## **Manhole Inspection Report**



Date: 10/04/2022 Weather: Coding: RZMACP

 MH#:
 M-103-016
 Owner:
 NA
 Len. Surveyed:
 8.4

 P.O.#:
 Surveyor:
 Jen Costello
 Rim to Invert:
 9.2

Customer: Cert. #: U-907-5518 Wall Material: Concrete (cast in

place)

Street: Alley between I-65 and Willow St. 5 Project: Hobart, IN

City:Hobart, INGPS Northing:2293950.788Location:Local Rural StreetsGPS Easting:2890599.438Drain Area:NorthwestGPS Accuracy:Sub-Meter


Cover Shape: Circular Evidence of Surcharge: No
Cover Size: 24.0 Potential for Runoff: None

Comments:

O&M Index:	2.00	O&M Quick:	2100	O&M Rating:	2.00
Structural Index:	1.00	Structural Quick:	1800	Structural Rating:	8.00
Overall Index:	1.11	Overall Quick:	2118	Overall Rating:	10.00


	Code	Observation	Video (sec)	Grade
103-016				
.0	MGO	General Observation	10	NA
0.	SRI	Surface Roughness Increased	21	S 1
2.7	MGO	General Observation	40	NA
8.4	DSF	Deposits Settled Fine	65	M 2
8.4	MGO	General Observation	76	NA
8.4	SRI	Surface Roughness Increased	88	S 1

Code:

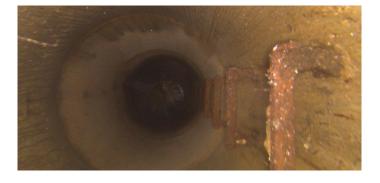

Description:	General Observation	
Distance (ft):	.0	
Structural Grade:	0	
O&M Grade:	0	
Clock Start/From:		
Clock To:		
1st Value:		
2nd Value:		
Value Percent:		
Step:	NO	
Remarks:	access mh	
nemarks.	access iiiii	

MGO

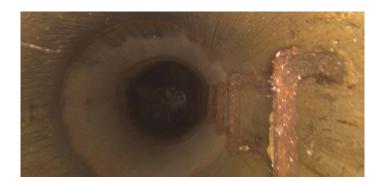

Code: SRI

Description: Surface Roughness Increased

Distance (ft): .0
Structural Grade: 1
O&M Grade: 0
Clock Start/From: 12
Clock To: 12
1st Value:

2nd Value: Value Percent:

Step: NO

Remarks:



Code: MGO

Description: General Observation

Distance (ft): 2.7
Structural Grade: 0
O&M Grade: 0
Clock Start/From:
Clock To:

1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: underside of frame



Code: **DSF** 

Description: Deposits Settled Fine

Distance (ft): 8.4
Structural Grade: 0
O&M Grade: 2
Clock Start/From: 12
Clock To: 12
1st Value:

1st Value: 2nd Value:

Value Percent: 10.000
Step: NO

Remarks:



Code: MGO

Description: General Observation

Distance (ft): 8.4
Structural Grade: 0

O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: end of survey



Code: SRI

Description: Surface Roughness Increased

Distance (ft): 8.4
Structural Grade: 1
O&M Grade: 0
Clock Start/From: 12
Clock To: 12
1st Value:
2nd Value:
Value Percent:

Step: NO

Remarks: