
Date:	04/16/2018	Weather:		Coding:	RZMACP
MH#:	M-103-134	Owner:	NA	Len. Surveyed:	6.2
P.O.#:		Surveyor:	John Kuglmaier	Rim to Invert:	7.5
Customer:		Cert. #:	U-1215-07002349	Wall Material:	Concrete (reinforced)
Street:	Alley / Mississippi St. and Swift St. 4 Project:		Hobart, IN		
City:	Hobart, IN	(GPS Northing:	2888931.313	
Location:		(GPS Easting:	2888931.313	
Drain Area:	Northwest	(GPS Accuracy:	Sub-Meter	
Cover Shape:	Circular	E	vidence of Surcharge:	No	
Cover Size: Comments:	23.0	F	Potential for Runoff:	None	
O&M Index:	2.00	O&M Quick:	2200	O&M Rating:	4.00
Structural Index:	0.00	Structural Quick		Oddivi Nating: Structural Rating:	0.00
Overall Index:	2.00	Overall Quick:	2200	Overall Rating:	4.00

Position	Code	Observation	Video (sec)	Grade
-103-134				
0.	MGP	General Photo	10	NA
1.6	MGP	General Photo	27	NA
4.4	DAZ	Deposits Attached Other	46	M 2
4.6	OBZ	Obstacle Other	58	M 2
5.5	MGO	General Observation	71	NA




Code: Description:	MGP General Photo
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	

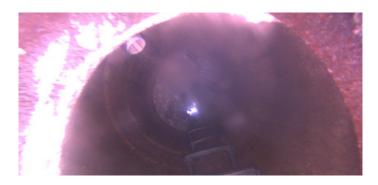

Code:MGPDescription:General Photo

Distance (ft):	1.6
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	

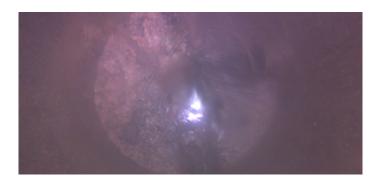

Code:	DAZ
Description:	Deposits Attached Other
Distance (ft):	
Distance (ft):	4.4
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	10.000
Step:	NO

Mixed materials



Code:	OBZ
Description:	Obstacle Other
Distance (ft):	4.6
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	7
Clock To:	3
1st Value:	
2nd Value:	
Value Percent:	5.000
Step:	NO
Remarks:	Metal rod

Remarks:



Code: Description:

MGO General Observation

Distance (ft):	5.5
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	Ins. Comp.