

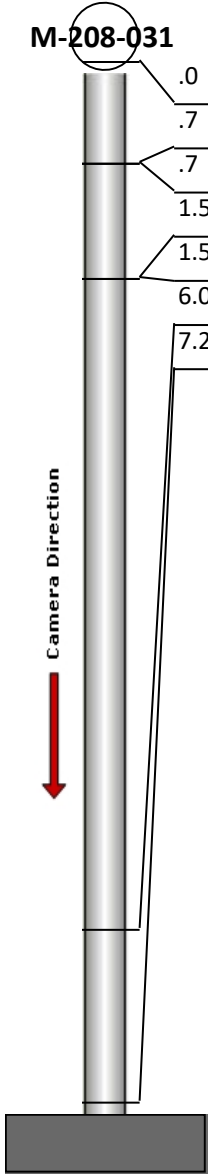
Manhole Inspection Report



Date:	03/26/2018	Weather:		Coding:	RZMACP
MH#:	M-208-031	Owner:	NA	Len. Surveyed:	7.2
P.O.#:		Surveyor:	Jen Costello	Rim to Invert:	12.1
Customer:		Cert. #:	U-907-5518	Wall Material:	Concrete (reinforced)

Street:	61st Ave. and Colorado St. To the N	Project:	Hobart, IN
City:	Hobart, IN	GPS Northing:	0.0
Location:		GPS Easting:	0.0
Drain Area:	Southwest	GPS Accuracy:	Nearest Meter
Cover Shape:	Circular	Evidence of Surcharge:	No
Cover Size:	22.5	Potential for Runoff:	None
Comments:			

O&M Index:	2.67	O&M Quick:	5121	O&M Rating:	8.00
Structural Index:	2.00	Structural Quick:	2100	Structural Rating:	2.00
Overall Index:	2.50	Overall Quick:	5122	Overall Rating:	10.00

	Position	Code	Observation	Video (sec)	Grade
	M-208-031				
	.0	MGO	General Observation	10	NA
	.7	RFB	Roots Fine Barrel	22	M 2
	.7	SSS	Surface Spalling	33	S 2
	1.5	MGP	General Photo	47	NA
	1.5	RFJ	Roots Fine Joint	57	M 1
	6.0	OBS	Obstacle Built Into Structure	79	M 5
	7.2	MSA	Abandoned Survey	93	NA



Code: **MGO**
Description: **General Observation**

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **ACCESS MH**



Code: **RFB**
Description: **Roots Fine Barrel**

Distance (ft): **.7**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **SSS**
Description: **Surface Spalling**

Distance (ft): **.7**
Structural Grade: **2**
O&M Grade: **0**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **MGP**
Description: **General Photo**

Distance (ft): **1.5**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **UNDERSIDE OF FRAME**



Code: **RFJ**
Description: **Roots Fine Joint**

Distance (ft): **1.5**
Structural Grade: **0**
O&M Grade: **1**
Clock Start/From: **6**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **OBS**
Description: **Obstacle Built Into Structure**

Distance (ft): **6.0**
Structural Grade: **0**
O&M Grade: **5**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent: **60.000**
Step: **NO**
Remarks:



Code: **MSA**
Description: **Abandoned Survey**

Distance (ft): **7.2**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **BLOCKED BY OBS**