
Date:	04/13/2018	Weather:		Coding:	RZMACP
MH#:	M-303-041	Owner:	NA	Len. Surveyed:	7.5
P.O.#:		Surveyor:	Jen Costello	Rim to Invert:	9.2
Customer:		Cert. #:	U-907-5518	Wall Material:	Concrete (reinforced)
Street:	Roche St. 398' Nor	th of 38th Ave.	Project:	Hobart, IN	
City:	Hobart, IN		GPS Northing:	0.0	
Location:			GPS Easting:	0.0	
Drain Area:	Northwest		GPS Accuracy:	Nearest Meter	
Cover Shape:	Circular		Evidence of Surcharge:	No	
Cover Size: Comments:	23.0		Potential for Runoff:	None	
O&M Index:	2.00	O&M Quick:	2100	O&M Rating:	2.00
Structural Index:	3.00	Structural Qu	iick: 3100	Structural Rating:	3.00
Overall Index:	2.50	Overall Quic	k: 3121	Overall Rating:	5.00

Position	Code	Observation	Video (sec)	Grade
03-041				
.0	MGO	General Observation	10	NA
.0	SAV	Surface Aggregate Visible	21	S 3
4.3	IS	Infil Stain	41	NA
6.6	DAE	Deposits Attached Encrustation	57	M 2
7.5	MGO	General Observation	71	NA



Code: Description:	MGO General Observation
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	ACCESS MH

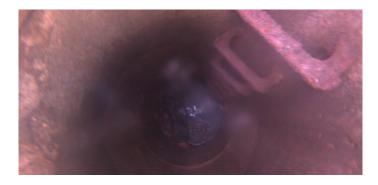

Code:SAVDescription:Surface Aggregate Visible

Distance (ft):	.0
Structural Grade:	3
O&M Grade:	0
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	



Code: Description:	IS Infil Stain
Distance (ft):	4.3
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	



Code:	DAE
Description:	Deposits Attached Encrustation
Distance (ft):	6.6
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	9
Clock To: 1st Value:	
2nd Value: Value Percent:	10.000
Step: Remarks:	NO



Code:MGODescription:General Observation

Distance (ft):	7.5
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	END SURVEY