Manhole Inspection Report



09/30/2022 Coding: Date: Weather: **RZMACP**

M-305-039 MH#: Owner: NA Len. Surveyed: 5.2 P.O.#: Surveyor: Jen Costello Rim to Invert: 5.7

U-907-5518 Concrete (cast in Customer: Cert. #: Wall Material:

place)

Street: North of Crab Apple Ln. 366' East of Project: Hobart, IN

City: Hobart, IN **GPS Northing:** 2288958.968 Location: Yard GPS Easting: 2894797.359 West Drain Area: GPS Accuracy: **Sub-Meter**

Cover Shape: Circular Evidence of Surcharge: No Cover Size: 24.0 Potential for Runoff: None

Comments:

2.00 2100 2.00 O&M Index: O&M Quick: O&M Rating: 1.57 3215 11.00 Structural Index: Structural Quick: Structural Rating: 13.00

1.63 3221 Overall Index: Overall Quick: Overall Rating:

John MGO General Observation O SRI Surface Roughness Increased O IW Infil Weeper 1.5 MGO General Observation 5.0 SAV Surface Aggregate Visible 5.0 SAV Surface Roughness Increased 5.0 MGO General Observation	10 21 32 49 69 80 92 103	NA S 1 M 2 NA S 3 S 3 S 1 NA
.0 MGO General Observation .0 SRI Surface Roughness Increased .0 IW Infil Weeper 1.5 MGO General Observation 5.0 SAV Surface Aggregate Visible 5.0 SAV Surface Aggregate Visible 5.0 SRI Surface Roughness Increased 5.0 MGO General Observation	21 32 49 69 80 92	S 1 M 2 NA S 3 S 3
1.5 MGO General Observation 5.0 SAV Surface Aggregate Visible 5.0 SAV Surface Aggregate Visible 5.0 SRI Surface Roughness Increased 5.0 MGO General Observation	32 49 69 80 92	M 2 NA S 3 S 3
1.5 MGO General Observation 5.0 SAV Surface Aggregate Visible 5.0 SAV Surface Aggregate Visible 5.0 SRI Surface Roughness Increased 5.0 MGO General Observation	49 69 80 92	NA S 3 S 3 S 1
5.0 SAV Surface Aggregate Visible 5.0 SAV Surface Aggregate Visible 5.0 SRI Surface Roughness Increased 5.0 MGO General Observation	69 80 92	S 3 S 3 S 1
5.0 SAV Surface Aggregate Visible 5.0 SRI Surface Roughness Increased 5.0 MGO General Observation	80 92	S 3 S 1
5.0 SRI Surface Roughness Increased 5.0 MGO General Observation	92	S 1
5.0 MGO General Observation		
	103	NA

Code:



Description:	General Observation
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	access mh

MGO



Code: SRI

Description: Surface Roughness Increased

Distance (ft): .0
Structural Grade: 1
O&M Grade: 0
Clock Start/From: 12
Clock To: 12
1st Value:

2nd Value: Value Percent:

Step: NO

Remarks:




Code: IW

Description: Infil Weeper

Distance (ft): .0
Structural Grade: 0
O&M Grade: 2
Clock Start/From: 12
Clock To: 12
1st Value:
2nd Value:
Value Percent:

Step: NO

Remarks:

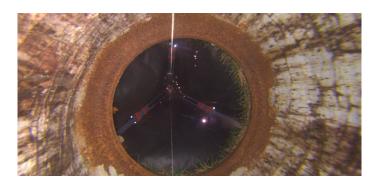

Code: MGO

Description: General Observation

Distance (ft): 1.5
Structural Grade: 0
O&M Grade: 0
Clock Start/From:
Clock To:
1st Value:

2nd Value: Value Percent:

Step: NO

Remarks: underside of frame



Code: SAV

Description: Surface Aggregate Visible

Distance (ft): 5.0
Structural Grade: 3
O&M Grade: 0
Clock Start/From: 12
Clock To: 12
1st Value:

2nd Value: Value Percent:

Step: NO

Remarks:



Code: SAV

Description: Surface Aggregate Visible

Distance (ft): 5.0
Structural Grade: 3
O&M Grade: 0
Clock Start/From: 3
Clock To: 9
1st Value:
2nd Value:

Step: NO

Remarks:

Value Percent:



Code: SRI

Description: Surface Roughness Increased

Distance (ft): 5.0
Structural Grade: 1
O&M Grade: 0
Clock Start/From: 12
Clock To: 12
1st Value:
2nd Value:
Value Percent:
Step: NO

.

Remarks:



Code: MGO

Description: General Observation

Distance (ft): 5.0
Structural Grade: 0
O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: end of survey