
## **Manhole Inspection Report**

Date:	05/14/2018	Weather:		Coding:	RZMACP
MH#:	M-504-010	Owner:	NA	Len. Surveyed:	-
P.O.#:		Surveyor:	Jen Costello	Rim to Invert:	9.7
Customer:		Cert. #:	U-907-5518	Wall Material:	Brick
Street:	44th Ave. 175' We	est of California St.	Project:	Hobart, IN	
City:	Hobart, IN		GPS Northing:	41.53821564	
Location:			GPS Easting:	-87.27120972	
Drain Area:	West		GPS Accuracy:	Nearest Meter	
Cover Shape:	Circular		Evidence of Surcharge:	Yes	
Cover Size:	22.5		Potential for Runoff:	None	
Comments:					
O&M Index:	3.00	O&M Quick:	4121	O&M Rating:	6.00
Structural Index:	0.00	Structural Qui	ick: 0000	Structural Rating:	0.00
Overall Index:	3.00	Overall Quick		Overall Rating:	6.00


RedZone

Position	Code	Observation	Video (sec)	Grade
1-504-010				
0.	MGO	General Observation	10	NA
1.7	MGO	General Observation	27	NA
8.2	DSF	Deposits Settled Fine	53	M 2
9.9	RMB	Roots Medium Barrel	68	M 4
9.9	MGO	General Observation	79	NA
Camera Direction				

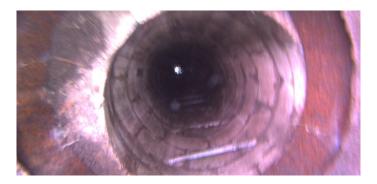

Code: Description:	MGO General Observation
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	ACCESS MH

\_\_\_\_

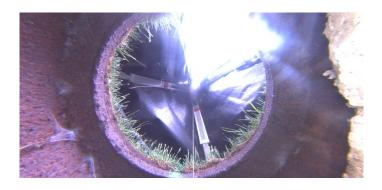

Code:	MGO
Description:	<b>General Observation</b>
Distance (ft):	1.7
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	END SURVEY

DSF



Coue.	D3F
Description:	<b>Deposits Settled Fine</b>
Distance (ft):	8.2
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	10.000
Step:	NO
Remarks:	

Code:



Code:	RMB
Description:	<b>Roots Medium Barrel</b>
Distance (ft):	9.9
Structural Grade:	0
O&M Grade:	4
Clock Start/From:	12
Clock To:	6
1st Value:	
2nd Value:	
Value Percent:	10.000
Step:	NO
Remarks:	



Description: **General Observation** Distance (ft): 9.9 Structural Grade: 0 O&M Grade: 0 Clock Start/From: Clock To: 1st Value: 2nd Value: Value Percent: Step: NO Remarks: END SURVEY

MGO

Code: