


Manhole Inspection Report



Date:	05/13/2018	Weather:		Coding:	RZMACP
MH#:	M-504-025	Owner:	NA	Len. Surveyed:	14.4
P.O.#:		Surveyor:	Jen Costello	Rim to Invert:	14.0
Customer:		Cert. #:	U-907-5518	Wall Material:	Concrete (reinforced)

Street:	45th Ave. 229' West of Colorado St.	Project:	Hobart, IN
City:	Hobart, IN	GPS Northing:	41.53644562
Location:		GPS Easting:	-87.27500153
Drain Area:	West	GPS Accuracy:	Nearest Meter
Cover Shape:	Circular	Evidence of Surcharge:	No
Cover Size:	22.5	Potential for Runoff:	None
Comments:			

O&M Index:	2.00	O&M Quick:	2200	O&M Rating:	4.00
Structural Index:	3.00	Structural Quick:	3A00	Structural Rating:	39.00
Overall Index:	2.87	Overall Quick:	3A22	Overall Rating:	43.00

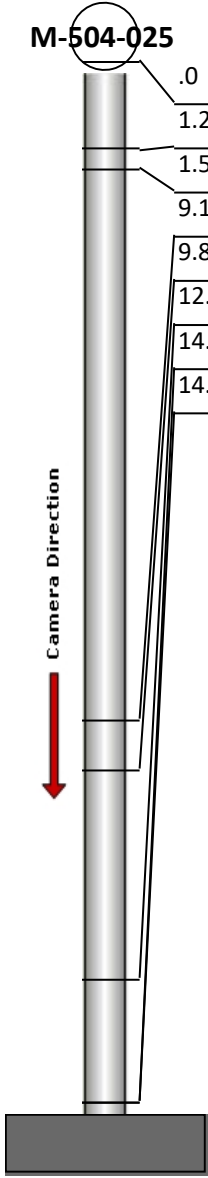	Position	Code	Observation	Video (sec)	Grade
	.0	MGO	General Observation	10	NA
	1.2	SAV	Surface Aggregate Visible	23	S 3
	1.5	MGO	General Observation	37	NA
	9.1	DAR	Deposits Attached Ragging	65	M 2
	9.8	MGO	General Observation	78	NA
	12.7	DSF	Deposits Settled Fine	96	M 2
	14.4	MGO	General Observation	111	NA
	14.4	SAV	Surface Aggregate Visible	122	S 3




Code: **MGO**
Description: **General Observation**

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **ACCESS MH**



Code:	SAV
Description:	Surface Aggregate Visible
Distance (ft):	1.2
Structural Grade:	3
O&M Grade:	0
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	

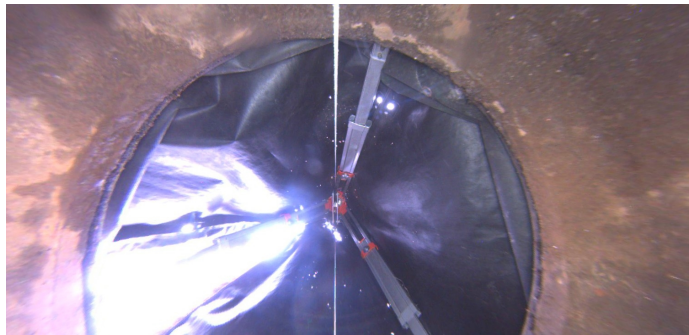

Code:	MGO
Description:	General Observation
Distance (ft):	1.5
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	UNDERSIDE OF FRAME



Code:	DAR
Description:	Deposits Attached Ragging
Distance (ft):	9.1
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	12
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	5.000
Step:	YES
Remarks:	



Code: **MGO**
Description: **General Observation**

Distance (ft): **9.8**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **YES**
Remarks: **BROKEN STEP**



Code: **DSF**
Description: **Deposits Settled Fine**

Distance (ft): **12.7**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent: **5.000**
Step: **NO**
Remarks:



Code: **MGO**
Description: **General Observation**

Distance (ft): **14.4**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **END SURVEY**



Code:	SAV
Description:	Surface Aggregate Visible
Distance (ft):	14.4
Structural Grade:	3
O&M Grade:	0
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	