Manhole Inspection Report



 Date:
 05/15/2018
 Weather:
 Coding:
 RZMACP

 MH#:
 M-504-070
 Owner:
 NA
 Len. Surveyed:
 13.0

 MH#:
 M-504-070
 Owner:
 NA
 Len. Surveyed:
 13.0

 P.O.#:
 Surveyor:
 Jen Costello
 Rim to Invert:
 15.0

 Customer:
 Cert. #:
 U-907-5518
 Wall Material:
 Brick

Street: **165' North of Ridge Rd. 164' East of** Project: **Hobart, IN**

City: Hobart, IN GPS Northing: 41.54023361
Location: GPS Easting: -87.27128601

Drain Area: Northwest GPS Accuracy: Nearest Meter

Cover Shape: Circular Evidence of Surcharge: No
Cover Size: Potential for Runoff: None

Comments:

O&M Index:	2.00	O&M Quick:	2100	O&M Rating:	2.00
Structural Index:	3.00	Structural Quick:	3A00	Structural Rating:	36.00
Overall Index:	2.92	Overall Quick:	3A21	Overall Rating:	38.00

Wednesday, May 3, 2023

	Position	Code	Observation	Video (sec)	Grade
1-504-0	70				
	0.	MGO	General Observation	10	NA
ш	1.3	MGO	General Observation	26	NA
н	<u></u>	SAV	Surface Aggregate Visible	39	S 3
ш	11.5	RPP	Repair Patch	71	NA
ш	13.0	DSF	Deposits Settled Fine	85	M 2
ш	13.0	MGO	General Observation	96	NA
-11	13.0	SAV	Surface Aggregate Visible	107	S 3
<u> </u>					
Camera Direction					




Code: MGO

Description: General Observation

Distance (ft): .0
Structural Grade: 0
O&M Grade: 0
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:

Step: NO

Remarks: ACCESS MH

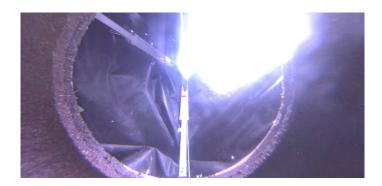

Code: MGO

Description: General Observation

Distance (ft): 1.3
Structural Grade: 0
O&M Grade: 0
Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: UNDERSIDE OF FRAME



Code: SAV

Description: Surface Aggregate Visible

Distance (ft): 1.3
Structural Grade: 3
O&M Grade: 0
Clock Start/From: 12
Clock To: 12
1st Value:
2nd Value:
Value Percent:

Step: NO

Remarks:



Code: RPP

Description: Repair Patch

Distance (ft): 11.5
Structural Grade: 0
O&M Grade: 0
Clock Start/From: 9
Clock To: 1st Value:

Value Percent:

2nd Value:

Step: NO Remarks: VCP

Wednesday, May 3, 2023



Code: **DSF**

Description: Deposits Settled Fine

Distance (ft): 13.0
Structural Grade: 0
O&M Grade: 2
Clock Start/From: 12
Clock To: 12

1st Value: 2nd Value:

Value Percent: 5.000 Step: NO

Remarks:



Code: MGO

Description: General Observation

Distance (ft): 13.0
Structural Grade: 0
O&M Grade: 0
Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: END SURVEY



Code: SAV

Description: Surface Aggregate Visible

Distance (ft): 13.0
Structural Grade: 3
O&M Grade: 0
Clock Start/From: 12
Clock To: 12
1st Value:
2nd Value:

Value Percent:

Step: NO

Remarks:

Wednesday, May 3, 2023