

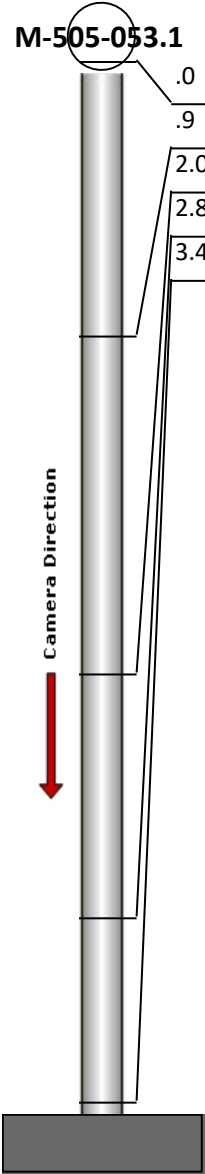
Manhole Inspection Report



Date:	05/01/2018	Weather:		Coding:	RZMACP
MH#:	M-505-053.1	Owner:	NA	Len. Surveyed:	3.4
P.O.#:		Surveyor:	Jen Costello	Rim to Invert:	3.4
Customer:		Cert. #:	U-907-5518	Wall Material:	Concrete (reinforced)

Street:	Colorado St. 397' South of 2nd St.	Project:	Hobart, IN
City:	Hobart, IN	GPS Northing:	41.53353119
Location:		GPS Easting:	-87.27409363
Drain Area:	West	GPS Accuracy:	Nearest Meter
Cover Shape:	Circular	Evidence of Surcharge:	No
Cover Size:	22.5	Potential for Runoff:	None
Comments:			

O&M Index:	2.00	O&M Quick:	2100	O&M Rating:	2.00
Structural Index:	4.00	Structural Quick:	4200	Structural Rating:	8.00
Overall Index:	3.33	Overall Quick:	4221	Overall Rating:	10.00

	Position	Code	Observation	Video (sec)	Grade
M-505-053.1					
	.0	MGO	General Observation	10	NA
	.9	FM	Fracture Multiple	23	S 4
	2.0	B	Broken	37	S 4
	2.8	DSF	Deposits Settled Fine	49	M 2
	3.4	MGO	General Observation	61	NA



Code: **MGO**
Description: **General Observation**

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **ACCESS MH**



Code: **FM**
Description: **Fracture Multiple**

Distance (ft): **.9**
Structural Grade: **4**
O&M Grade: **0**
Clock Start/From: **8**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **B**
Description: **Broken**

Distance (ft): **2.0**
Structural Grade: **4**
O&M Grade: **0**
Clock Start/From: **8**
Clock To: **9**
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **DSF**
Description: **Deposits Settled Fine**

Distance (ft): **2.8**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent: **5.000**
Step: **NO**
Remarks:



Code:	MGO
Description:	General Observation
Distance (ft):	3.4
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	END SURVEY