

Manhole Inspection Report



Date:	04/24/2018	Weather:		Coding:	RZMACP
MH#:	M-507-039.6	Owner:	NA	Len. Surveyed:	5.2
P.O.#:		Surveyor:	Jen Costello	Rim to Invert:	5.6
Customer:		Cert. #:	U-907-5518	Wall Material:	Concrete (reinforced)

Street:	499' East of Decatur St. North of 10t	Project:	Hobart, IN
City:	Hobart, IN	GPS Northing:	2900784.319
Location:		GPS Easting:	2900784.319
Drain Area:	Southwest	GPS Accuracy:	Sub-Meter
Cover Shape:	Circular	Evidence of Surcharge:	No
Cover Size:	26.0	Potential for Runoff:	None
Comments:			


O&M Index:	2.00	O&M Quick:	2100	O&M Rating:	2.00
Structural Index:	3.33	Structural Quick:	4132	Structural Rating:	10.00
Overall Index:	3.00	Overall Quick:	4132	Overall Rating:	12.00

Position	Code	Observation	Video (sec)	Grade
<div> <div> <div>M-507-039.6</div> <div> <div>Camera Direction</div> <div></div> </div> </div> <div> <div></div> <div></div> <div></div> <div></div> <div></div> <div></div> </div> </div>				
.0	MGO	General Observation	10	NA
.0	FM	Fracture Multiple	20	S 4
.0	SAP	Surface Aggregate Projecting	30	S 3
1.2	MGO	General Observation	45	NA
1.6	SAV	Surface Aggregate Visible	59	S 3
5.2	DSF	Deposits Settled Fine	77	M 2




Code: **MGO**
Description: **General Observation**

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **ACCESS MH**

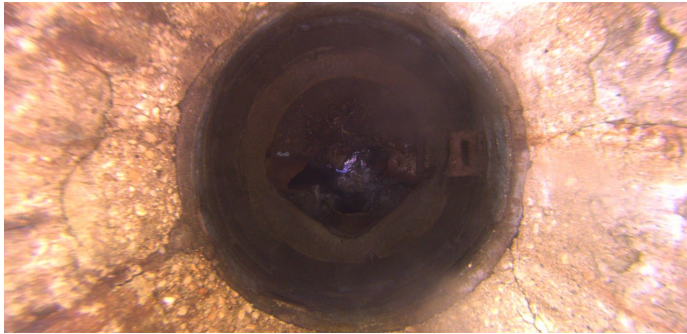

Code: **FM**
Description: **Fracture Multiple**

Distance (ft): **.0**
Structural Grade: **4**
O&M Grade: **0**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:

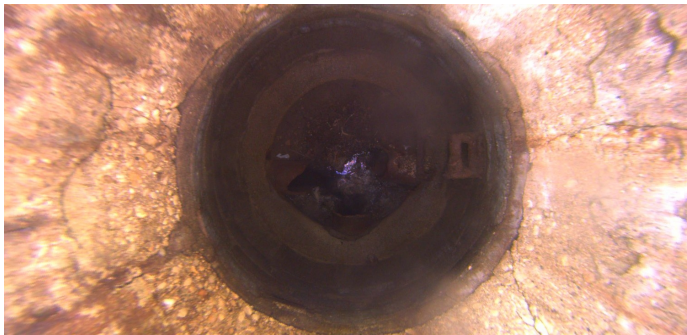

Code: **SAP**
Description: **Surface Aggregate Projecting**

Distance (ft): **.0**
Structural Grade: **3**
O&M Grade: **0**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **MGO**
Description: **General Observation**

Distance (ft): **1.2**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **UNDERSIDE OF FRAME**



Code:	SAV
Description:	Surface Aggregate Visible
Distance (ft):	1.6
Structural Grade:	3
O&M Grade:	0
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	



Code:	DSF
Description:	Deposits Settled Fine
Distance (ft):	5.2
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	5.000
Step:	NO
Remarks:	