

## RedZone **Manhole Inspection Report** ROBOTICS Date: 05/13/2018 Coding: RZMACP Weather: M-604-054 MH#: Owner: NA Len. Surveyed: 11.2 P.O.#: Jen Costello Rim to Invert: Surveyor: 12.0 U-907-5518 Wall Material: Brick Customer: Cert. #: Connecticut St. 188' North of Ridge Hobart, IN Street: Project: City: Hobart, IN **GPS Northing:** 2902739.349 Location: **GPS Easting:** 2902739.349 Drain Area: Northwest **GPS Accuracy:** Sub-Meter Cover Shape: Circular Evidence of Surcharge: No Cover Size: 22.5 Potential for Runoff: None Comments: 2.00 2100 2.00 O&M Index: O&M Quick: **O&M** Rating: 7.00 3.50 Structural Quick: Structural Index: Structural Rating: 9.00 **Overall Index:** 3.00 **Overall Quick:** Overall Rating:

1 0510	ion Code	Observation	Video (sec)	Grade
604-054				
.0	MGP	General Photo	10	NA
1.8	MGO	General Observation	27	NA
/2.1	В	Broken	42	S 4
9.4	SAV	Surface Aggregate Visible	68	S 3
11.1	OBZ	Obstacle Other	83	M 2
11.2	MGO	General Observation	95	NA

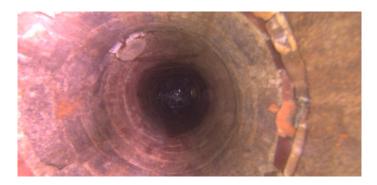

Code:	MGP
Description:	General Photo
	_
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	access MH

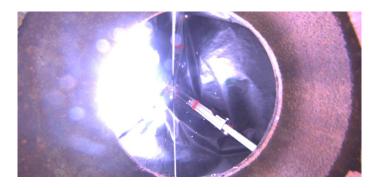

Code:	MGO
Description:	General Observation
Distance (ft):	1.8
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	UNDERSIDE OF FRAME



Code: Description:	B Broken	
Distance (ft): Structural Grade: O&M Grade: Clock Start/From: Clock To: 1st Value: 2nd Value: Value Percent:	2.1 4 0 10 11	
Step: Remarks:	NO	



Code: Description:	SAV Surface Aggregate Visible
Distance (ft):	9.4
Structural Grade:	3
O&M Grade:	0
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	



Code: O Description: O

Code:

OBZ Obstacle Other

Distance (ft):	11.1
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	10
Clock To:	2
1st Value:	
2nd Value:	
Value Percent:	5.000
Step:	NO
Remarks:	PAPER PRODUCTS



Description:	<b>General Observation</b>
Distance (ft):	11.2
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	END SURVEY

MGO