

| Date: | 04/26/2018 | Weather: | | Coding: | RZMACP |
|--------------------------|--------------------|------------------|------------------------|--------------------|--------------------------|
| MH#: | M-606-076 | Owner: | NA | Len. Surveyed: | 15.5 |
| P.O.#: | | Surveyor: | Jen Costello | Rim to Invert: | 15.0 |
| Customer: | | Cert. #: | U-907-5518 | Wall Material: | Concrete (reinforced) |
| Street: | Hollywood Blvd. 13 | 7' South of Lake | Project: | Hobart, IN | |
| City: | Hobart, IN | | GPS Northing: | 2902862.97 | |
| Location: | | | GPS Easting: | 2902862.97 | |
| Drain Area: | Southwest | | GPS Accuracy: | Sub-Meter | |
| Cover Shape: | Circular | | Evidence of Surcharge: | Νο | |
| Cover Size: Comments: | 22.5 | | Potential for Runoff: | None | |
| O&M Index: | 2.00 | O&M Quick: | 2100 | O&M Rating: | 2.00 |
| Structural Index: | 3.00 | Structural Qu | iick: 3A00 | Structural Rating: | 42.00 |
| Overall Index: | 2.93 | Overall Quicl | k: 3A21 | Overall Rating: | 44.00 |

| Position | Code | Observation | Video (sec) | Grade |
|----------|------|------------------------------|-------------|-------|
| 506-076 | | | | |
| .0 | MGO | General Observation | 10 | NA |
| 1.8 | MGO | General Observation | 27 | NA |
| 2.5 | SAV | Surface Aggregate Visible | 42 | S 3 |
| 3.2 | IS | Infil Stain | 55 | NA |
| 14.2 | OBB | Obstacle Brick | 88 | M 2 |
| 15.5 | SAV | Surface Aggregate Visible | 102 | S 3 |
| 15.5 | SAP | Surface Aggregate Projecting | 113 | S 3 |
| | | | | |
| | | | | |

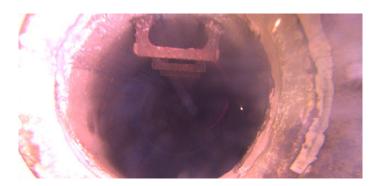

| Code: Description: | MGO General Observation |
|-----------------------|----------------------------|
| Distance (ft): | .0 |
| Structural Grade: | 0 |
| O&M Grade: | 0 |
| Clock Start/From: | |
| Clock To: | |
| 1st Value: | |
| 2nd Value: | |
| Value Percent: | |
| Step: | NO |
| Remarks: | ACCESS MH |

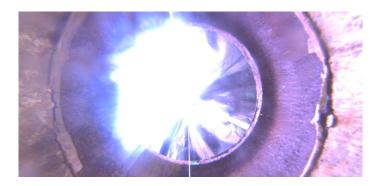

| Code: | MGO |
|-------------------|---------------------|
| Description: | General Observation |
| | |
| | |
| Distance (ft): | 1.8 |
| Structural Grade: | 0 |
| O&M Grade: | 0 |
| Clock Start/From: | |
| Clock To: | |
| 1st Value: | |
| 2nd Value: | |
| Value Percent: | |
| Step: | NO |
| Remarks: | UNDERSIDE OF FRAME |
| | |

SAV



| Description: | Surface Aggregate Visible |
|-------------------|---------------------------|
| Distance (ft): | 2.5 |
| Structural Grade: | 3 |
| O&M Grade: | 0 |
| Clock Start/From: | 12 |
| Clock To: | 12 |
| 1st Value: | |
| 2nd Value: | |
| Value Percent: | |
| Step: | NO |
| Remarks: | |
| | |

Code:



| Code: | IS |
|-------------------|-------------|
| Description: | Infil Stain |
| | |
| | |
| Distance (ft): | 3.2 |
| Structural Grade: | 0 |
| O&M Grade: | 0 |
| Clock Start/From: | 10 |
| Clock To: | 2 |
| 1st Value: | |
| 2nd Value: | |
| Value Percent: | |
| Step: | NO |
| Remarks: | |



| Code: | OBB |
|-------------------|-----------------------|
| Description: | Obstacle Brick |
| | |
| | |
| Distance (ft): | 14.2 |
| Structural Grade: | 0 |
| O&M Grade: | 2 |
| Clock Start/From: | 12 |
| Clock To: | |
| 1st Value: | |
| 2nd Value: | |
| Value Percent: | 5.000 |
| Step: | NO |
| Remarks: | |

Code:



| Surface Aggregate Visible |
|---------------------------|
| |
| 15.5 |
| 3 |
| D |
| 12 |
| 12 |
| |
| |
| |
| NO |
| |
| |

SAV



| Code: Description: | SAP Surface Aggregate Projecting |
|-----------------------|-------------------------------------|
| Distance (ft): | 15.5 |
| Structural Grade: | 3 |
| O&M Grade: | 0 |
| Clock Start/From: | 9 |
| Clock To: | 3 |
| 1st Value: | |
| 2nd Value: | |
| Value Percent: | |
| Step: | NO |
| Remarks: | |