
Date:	04/04/2018	Weather:		Coding:	RZMACP
MH#:	M-607-050	Owner:	NA	Len. Surveyed:	9.6
P.O.#:		Surveyor:	John Kuglmaier	Rim to Invert:	10.6
Customer:		Cert. #:	U-1215-07002349	Wall Material:	Concrete (reinforced)
Street:	Medlee Dr. 4th Ma	nhole South of N	Project:	Hobart, IN	
City:	Hobart, IN	(GPS Northing:	0.0	
Location:		(GPS Easting:	0.0	
Drain Area:	Southwest	(GPS Accuracy:	Nearest Meter	
Cover Shape:	Circular	I	Evidence of Surcharge:	No	
Cover Size: Comments:	22.5	I	Potential for Runoff:	None	
O&M Index:	2.50	O&M Quick:	3121	O&M Rating:	5.00
Structural Index:	0.00	Structural Quid	ck: 0000	Structural Rating:	0.00
Overall Index:	2.50	Overall Quick:	3121	Overall Rating:	5.00





Code:	MGP
Description:	General Photo
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	

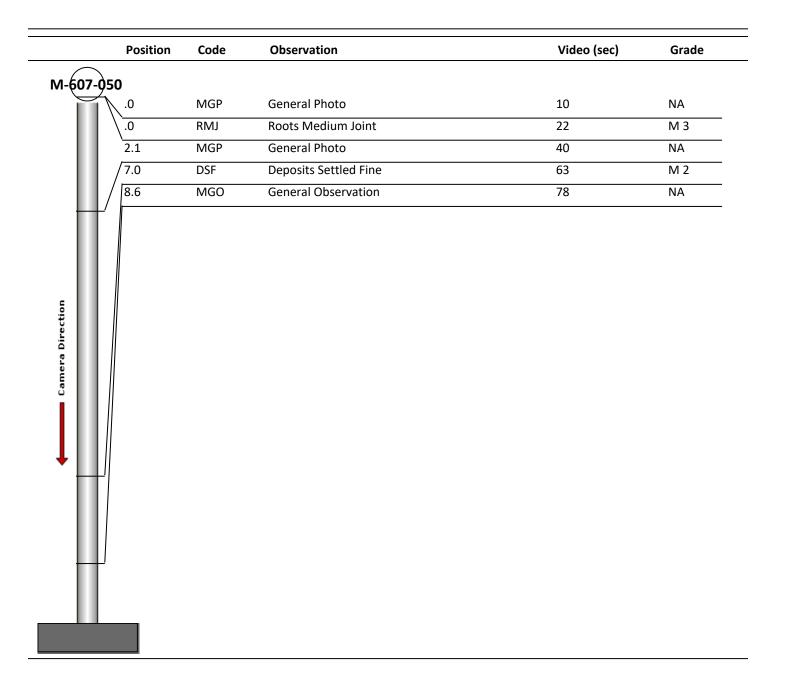

Code: RMJ Description: **Roots Medium Joint** Distance (ft): .0 Structural Grade: 0 O&M Grade: 3 Clock Start/From: 12 Clock To: 12 1st Value: 2nd Value:

Value Percent:

Step:

Remarks:

Code: Description:	MGP General Photo
Distance (ft):	2.1
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	

5.000

NO



Code:	DSF
Description:	Deposits Settled Fine
Distance (ft):	7.0
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	10.000
Step:	NO
Remarks:	



Code: Description: MGO General Observation

Distance (ft):	8.6	
Structural Grade:	0	
O&M Grade:	0	
Clock Start/From:		
Clock To:		
1st Value:		
2nd Value:		
Value Percent:		
Step:	NO	
Remarks:	Ins. Comp.	