Manhole Inspection Report



Date: 04/08/2018 Weather: Coding: RZMACP

MH#: M-608-014 Owner: NA Len. Surveyed: 6.7
P.O.#: Surveyor: John Kuglmaier Rim to Invert: 7.4

Customer: Cert. #: U-1215-07002349 Wall Material: Concrete

(reinforced)

Street: On the West Side of West 61st St. 13 Project: Hobart, IN

City: Hobart, IN GPS Northing: 2903320.377

Location: GPS Easting: 2903320.377

Drain Area: Southwest GPS Accuracy: Sub-Meter

Cover Shape: Circular Evidence of Surcharge: Yes

Cover Size: Potential for Runoff: None

Comments:

 O&M Index:
 2.00
 O&M Quick:
 2100
 O&M Rating:
 2.00

 Structural Index:
 3.00
 Structural Quick:
 3500
 Structural Rating:
 15.00

Overall Index: 2.83 Overall Quick: 3521 Overall Rating: 17.00

Wednesday, May 3, 2023

| Position | Code | Observation | Video (sec) | Grade |
|----------|------|---------------------------|-------------|-------|
| -608-014 | | | | |
| 0. | MGP | General Photo | 10 | NA |
| 0. | SAV | Surface Aggregate Visible | 22 | S 3 |
| 1.5 | IS | Infil Stain | 37 | NA |
| /2.6 | MGP | General Photo | 53 | NA |
| 4.4 | DAZ | Deposits Attached Other | 70 | M 2 |
| 5.1 | SAV | Surface Aggregate Visible | 83 | S 3 |
| 5.4 | MGO | General Observation | 96 | NA |
| | | | | |



| Description: | General Photo |
|-------------------|---------------|
| Distance (ft): | .0 |
| Structural Grade: | 0 |
| O&M Grade: | 0 |
| Clock Start/From: | |
| Clock To: | |
| 1st Value: | |
| 2nd Value: | |
| Value Percent: | |
| Step: | NO |
| Remarks: | |
| | |

MGP

Wednesday, May 3, 2023

Code:



Code: SAV

Description: Surface Aggregate Visible

Distance (ft): .0
Structural Grade: 3
O&M Grade: 0
Clock Start/From: 12
Clock To: 12
1st Value:

1st Value: 2nd Value: Value Percent:

Step: NO

Remarks:



Code: IS


Description: Infil Stain

Distance (ft): 1.5
Structural Grade: 0
O&M Grade: 0
Clock Start/From: 1
Clock To:
1st Value:

2nd Value: Value Percent:

Step: NO

Remarks:

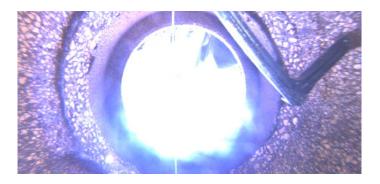

Code: MGP

Description: General Photo

Distance (ft): 2.6
Structural Grade: 0
O&M Grade: 0
Clock Start/From:
Clock To:
1st Value:
2nd Value:

Step: NO

Remarks:

Value Percent:

Wednesday, May 3, 2023 3



Code: DAZ

Description: Deposits Attached Other

Distance (ft): 4.4
Structural Grade: 0
O&M Grade: 2
Clock Start/From: 12
Clock To: 12

1st Value: 2nd Value:

Value Percent: 5.000 Step: NO

Remarks: Mixed materials



Code: SAV

Description: Surface Aggregate Visible

Distance (ft): 5.1
Structural Grade: 3

O&M Grade: 0

Clock Start/From: 12

Clock To: 12

1st Value:

2nd Value: Value Percent:

Step: NO

Remarks:



Code: MGO

Description: General Observation

Distance (ft): 5.4
Structural Grade: 0
O&M Grade: 0
Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: Ins. Comp.

Wednesday, May 3, 2023 4