
Date:	04/18/2018	Weather:		Coding:	RZMACP
MH#:	M-708-001	Owner:	NA	Len. Surveyed:	6.2
P.O.#:		Surveyor:	John Kuglmaier	Rim to Invert:	6.3
Customer:		Cert. #:	U-1215-07002349	Wall Material:	Concrete (reinforced)
Street:	Lincoln St. 193' No	rth of Hidden Oak	Project:	Hobart, IN	
City:	Hobart, IN	(GPS Northing:	2906578.344	
Location:		(GPS Easting:	2906578.344	
Drain Area:	Southeast	(GPS Accuracy:	Sub-Meter	
Cover Shape:	Circular	E	Evidence of Surcharge:	No	
Cover Size: Comments:	22.5	ſ	Potential for Runoff:	None	
O&M Index:	3.00	O&M Quick:	3100	O&M Rating:	3.00
Structural Index:	0.00	Structural Quid	ck: 0000	Structural Rating:	0.00
Overall Index:	3.00	Overall Quick:	3100	Overall Rating:	3.00

Position	Code	Observation	Video (sec)	Grade
708-001				
0.	MGP	General Photo	10	NA
.9	IS	Infil Stain	23	NA
2.3	MGP	General Photo	40	NA
3.3	DAZ	Deposits Attached Other	55	M 3
5.5	MGO	General Observation	71	NA



Code:	MGP
Description:	General Photo
	_
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	

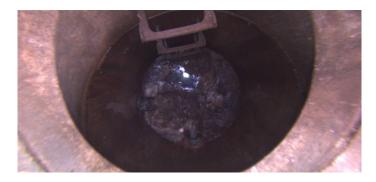


Code:	IS
Description:	Infil Stain
Distance (ft):	.9
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	



Code: Description:	MGP General Photo
Distance (ft): Structural Grade: O&M Grade: Clock Start/From: Clock To: 1st Value: 2nd Value: Value Percent:	2.3 0 0
Step: Remarks:	ΝΟ



Code: Description:	DAZ Deposits Attached Other
Distance (ft):	3.3
Structural Grade:	0
O&M Grade:	3
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	20.000
Step:	NO
Remarks:	Mixed materials

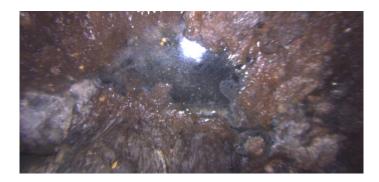

Code:MGODescription:General Observation

Distance (ft):	5.5	
Structural Grade:	0	
O&M Grade:	0	
Clock Start/From:		
Clock To:		
1st Value:		
2nd Value:		
Value Percent:		
Step:	NO	
Remarks:	Ins. Comp.	