


Manhole Inspection Report




Date:	04/10/2018	Weather:		Coding:	RZMACP
MH#:	M-708-115	Owner:	NA	Len. Surveyed:	3.6
P.O.#:		Surveyor:	John Kuglmaier	Rim to Invert:	7.2
Customer:		Cert. #:	U-1215-07002349	Wall Material:	Concrete (reinforced)

Street:	Bracken Pky. and Capitol Dr. Northw	Project:	Hobart, IN
City:	Hobart, IN	GPS Northing:	2906957.701
Location:		GPS Easting:	2906957.701
Drain Area:	Southwest	GPS Accuracy:	Sub-Meter
Cover Shape:	Circular	Evidence of Surcharge:	Yes
Cover Size:	22.5	Potential for Runoff:	None
Comments:			

O&M Index:	5.00	O&M Quick:	5100	O&M Rating:	5.00
Structural Index:	0.00	Structural Quick:	0000	Structural Rating:	0.00
Overall Index:	5.00	Overall Quick:	5100	Overall Rating:	5.00

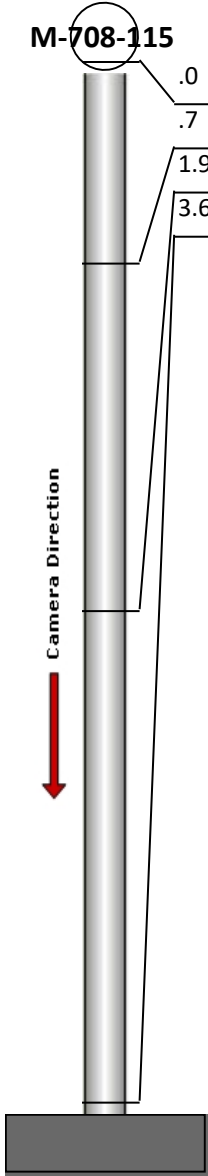	Position	Code	Observation	Video (sec)	Grade
	.0	MGP	General Photo	10	NA
	.7	OBZ	Obstacle Other	23	M 5
	1.9	MGP	General Photo	39	NA
	3.6	MGO	General Observation	56	NA

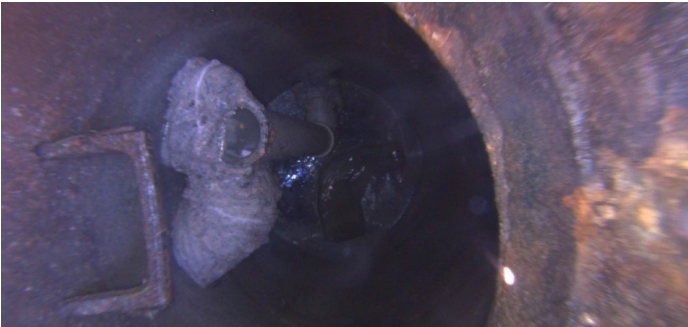

Code:

MGP

Description:

General Photo

Distance (ft):

.0

Structural Grade:

0

O&M Grade:

0

Clock Start/From:

Clock To:

1st Value:

2nd Value:

Value Percent:

Step:

NO

Remarks:



Code: **OBZ**
Description: **Obstacle Other**

Distance (ft): **.7**
Structural Grade: **0**
O&M Grade: **5**
Clock Start/From: **7**
Clock To: **10**
1st Value:
2nd Value:
Value Percent: **35.000**
Step: **YES**
Remarks: **Mixed materials**



Code: **MGP**
Description: **General Photo**

Distance (ft): **1.9**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **MGO**
Description: **General Observation**

Distance (ft): **3.6**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **Ins. Comp.**