Manhole Inspection Report



Date: 09/21/2022 Weather: Coding: RZMACP

 MH#:
 M-708-128
 Owner:
 NA
 Len. Surveyed:
 4.8

 P.O.#:
 Surveyor:
 Jen Costello
 Rim to Invert:
 5.7

Customer: Cert. #: U-907-5518 Wall Material: Concrete (cast in

place)

Street: Azalea Dr. 77' East of Redbud Dr. Project: Hobart, IN
City: Hobart, IN GPS Northing: 2280320.261

Location: Local Rural Streets GPS Easting: 2905391.672

Drain Area: Southwest GPS Accuracy: Sub-Meter

Cover Shape: Circular Evidence of Surcharge: No
Cover Size: 24.0 Potential for Runoff: None

Comments:

O&M Index:	2.00	O&M Quick:	2100	O&M Rating:	2.00
Structural Index:	1.00	Structural Quick:	1600	Structural Rating:	6.00
Overall Index:	1.14	Overall Quick:	2116	Overall Rating:	8.00

Position	Code	Observation	Video (sec)	Grade
8-128				
.0	MGO	General Observation	10	NA
0.	SRI	Surface Roughness Increased	21	S 1
2.1	MGO	General Observation	39	NA
4.6	DSF	Deposits Settled Fine	58	M 2
4.6	SRI	Surface Roughness Increased	69	S 1
4.6	SRI	Surface Roughness Increased	80	S 1
4.6	MGO	General Observation	91	NA

Code:



Description:	General Observation	
Distance (ft):	.0	
Structural Grade:	0	
O&M Grade:	0	
Clock Start/From:		
Clock To:		
1st Value:		
2nd Value:		
Value Percent:		
Step:	NO	
Remarks:	access mh	

MGO



Code: SRI

Description: Surface Roughness Increased


Distance (ft): .0
Structural Grade: 1
O&M Grade: 0
Clock Start/From: 12
Clock To: 12
1st Value:

2nd Value: Value Percent:

Step: NO

Remarks:

2nd Value:

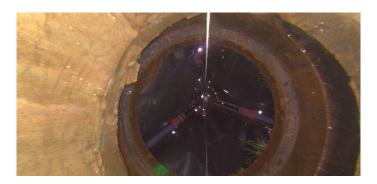

Code: MGO

Description: General Observation

Distance (ft):

Structural Grade:

O&M Grade:

Clock Start/From:

Clock To:

1st Value:

Value Percent: Step: **NO**

Remarks: underside of frame



Code: **DSF**

Description: Deposits Settled Fine

Distance (ft): 4.6
Structural Grade: 0
O&M Grade: 2
Clock Start/From: 12
Clock To: 12
1st Value:

2nd Value:

Value Percent: 5.000 Step: NO

Remarks:



Code: SRI

Description: Surface Roughness Increased

Distance (ft): 4.6
Structural Grade: 1
O&M Grade: 0
Clock Start/From: 12
Clock To: 12
1st Value:

2nd Value: Value Percent:

Step: NO

Remarks:



Code: SRI

Description: Surface Roughness Increased

Distance (ft): 4.6
Structural Grade: 1
O&M Grade: 0
Clock Start/From: 3
Clock To: 9
1st Value:
2nd Value:

Step: NO

Remarks:

Value Percent:



Code: MGO

Description: General Observation

Distance (ft): 4.6
Structural Grade: 0
O&M Grade: 0
Clock Start/From:
Clock To:

1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: end of survey