## **Manhole Inspection Report**

Southwest



Date: 04/10/2018 Coding: Weather: M-709-008 MH#: Owner: NA Len. Surveyed:

15.1 P.O.#: John Kuglmaier 15.6 Surveyor: Rim to Invert: U-1215-07002349 Concrete Customer: Cert. #: Wall Material:

(reinforced)

**RZMACP** 

Street: Bracken Parkway. and Tanager St. Project: Hobart, IN City: Hobart, IN **GPS Northing:** 2906950.936

Location: GPS Easting: 2906950.936

GPS Accuracy: Cover Shape: Circular Evidence of Surcharge: Yes Cover Size: 22.5 Potential for Runoff: None

Comments:


Drain Area:

1.50 2111 3.00 O&M Index: O&M Quick: O&M Rating: 0.00 0000 0.00 Structural Index: Structural Quick: Structural Rating: 1.50 2111 3.00 Overall Index: Overall Quick: Overall Rating:

**Sub-Meter** 

Wednesday, May 3, 2023 1

	Position	Code	Observation	Video (sec)	Grade
л- <del>7</del> 09-008	8				
	.0	MGP	General Photo	10	NA
	0.	RFJ	Roots Fine Joint	22	M 1
-11	2.1	MGP	General Photo	40	NA
	2.9	IS	Infil Stain	55	NA
	6.6	IS	Infil Stain	74	NA
-11	8.2	IS	Infil Stain	89	NA
ш,	11.7	DAZ	Deposits Attached Other	108	M 2
	12.5	MGO	General Observation	121	NA
Camera Direction					

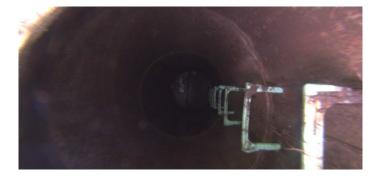

Description:	<b>General Photo</b>
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	

MGP

Wednesday, May 3, 2023

Code:



Code: RFJ

Description: Roots Fine Joint

Distance (ft): .0
Structural Grade: 0
O&M Grade: 1
Clock Start/From: 2
Clock To: 3
1st Value:

2nd Value: Value Percent:

Step: NO

Remarks:



Code: MGP

Description: General Photo

Distance (ft): 2.1
Structural Grade: 0
O&M Grade: 0
Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent:

Step: NO

Remarks:

Code: IS

Description: Infil Stain



Distance (ft): 2.9
Structural Grade: 0

O&M Grade: 0
Clock Start/From: 12
Clock To: 12

1st Value: 2nd Value: Value Percent:

Step: NO

Remarks:

Wednesday, May 3, 2023 3



Code: IS


Description: Infil Stain

Distance (ft): 6.6
Structural Grade: 0
O&M Grade: 0
Clock Start/From: 10

Clock To: 1st Value: 2nd Value: Value Percent:

Step: NO

Remarks:

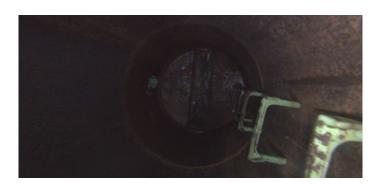

Code: IS

Description: Infil Stain

Distance (ft): 8.2
Structural Grade: 0
O&M Grade: 0
Clock Start/From: 12
Clock To: 12
1st Value:

2nd Value: Value Percent:

Step: NO

Remarks:



Code: DAZ

Description: Deposits Attached Other

Distance (ft): 11.7
Structural Grade: 0
O&M Grade: 2
Clock Start/From: 12
Clock To: 12
1st Value:

2nd Value:

Value Percent: 5.000 Step: NO

Remarks: Mixed materials

4

Wednesday, May 3, 2023



Code: MGO

Description: General Observation

Distance (ft): 12.5
Structural Grade: 0
O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: Ins. Comp.