Manhole Inspection Report



10/08/2022 Coding: **RZMACP** Date: Weather:

M-803-024 MH#: Owner: NA Len. Surveyed: 8.1 P.O.#: Jen Costello Rim to Invert: Surveyor:

U-907-5518 Concrete (cast in Customer: Cert. #: Wall Material:

place)

Street: 295' South of 40th Ave. 167' East of Project: Hobart, IN

City: Hobart, IN **GPS Northing:** 2293421.13 Location: Other GPS Easting: 2908554.425 Northeast Drain Area: GPS Accuracy: **Sub-Meter**

Cover Shape: Circular Evidence of Surcharge: No Cover Size: 24.0 Potential for Runoff: None

Comments:

2.00 2100 2.00 O&M Index: O&M Quick: O&M Rating: 3100 3.00 3.00 Structural Index: Structural Quick: Structural Rating: 2.50 3121 5.00 Overall Index: Overall Quick: Overall Rating:


Position	Code	Observation	Video (sec)	Grade
-803-024				
.0	MGO	General Observation	10	NA
1.8	MGO	General Observation	27	NA
/2.6	FL	Fracture Longitudinal	42	S 3
//8.1	DSGV	Deposits Settled Gravel	65	M 2
8.1	MGO	General Observation	77	NA

Code:



Description:	General Observation
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	access mh

MGO

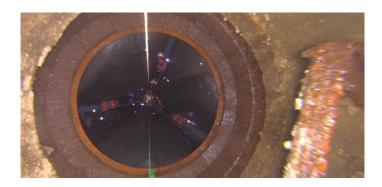

Code: MGO

Description: General Observation

Distance (ft): 1.8
Structural Grade: 0
O&M Grade: 0
Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: underside of frame



Code: FL

Description: Fracture Longitudinal

Distance (ft): 2.6
Structural Grade: 3
O&M Grade: 0
Clock Start/From: 12
Clock To:

1st Value: 2nd Value: Value Percent:

Step: NO

Remarks:



Code: **DSGV**

Description: Deposits Settled Gravel

Distance (ft): 8.1
Structural Grade: 0
O&M Grade: 2
Clock Start/From: 12
Clock To: 12
1st Value:

2nd Value:

Value Percent: 5.000 Step: NO

Remarks:



Code: MGO

Description: General Observation

Distance (ft): 8.1
Structural Grade: 0

O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: end of survey