Manhole Inspection Report



Date:

09/19/2022

Weather:

NA

Coding:

RZMACP

MH#:

M-803-068

Owner:

Len. Surveyed:

15.7

P.O.#:

Surveyor:

Cert. #:

Rim to Invert:

17.4 Wall Material:

Not Known

Street:

Customer:

South Side of Hwy 6, and Colonial Dr Project:

GPS Northing:

Hobart, IN 2295649.722

City: Location: Hobart, IN

Jen Costello

U-907-5518

2907513.396

Drain Area:

Yard Northeast GPS Easting: **GPS Accuracy:**

Sub-Meter

Cover Shape:

Circular

Evidence of Surcharge:

Cover Size:

24.0

Potential for Runoff:

211B

Comments:

O&M Index:

Overall Index:

Structural Index:

2.00 1.00

1.06

O&M Quick:

Structural Quick: Overall Quick:

2100 O&M Rating: 1B00

Structural Rating: Overall Rating:

16.00 18.00

2.00

Position	Code	Observation	Video (sec)	Grade
03-068				
.0	MGO	General Observation	10	NA
0.	SRI	Surface Roughness Increased	21	S 1
2.4	MGO	General Observation	40	NA
15.7	DSF	Deposits Settled Fine	80	M 2
15.7	MGO	General Observation	92	NA
15.7	SRI	Surface Roughness Increased	103	S 1

Code:



Description:	General Observation	
Distance (ft):	.0	
Structural Grade:	0	
O&M Grade:	0	
Clock Start/From:		
Clock To:		
1st Value:		
2nd Value:		
Value Percent:		
Step:	NO	
Remarks:	access mh	

MGO



Code: SRI


Description: Surface Roughness Increased

Distance (ft): .0
Structural Grade: 1
O&M Grade: 0
Clock Start/From: 12
Clock To: 12

1st Value: 2nd Value: Value Percent:

Step: NO

Remarks:

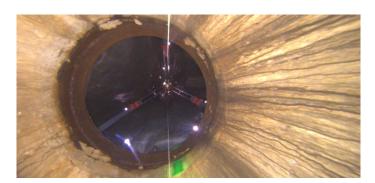

Code: MGO

Description: General Observation

Distance (ft): 2.4
Structural Grade: 0
O&M Grade: 0
Clock Start/From:
Clock To:

1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: underside of frame



Code: **DSF**

Description: Deposits Settled Fine

Distance (ft): 15.7
Structural Grade: 0

O&M Grade: 2

Clock Start/From: 12

Clock To: 12

1st Value:

2nd Value:

Value Percent: 5.000 Step: NO

Remarks:



Code: MGO

Description: General Observation

Distance (ft): 15.7
Structural Grade: 0

O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: end of survey



Code: SRI

Description: Surface Roughness Increased

Distance (ft): 15.7
Structural Grade: 1

O&M Grade: 0

Clock Start/From: 12

Clock To: 12

1st Value: 2

2nd Value: Value Percent:

Step: NO

Remarks: