Manhole Inspection Report



Date: 09/29/2022 Weather: Coding: RZMACP

 MH#:
 M-805-046
 Owner:
 NA
 Len. Surveyed:
 4.7

 P.O.#:
 Surveyor:
 Jen Costello
 Rim to Invert:
 5.3

 Customer:
 Cert. #:
 U-907-5518
 Wall Material:
 Brick

Street:Franklin St. 236' North of 4th St.Project:Hobart, INCity:Hobart, INGPS Northing:2289301.881Location:Local Rural StreetsGPS Easting:2907513.103

Drain Area: South GPS Accuracy: Sub-Meter


Cover Shape: Circular Evidence of Surcharge: No
Cover Size: 24.0 Potential for Runoff: None

Comments:

O&M Index:	2.00	O&M Quick:	2200	O&M Rating:	4.00
Structural Index:	0.00	Structural Quick:	0000	 Structural Rating:	0.00
Overall Index:	2.00	Overall Quick:	2200	Overall Rating:	4.00

Position	Code	Observation	Video (sec)	Grade
805-046				
.0	MGO	General Observation	10	NA
2.6	MGO	General Observation	29	NA
4.7	DSGV	Deposits Settled Gravel	47	M 2
4.7	OBB	Obstacle Brick	58	M 2
4.7	MGO	General Observation	69	NA

Code:

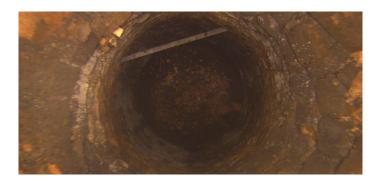

Description:	General Observation	
Distance (ft):	.0	
Structural Grade:	0	
O&M Grade:	0	
Clock Start/From:		
Clock To:		
1st Value:		
2nd Value:		
Value Percent:		
Step:	NO	
Remarks:	access mh	

MGO



Code: MGO

Description: General Observation

Distance (ft): 2.6
Structural Grade: 0
O&M Grade: 0
Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: underside of frame



Code: **DSGV**

Description: Deposits Settled Gravel

Distance (ft): 4.7
Structural Grade: 0

O&M Grade: 2

Clock Start/From: 12

Clock To: 12

1st Value: 2

2nd Value:

Value Percent: 5.000 Step: NO

Remarks:

Code: OBB

Description: Obstacle Brick



Distance (ft): 4.7
Structural Grade: 0

O&M Grade: 2

Clock Start/From: 12

Clock To: 12

1st Value: 2nd Value:

Value Percent: 5.000 Step: NO

Remarks:



Code: MGO

Description: General Observation

Distance (ft): 4.7
Structural Grade: 0

O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: end of survey