
Date:	04/03/2018	Weather:		Coding:	PACP 6.0
Pipe Length (ft):	202.0	Owner:	NA	Pre Clean:	Not Known
P.O.#:		Surveyor:	Jen Costello	PSR:	P-103-002-003
Customer:		Clean Date:	01/01/1900	Shape:	С
Street:	E 40TH AVE		Flow Control:	Not Controlled	
City:	Hobart, IN		Year Renewed:		
Location:	Other		Tape/Media #:		
Purpose:	Not Known		Dia/Height:	10"	
Use:	Sanitary		Material:	VCP	
Drain Area:	NA		Lining:		
Category:	NA				
Comment:					
Location Details	:		Direction of Survey	: Downstream	
US MH:	M-103-003	DS MH:	M-103-002	Total Length Surveyed (ft)	: 25.6
D&M Index:	2.00	O&M Quick:	2100	O&M Rating:	2.00
Structural Index:	0.00	Structural Qu	uick: 0000	Structural Rating:	0.00
Overall Index:	2.00	Overall Quic		Overall Rating:	2.00






Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-103-003

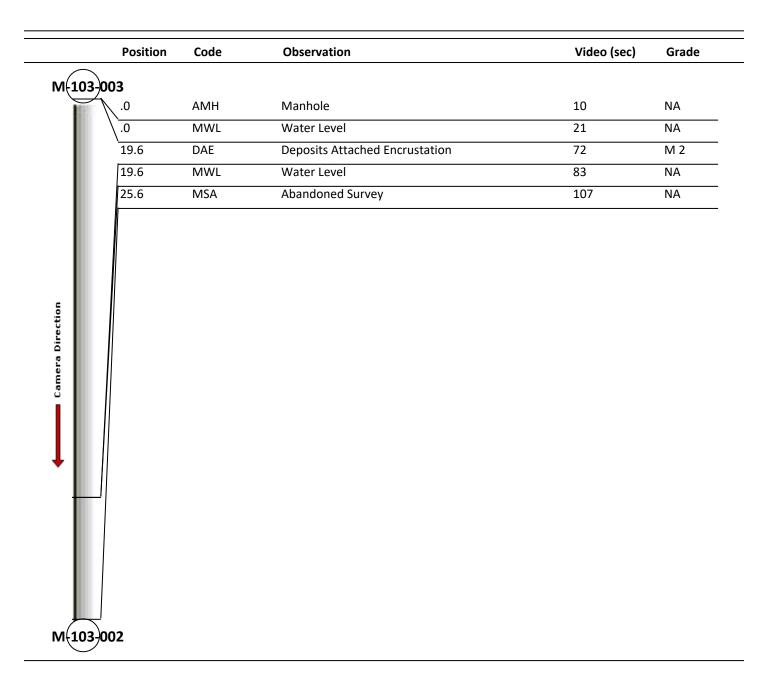


Code: MWL Description: Water Level

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	20.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	

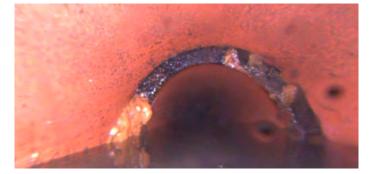

Code:	DAE
Description:	Deposits Attached Encrustation

Distance (ft):	19.6
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	

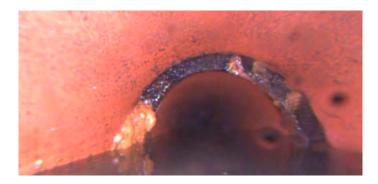

Code: MWL Description: Water Level

Distance (ft):	19.6
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	40.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	

Code:	
Description:	

MSA Abandoned Survey

Distance (ft):	25.6
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	HIGH WATER