
Date:	04/06/2018	Weather:		Coding:	PACP 6.0
Pipe Length (ft):	151.5	Owner:	NA	Pre Clean:	Not Known
P.O.#:		Surveyor:	Jen Costello	PSR:	P-103-027-028
Customer:		Clean Date:	01/01/1900	Shape:	С
Street:	39th av		Flow Control:	Not Controlled	
City:	Hobart, IN		Year Renewed:		
Location:	Other		Tape/Media #:		
Purpose:	Not Known		Dia/Height:	12"	
Use:	Sanitary		Material:	VCP	
Drain Area:	NA		Lining:		
Category:	NA				
Comment:					
Location Details	:		Direction of Survey	/: Upstream	
US MH:	M-103-027	DS MH:	M-103-028	Total Length Surveyed (ft)	: 11.8
D&M Index:	2.00	O&M Quick:	2200	O&M Rating:	4.00
Structural Index:	0.00	Structural Qu	uick: 0000	Structural Rating:	0.00
Overall Index:	2.00	Overall Quic		Overall Rating:	4.00





Code:	АМН
Description:	Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-103-028

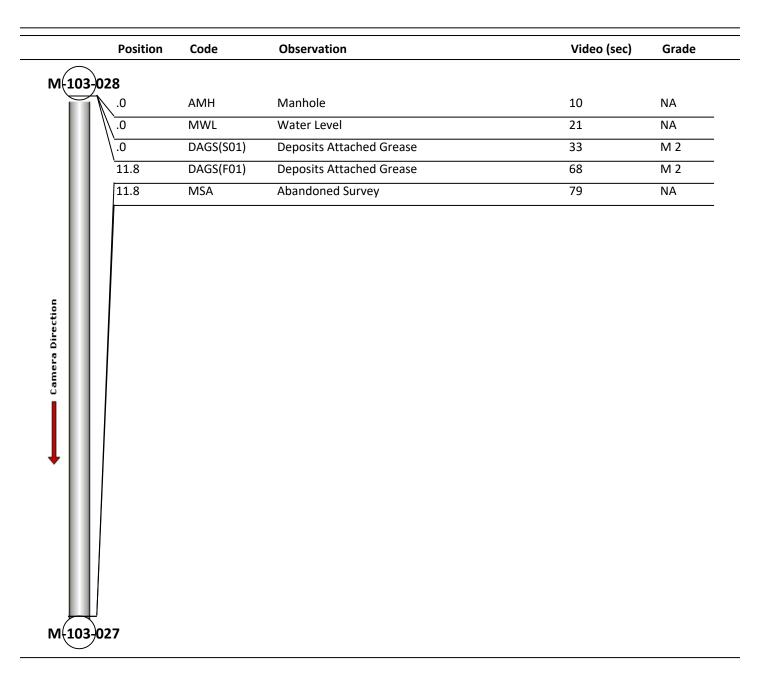

Code: MWL Description: Water Level

Distance (ft): .0 Structural Grade: 0 O&M Grade: 0 Clock Start/From: Clock To: 1st Value: 2nd Value: Value Percent: 30.000 Continuous Index: Within 8" of Joint: NO Remarks:



Code:	DAGS
Description:	Deposits Attached Grease

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	S01
Within 8" of Joint:	NO
Remarks:	



Code:DAGSDescription:Deposits Attached Grease

Distance (ft):	11.8
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	F01
Within 8" of Joint:	NO
Remarks:	

Code:	
Description:	

MSA Abandoned Survey

Distance (ft):	11.8
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	DEBRIS UNDER WATER