Profile/Ph	oto Observation	Report				RedZon
Date:	03/24/2018	Weather:			Coding:	PACP 6.0
Pipe Length (ft): 138.3	Owner:	NA		Pre Clean:	No Pre-Cleaning
P.O.#:		Surveyor:	Justin Gonz	ales	PSR:	P-108-018-016
Customer:		Clean Date:	01/01/190)	Shape:	С
Street:	14TH LN		Flow Control	:	Not Controlled	
City:	Hobart, IN		Year Renewe	d:		
Location:	Light Highway		Tape/Media	#:		
Purpose:	Routine Assessmer	nt	Dia/Height:		8"	
Use:	Sanitary		Material:		VCP	
Drain Area:	NA		Lining:			
Category:	NA					
Comment:	Flow direction wro	ng				
Location Detai	ls:		Direction of S	Survey:	Downstream	
US MH:	M-108-016	DS MH:	M-108-018	Т	otal Length Surveyed (ft)	: 141.9
0&M Index:	2.00	O&M Quick:		2F00	O&M Rating:	78.00
Structural Index:	0.00	Structural Qu	lick:	0000	Structural Rating:	0.00
Overall Index:	2.00	Overall Quick		2F00	Overall Rating:	78.00

	Position	Code	Observation	Video (sec)	Grade
M(108-0)16				
	0.	AMH	Manhole	10	NA
	.0	MWL	Water Level	21	NA
	0.	DAZ(S01)	Deposits Attached Other	32	M 2
	73.9	RPR	Repair Point Pipe Replaced	191	NA
	79.0	RPR	Repair Point Pipe Replaced	213	NA
	79.8	TF	Tap Factory	226	NA
	82.2	TF	Tap Factory	243	NA
	88.3	DAGS(S02)	Deposits Attached Grease	268	M 2
	141.9	AMH	Manhole	386	NA
5	141.9	DAZ(F01)	Deposits Attached Other	397	M 2
ecti	141.9	DAGS(F02)	Deposits Attached Grease	408	M 2
Camera Direction					
M(108-0)18				



Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-108-016



Code: MWL Description: Water Level

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	



Code:	DAZ
Description:	Deposits Attached Other

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	7
Clock To:	5
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	S01
Within 8" of Joint:	YES
Remarks:	WANDER




Code:RPRDescription:Repair Point Pipe Replaced

Distance (ft):	73.9
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	CIP LINER

Code: Description: RPR Repair Point Pipe Replaced



Distance (ft):	79.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	CIP LINER END

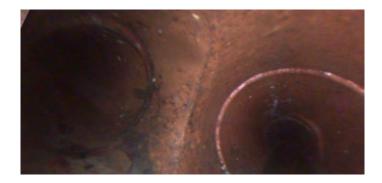

Code:	TF
Description:	Tap Factory

Distance (ft):	79.8
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	10
Clock To:	
1st Value:	4.000
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	
Remarks:	



Distance (ft):82.2Structural Grade:0O&M Grade:0Clock Start/From:2Clock To:4.0002nd Value:4.000Value Percent:Continuous Index:Within 8" of Joint:Remarks:	Code: Description:	TF Tap Factory
O&M Grade:OO&M Grade:OClock Start/From:2Clock To:4.0002nd Value:4.000Value Percent:Continuous Index:Within 8" of Joint:Value Percent:	Distance (ft):	82.2
Clock Start/From: 2 Clock To: 1st Value: 4.000 2nd Value: Value Percent: Continuous Index: Within 8" of Joint:	Structural Grade:	0
Clock To: 1st Value: 2nd Value: Value Percent: Continuous Index: Within 8" of Joint:	O&M Grade:	0
1st Value:4.0002nd Value:Value Percent:Continuous Index:Within 8" of Joint:	Clock Start/From:	2
2nd Value: Value Percent: Continuous Index: Within 8" of Joint:	Clock To:	
Value Percent: Continuous Index: Within 8" of Joint:	1st Value:	4.000
Continuous Index: Within 8" of Joint:	2nd Value:	
Within 8" of Joint:	Value Percent:	
	Continuous Index:	
Remarks:	Within 8" of Joint:	
	Remarks:	



Code:DAGSDescription:Deposits Attached Grease

AMH

Manhole

Distance (ft):	88.3
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	7
Clock To:	5
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	S02
Within 8" of Joint:	YES
Remarks:	WANDER

Code:

Description:



Distance (ft):	141.9
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-108-018



Code:DAZDescription:Deposits Attached Other

Distance (ft):	141.9
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	7
Clock To:	5
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	F01
Within 8" of Joint:	YES
Remarks:	WANDER

Code: Description: DAGS Deposits Attached Grease



Distance (ft):	141.9
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	7
Clock To:	5
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	F02
Within 8" of Joint:	YES
Remarks:	WANDER