

Profile/Ph	oto Observatior	n Report			RedZone
Date:	03/22/2018	Weather:		Coding:	PACP 6.0
Pipe Length (ft)	: 318.8	Owner:	NA	Pre Clean:	No Pre-Cleaning
P.O.#:		Surveyor:	Selasie Honu	PSR:	P-208-003-004
Customer:		Clean Date:	01/01/1900	Shape:	C
Street:	FOXCROFT STREET	г	Flow Control:	Not Controlled	
City:	Hobart, IN		Year Renewed:		
Location:	Light Highway		Tape/Media #:		
Purpose:	Routine Assessme	ent	Dia/Height:	8"	
Use:	Sanitary		Material:	VCP	
Drain Area:	NA		Lining:		
Category:	NA				
Comment:	F_S_P_C at 0 ft bu	ild up on the pipe			
Location Detail	s:		Direction of Survey:	Downstream	
US MH:	M-208-004	DS MH: N	1-208-003	Total Length Surveyed (ft)	: 2.1
0&M Index:	3.00	O&M Quick:	4121	O&M Rating:	6.00
tructural Index:	0.00	Structural Quic	k: 0000	Structural Rating:	0.00
Overall Index:	3.00	Overall Quick:	4121	Overall Rating:	6.00



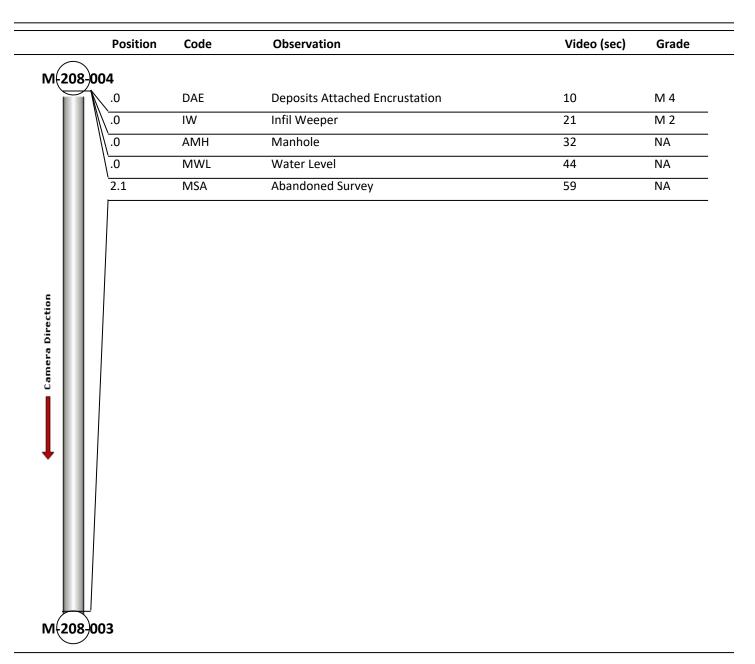

Code: Description:	DAE Deposits Attached Encrustation
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	4
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	30.000
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	

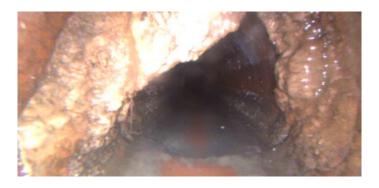

Code: IW Description: Infil Weeper

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	



Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-208-004



Code:	MWL
Description:	Water Level

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	

Code:	
Description:	

MSA	
Abandon	ed Survey



Distance (ft):	2.1
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	camera stopped