
Profile/Pho	oto Observatior	n Report			RedZon
Date:	03/23/2018	Weather:		Coding:	PACP 6.0
Pipe Length (ft)	: <b>182.8</b>	Owner:	NA	Pre Clean:	No Pre-Cleaning
P.O.#:		Surveyor:	Jen Costello	PSR:	P-208-012-013
Customer:		Clean Date:	01/01/1900	Shape:	С
Street:	FOXCROFT STREET	Г	Flow Control:	Not Controlle	d
City:	Hobart, IN		Year Renewed:		
Location:	Light Highway		Tape/Media #:		
Purpose:	Routine Assessme	ent	Dia/Height:	12"	
Use:	Sanitary		Material:	VCP	
Drain Area:	NA		Lining:		
Category:	NA				
Comment:	R_M at 17 ft debri	is and rocks in the	tracks\nFlow direc	tion wrong	
Location Details	5:		Direction of Surve	y: Upstream	
US MH:	M-208-013	DS MH:	M-208-012	Total Length Surveyed (f	t): <b>18.7</b>
0&M Index:	2.20	O&M Quick:	3124	O&M Rating:	11.00
structural Index:	0.00	Structural Qui	ck: 0000		0.00
Overall Index:	2.20	Overall Quick:	3124	Overall Rating:	11.00






Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-208-012

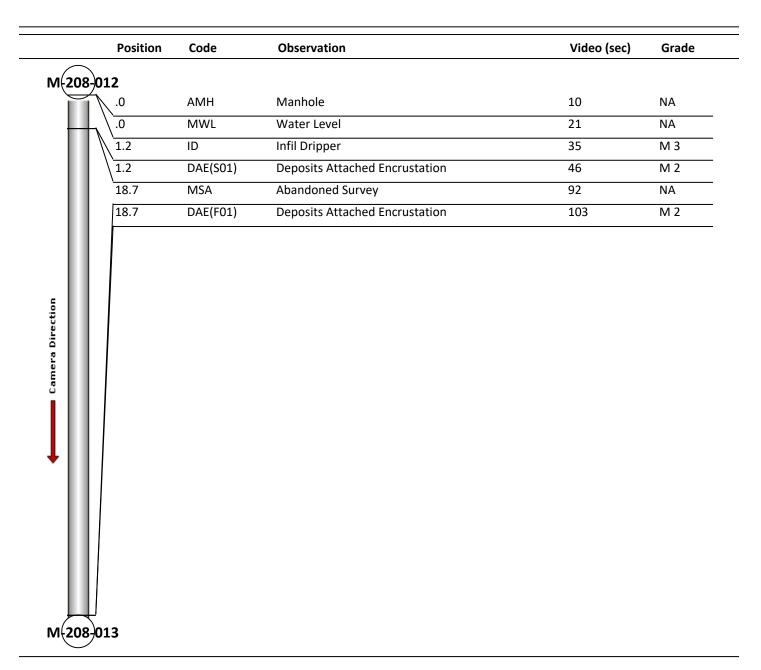


Code: MWL Description: Water Level

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	

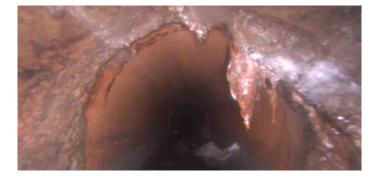

Code: Description:	ID Infil Dripper
Distance (ft):	1.2
Structural Grade:	0
O&M Grade:	3
Clock Start/From:	12
Clock To:	1
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	

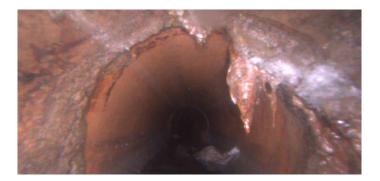

Code:DAEDescription:Deposits Attached Encrustation

Distance (ft):	1.2
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	10.000
Continuous Index:	S01
Within 8" of Joint:	YES
Remarks:	




Code:	
Description:	

MSA Abandoned Survey

Distance (ft):	18.7
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	overturned

Code:DAEDescription:Deposits Attached Encrustation

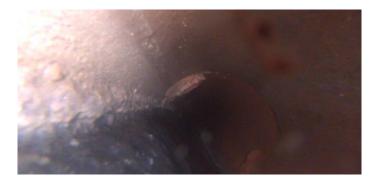

Distance (ft):	18.7
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	10.000
Continuous Index:	F01
Within 8" of Joint:	YES
Remarks:	