

Profile/Photo Observation Report



Date:	10/23/2021	Weather:		Coding:	PACP 6.0
Pipe Length (ft):		Owner:	Hobart, IN	Pre Clean:	Not Known
P.O.#:	994_1	Surveyor:	M. Pielacha	PSR:	P-303-007-006
Customer:	Hobart, IN	Clean Date:		Shape:	C

Street:	Off Old Ridge Road	Flow Control:	
City:	Hobart, IN	Year Renewed:	
Location:	Sidewalk	Tape/Media #:	994
Purpose:	Routine Assessment	Dia/Height:	12"
Use:	Sanitary	Material:	VCP
Drain Area:		Lining:	

Category: **NA**


Comment:

Location Details: Direction of Survey: **Upstream**

US MH: **M-303-7** DS MH: **M-303-6** Total Length Surveyed (ft): **62.9**

O&M Index:	2.50	O&M Quick:	3222	O&M Rating:	10.00
Structural Index:	0.00	Structural Quick:	0000	Structural Rating:	0.00
Overall Index:	2.50	Overall Quick:	3222	Overall Rating:	10.00

Position	Code	Observation	Video (sec)	Grade																																								
<div> <div> <div>M-303-6</div> <div> <div>Camera Direction</div> <div></div> </div> <div>M-303-7</div> </div> <table> <tr> <td>.0</td><td>AMH</td><td>Manhole</td><td>0</td><td>NA</td></tr> <tr> <td>.0</td><td>MWL</td><td>Water Level</td><td>22</td><td>NA</td></tr> <tr> <td>21.9</td><td>RMJ</td><td>Roots Medium Joint</td><td>68</td><td>M 3</td></tr> <tr> <td>23.0</td><td>TF</td><td>Tap Factory</td><td>82</td><td>NA</td></tr> <tr> <td>23.9</td><td>RMJ</td><td>Roots Medium Joint</td><td>112</td><td>M 3</td></tr> <tr> <td>43.6</td><td>DAE</td><td>Deposits Attached Encrustation</td><td>144</td><td>M 2</td></tr> <tr> <td>62.9</td><td>OBZ</td><td>Obstacle Other</td><td>229</td><td>M 2</td></tr> <tr> <td>62.9</td><td>MSA</td><td>Abandoned Survey</td><td>282</td><td>NA</td></tr> </table> </div>					.0	AMH	Manhole	0	NA	.0	MWL	Water Level	22	NA	21.9	RMJ	Roots Medium Joint	68	M 3	23.0	TF	Tap Factory	82	NA	23.9	RMJ	Roots Medium Joint	112	M 3	43.6	DAE	Deposits Attached Encrustation	144	M 2	62.9	OBZ	Obstacle Other	229	M 2	62.9	MSA	Abandoned Survey	282	NA
.0	AMH	Manhole	0	NA																																								
.0	MWL	Water Level	22	NA																																								
21.9	RMJ	Roots Medium Joint	68	M 3																																								
23.0	TF	Tap Factory	82	NA																																								
23.9	RMJ	Roots Medium Joint	112	M 3																																								
43.6	DAE	Deposits Attached Encrustation	144	M 2																																								
62.9	OBZ	Obstacle Other	229	M 2																																								
62.9	MSA	Abandoned Survey	282	NA																																								

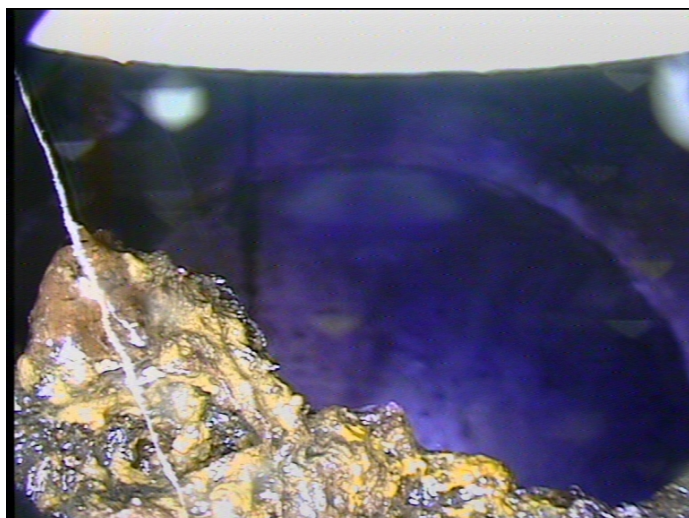

Code: **AMH**
Description: **Manhole**

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks: **M-303-6**



Code: **MWL**
Description: **Water Level**

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent: **10.000**
Continuous Index:
Within 8" of Joint: **NO**
Remarks:



Code: **RMJ**
Description: **Roots Medium Joint**

Distance (ft): **21.9**
Structural Grade: **0**
O&M Grade: **3**
Clock Start/From: **8**
Clock To: **4**
1st Value:
2nd Value:
Value Percent: **10.000**
Continuous Index:
Within 8" of Joint: **YES**
Remarks:



Code: **TF**
Description: **Tap Factory**

Distance (ft): **23.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From: **2**
Clock To:
1st Value: **4.000**
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks:



Code: **RMJ**
Description: **Roots Medium Joint**


Distance (ft): **23.9**
Structural Grade: **0**
O&M Grade: **3**
Clock Start/From: **10**
Clock To: **12**
1st Value:
2nd Value:
Value Percent: **5.000**
Continuous Index:
Within 8" of Joint: **YES**
Remarks:



Code:	DAE
Description:	Deposits Attached Encrustation
Distance (ft):	43.6
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	7
Clock To:	5
1st Value:	
2nd Value:	
Value Percent:	10.000
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	



Code:	OBZ
Description:	Obstacle Other
Distance (ft):	62.9
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	4
Clock To:	8
1st Value:	
2nd Value:	
Value Percent:	10.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	under water debris

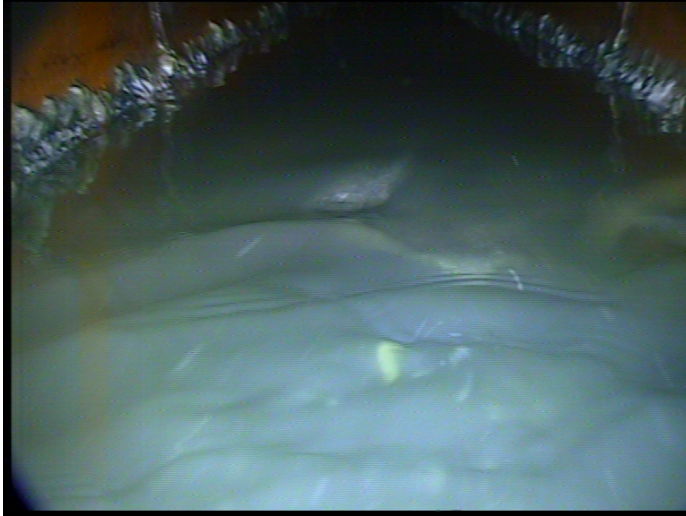

Code:	MSA
Description:	Abandoned Survey
Distance (ft):	62.9
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	under water debris