Profile/Photo Observation Report

Other

Location:

Comment:



Date: 03/29/2018 Weather: **PACP 6.0** Coding: Pipe Length (ft): 121.3 Owner: NA Pre Clean: **Not Known** P.O.#: Jen Costello PSR: P-303-042-041 Surveyor:

Customer: Clean Date: 01/01/1900 Shape: C

Street: ROCHE ST Flow Control: Not Controlled
City: Hobart, IN Year Renewed:

Purpose: Not Known Dia/Height: 12"
Use: Sanitary Material: VCP

Drain Area: NA Lining:

Category: NA

Location Details: Direction of Survey: **Downstream**

US MH: M-303-041 DS MH: M-303-042 Total Length Surveyed (ft): 53.5

2.00 2200 4.00 O&M Index: O&M Quick: O&M Rating: 0.00 0000 0.00 Structural Quick: Structural Rating: Structural Index: 2.00 2200 4.00 Overall Rating: Overall Index: Overall Quick:

Tape/Media #:

Position	Code	Observation	Video (sec)	Grade
03-041				
0.	AMH	Manhole	10	NA
0.	MWL	Water Level	21	NA
1.3	DAE	Deposits Attached Encrustation	35	M 2
1.3	DAR	Deposits Attached Ragging	46	M 2
53.5	MSA	Abandoned Survey	162	NA

Code:



Description:	Manhole		
Distance (ft):	.0		
O&M Grade: Clock Start/From:	0		
Clock To: 1st Value:			
2nd Value: Value Percent:			
Continuous Index: Within 8" of Joint: Remarks:	NO M-303-041		

AMH



Code: MWL

Description: Water Level

Distance (ft): .0
Structural Grade: 0
O&M Grade: 0
Clock Start/From:

Clock To: 1st Value: 2nd Value:

Value Percent:

Continuous Index:

Within 8" of Joint:

Remarks:

30.000

NO

Code: DAE

Description: Deposits Attached Encrustation



Distance (ft): 1.3
Structural Grade: 0
O&M Grade: 2

Clock Start/From: 8
Clock To: 4


1st Value: 2nd Value:

Value Percent: 5.000

Continuous Index:

Within 8" of Joint: YES

Remarks:

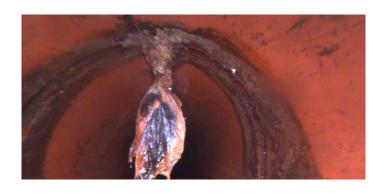

Code: DAR

Description: Deposits Attached Ragging

Distance (ft): 1.3
Structural Grade: 0
O&M Grade: 2
Clock Start/From: 12

Clock To: 1st Value: 2nd Value:

Value Percent: 10.000

Continuous Index:

Within 8" of Joint:

Remarks:

YES



Code: MSA

Description: Abandoned Survey

Distance (ft): 53.5
Structural Grade: 0

O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent: Continuous Index:

Within 8" of Joint: NO

Remarks: **DEBRIS UNDER WATER**