Profile/Photo Observation Report



Date: 09/26/2018 Weather: Coding: PACP 6.0

Pipe Length (ft): 243.9 Owner: NA Pre Clean: Not Known

P.O.#: Surveyor: Justin Gonzales PSR: P-303-045.1-045

Customer: Clean Date: 01/01/1900 Shape: C

Street: BROWN ST & W 38TH AVE Flow Control: Not Controlled

City: Hobart, IN Year Renewed:
Location: Light Highway Tape/Media #:

Purpose: Routine Assessment Dia/Height: 8"
Use: Sanitary Material: VCP

Drain Area: **NA** Lining:

Category: NA

Comment:


Location Details: Direction of Survey: **Downstream**

US MH: M-303-045 DS MH: M-303-045.1 Total Length Surveyed (ft): 282.6

2.00 2100 2.00 O&M Index: O&M Quick: O&M Rating: 2.00 2100 2.00 Structural Quick: Structural Rating: Structural Index: 2.00 2200 4.00 Overall Rating: Overall Index: Overall Quick:


	Position	Code	Observation	Video (sec)	Grade
303-04	.5				
	.0	AMH	Manhole	10	NA
<u> </u>	0.	MWL	Water Level	21	NA
	\ \ 5.1	MGO	General Observation	45	NA
	13.6	TFA	Tap Factory Active	74	NA
	20.9	MGO	General Observation	103	NA
	76.3	TFA	Tap Factory Active	229	NA
	84.1	TFA	Tap Factory Active	259	NA
	161.5	TFA	Tap Factory Active	428	NA
	174.8	TF	Tap Factory	470	NA
	184.2	JSL	Joint Separated Large	505	S 2
	185.2	TF	Tap Factory	522	NA
	185.4	DAE	Deposits Attached Encrustation	538	M 2
	282.6	AMH	Manhole	747	NA

Code:

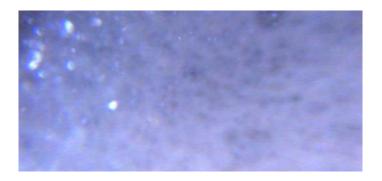

Description:	Manhole		
Distance (ft):	.0		
Structural Grade:	0		
O&M Grade:	0		
Clock Start/From:			
Clock To:			
1st Value:			
2nd Value:			
Value Percent:			
Continuous Index:			
Within 8" of Joint:	NO		
Remarks:	M-303-045		

AMH

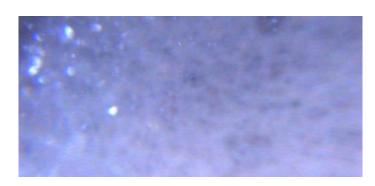

Code: MWL

Description: Water Level

Distance (ft): .0
Structural Grade: 0
O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value:

Value Percent: 10.000

Continuous Index:

Within 8" of Joint: NO

Remarks: **SOAP SUDS**



Code: MGO

Description: General Observation

Distance (ft): 5.1
Structural Grade: 0
O&M Grade: 0
Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent: Continuous Index:

Within 8" of Joint: NO

Remarks: **SOAP SUDS**



Code: TFA

Description: Tap Factory Active

Distance (ft): 13.6
Structural Grade: 0
O&M Grade: 0
Clock Start/From: 9

Clock To:

1st Value:

6.000

2nd Value: Value Percent: Continuous Index: Within 8" of Joint:

Remarks:



Code: MGO

Description: General Observation

Distance (ft): 20.9
Structural Grade: 0


O&M Grade: 0

Clock Start/From:

Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:

Within 8" of Joint: NO

Remarks: BACK TO FROM CAMERA

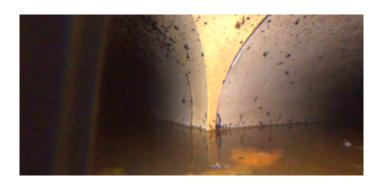

Code: TFA

Description: Tap Factory Active

Distance (ft): 76.3
Structural Grade: 0
O&M Grade: 0
Clock Start/From: 9

Clock To:


1st Value: **6.000**

2nd Value: Value Percent: Continuous Index: Within 8" of Joint:

Remarks:

Code: TFA

Description: Tap Factory Active

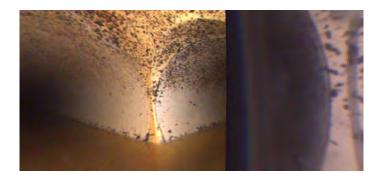

Distance (ft): 84.1
Structural Grade: 0

O&M Grade: 0

Clock Start/From: 3

Clock To:

1st Value: **6.000**

2nd Value: Value Percent: Continuous Index: Within 8" of Joint:

Remarks:



Code: TFA

Description: Tap Factory Active


Distance (ft): 161.5
Structural Grade: 0
O&M Grade: 0
Clock Start/From: 3

Clock To:

1st Value: **4.000**

2nd Value: Value Percent: Continuous Index: Within 8" of Joint:

Remarks:

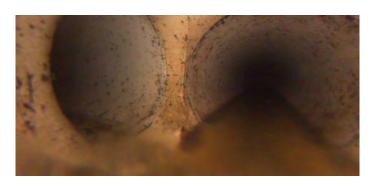

Code: **TF**

Description: Tap Factory

Distance (ft): 174.8
Structural Grade: 0
O&M Grade: 0
Clock Start/From: 9

Clock To:

1st Value: **4.000**

2nd Value: Value Percent: Continuous Index: Within 8" of Joint:

Remarks:



Code: JSL

Description: Joint Separated Large

Distance (ft): 184.2
Structural Grade: 2
O&M Grade: 0
Clock Start/From:


Clock To: 1st Value: 2nd Value: Value Percent:

Continuous Index:

Within 8" of Joint:

Remarks:

NO

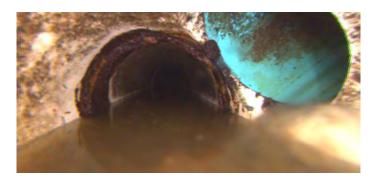

Code: **TF**

Description: Tap Factory

Distance (ft): 185.2
Structural Grade: 0
O&M Grade: 0
Clock Start/From: 2


Clock To:

1st Value: **6.000**

2nd Value: Value Percent: Continuous Index:

Within 8" of Joint:

Remarks:

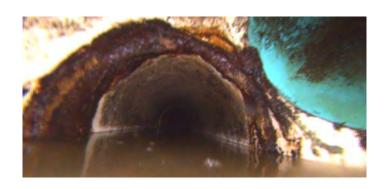

Code: DAE

Description: Deposits Attached Encrustation

YES

Distance (ft): 185.4
Structural Grade: 0
O&M Grade: 2
Clock Start/From: 7
Clock To: 5

1st Value: 2nd Value:

Value Percent: 5.000

Continuous Index:

Within 8" of Joint:

Remarks:

Code: AMH
Description: Manhole



Distance (ft): 282.6
Structural Grade: 0

O&M Grade: 0

Clock Start/From:

Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:

Within 8" of Joint: NO

Remarks: M-303-045.1