## **Profile/Photo Observation Report**



Date: 11/04/2021 Weather: **PACP 7.0** Coding: Pipe Length (ft): 291.0 Owner: **City of Hobart** Pre Clean: **Heavy Cleaning** P.O.#: YES502259 S. Bucklin PSR: P-405-068-002 Surveyor:

Customer: City of Hobart Clean Date: 10/29/2021 Shape: C

Street: South Wabash Street Flow Control: Not Controlled
City: Hobart, IN Year Renewed:

Location: Alley Tape/Media #:

Purpose:Routine AssessmentDia/Height:12"Use:Sanitary Sewage PipeMaterial:VCP


Drain Area: Lining: **None** 

Category: NA
Comment:


Location Details: Direction of Survey: **Downstream** 

US MH: M-404-002 DS MH: M-405-068 Total Length Surveyed (ft): 58.2

2.00 2200 4.00 O&M Index: O&M Quick: O&M Rating: 2.00 2300 6.00 Structural Index: Structural Quick: Structural Rating: 2.00 2500 10.00 Overall Index: Overall Quick: Overall Rating:

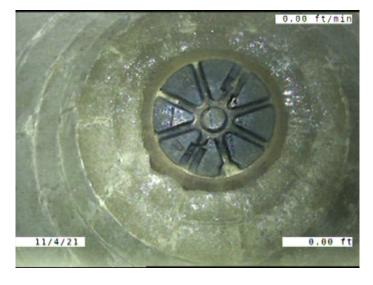

Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-404-002

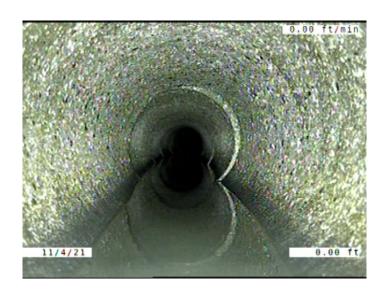

Code: MWL

Description: Miscellaneous Water Level

Distance (ft): .0
Structural Grade: 0
O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value:

Value Percent:


Continuous Index:

Within 8" of Joint:

Remarks:

10.000

NO

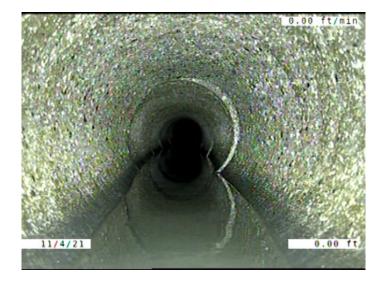

Code: MGO

Description: Miscellaneous General Observation


Distance (ft): .0
Structural Grade: 0
O&M Grade: 0
Clock Start/From:
Clock To:

1st Value: 2nd Value: Value Percent: Continuous Index:

Within 8" of Joint: NO

Remarks: PIPE SIZE AT THE UPSTREAM

MANHOLE IS 10".

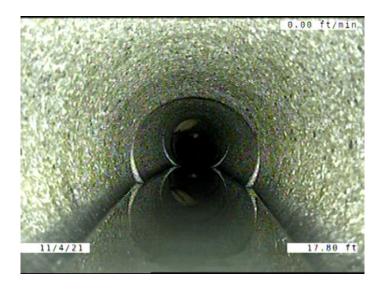

Code: MWLS

Description: Miscellaneous Water Level Sag


Distance (ft): 17.8
Structural Grade: 2
O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value:

Value Percent: 10.000
Continuous Index: S01
Within 8" of Joint: NO

Remarks:

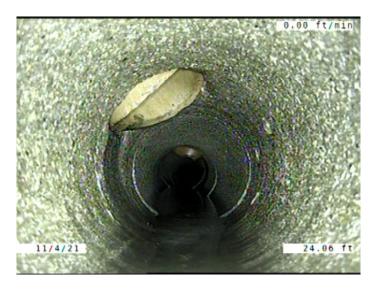

Code: MWLS

Description: Miscellaneous Water Level Sag


Distance (ft): 24.1
Structural Grade: 2
O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value:

Value Percent: 10.000
Continuous Index: F01
Within 8" of Joint: NO

Remarks:

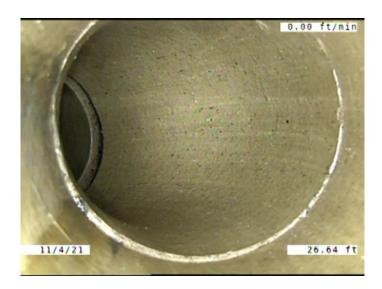

Code: **TBI** 

Description: Tap Break-in Intruding

Distance (ft): 26.6
Structural Grade: 0
O&M Grade: 2
Clock Start/From: 11

Clock To:

 1st Value:
 4.000

 2nd Value:
 1.000


Value Percent:

Continuous Index:

Within 8" of Joint:

Remarks:

YES

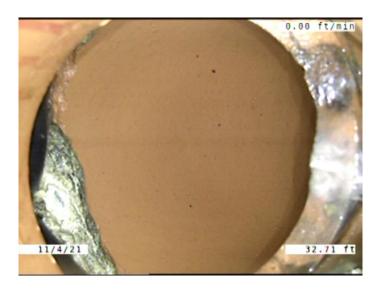

Code: TBI

Description: Tap Break-in Intruding

Distance (ft): 32.7
Structural Grade: 0
O&M Grade: 2
Clock Start/From: 1

Clock To:

 1st Value:
 4.000


 2nd Value:
 2.000

Value Percent: Continuous Index:

Within 8" of Joint:

Remarks:

YES

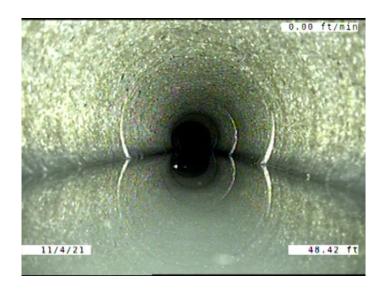

Code: MWLS

Description: Miscellaneous Water Level Sag


Distance (ft): 48.4
Structural Grade: 2
O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value:

Value Percent: 15.000
Continuous Index: S02
Within 8" of Joint: NO

Remarks:

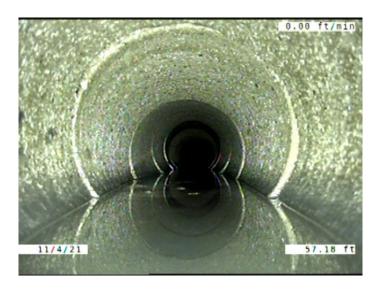

Code: MWLS

Description: Miscellaneous Water Level Sag


Distance (ft): 57.2
Structural Grade: 2
O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value:

Value Percent: 15.000
Continuous Index: F02
Within 8" of Joint: NO

Remarks:

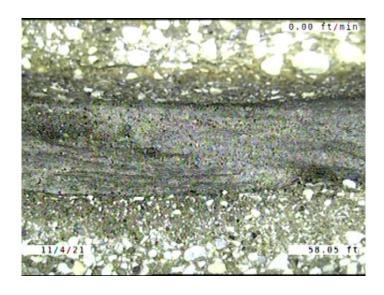

Code: MSC

Description: Miscellaneous Shape/Size Change

Distance (ft): 58.1
Structural Grade: 0

O&M Grade: 0

Clock Start/From:

Clock To:


1st Value: **12.000** 

2nd Value: Value Percent: Continuous Index:

Within 8" of Joint:

Remarks:

NO

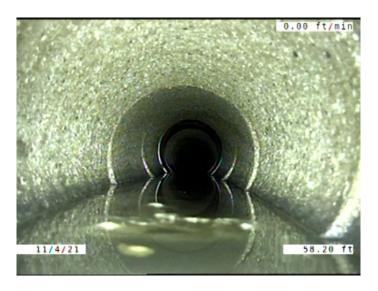

Code: MSA

Description: Miscellaneous Survey Abandoned

Distance (ft): 58.2
Structural Grade: 0

O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent: Continuous Index:

Within 8" of Joint: NO

Remarks: MADE IT TO THE POINT OF OVERLAP.

**REVERSAL COMPLETE**