

# Profile/Photo Observation Report



Date:	09/02/2021	Weather:		Coding:	PACP 7.0
Pipe Length (ft):	237.0	Owner:	City of Hobart	Pre Clean:	Light Cleaning
P.O.#:	YES502259	Surveyor:	S. Bucklin	PSR:	P-404-018-017
Customer:	City of Hobart	Clean Date:	08/29/2021	Shape:	C


Street:	North Wabash Street	Flow Control:	Not Controlled
City:	Hobart, IN	Year Renewed:	
Location:	Yard	Tape/Media #:	
Purpose:	Routine Assessment	Dia/Height:	10"
Use:	Sanitary Sewage Pipe	Material:	VCP
Drain Area:		Lining:	
Category:	NA		
Comment:			
Location Details:		Direction of Survey:	Downstream
US MH:	M-404-017	DS MH:	M-404-018
		Total Length Surveyed (ft):	193.5

O&M Index:	1.95	O&M Quick:	4132	O&M Rating:	109.00
Structural Index:	4.00	Structural Quick:	5143	Structural Rating:	20.00
Overall Index:	2.11	Overall Quick:	5144	Overall Rating:	129.00

Position	Code	Observation	Video (sec)	Grade
.0	AMH	Manhole	1	NA
.0	MWL	Miscellaneous Water Level	80	NA
.0	DSC(S01)	Deposits Settled Hard/Compacted	94	M 2
.5	OBN(S02)	Obstruction Construction Debris	116	M 2
5.4	TFC	Tap Factory Capped	160	NA
15.3	OBN(F02)	Obstruction Construction Debris	223	M 2
17.8	IRC	Infiltration Runner Connection	252	M 4
18.1	TBD	Tap Break-in/Hammer Defective	296	M 3
18.1	FM	Fracture Multiple	354	S 4
18.1	DSC(F01)	Deposits Settled Hard/Compacted	370	M 2
22.4	DSF(S03)	Deposits Settled Fine	399	M 2
27.1	FS	Fracture Spiral	483	S 3
27.1	DAE	Deposits Attached Encrustation	522	M 2
38.4	TFC	Tap Factory Capped	588	NA
45.6	TFC	Tap Factory Capped	645	NA
60.8	B	Broken	767	S 4
60.8	DAE	Deposits Attached Encrustation	807	M 2
62.4	RFL	Roots Fine Lateral	0	M 1
62.6	TBI	Tap Break-in Intruding	3	M 2

72.6	ISJ	Infiltration Stain Joint	89	M 1
72.6	RFJ	Roots Fine Joint	105	M 1
78.6	TFC	Tap Factory Capped	152	NA
80.6	TFC	Tap Factory Capped	179	NA
97.2	ISJ	Infiltration Stain Joint	286	M 1
112.4	ISJ	Infiltration Stain Joint	400	M 1
118.4	BSV(S04)	Broken Soil Visible	503	S 5
118.5	ISB	Infiltration Stain Barrel	528	M 1
118.5	MWL	Miscellaneous Water Level	542	NA
122.9	BSV(F04)	Broken Soil Visible	648	S 5
144.1	TFC	Tap Factory Capped	861	NA
146.3	TFA	Tap Factory Activity	896	NA
152.5	ISJ	Infiltration Stain Joint	959	M 1
189.2	TFC	Tap Factory Capped	1154	NA
192.8	DAE	Deposits Attached Encrustation	1271	M 2
192.8	RML	Roots Medium Lateral	1298	M 3
192.8	FM	Fracture Multiple	1320	S 4
193.5	TBI	Tap Break-in Intruding	1358	M 2
193.5	DSF(F03)	Deposits Settled Fine	1388	M 2
193.5	MSA	Miscellaneous Survey Abandoned	1397	NA

**M-404-018**

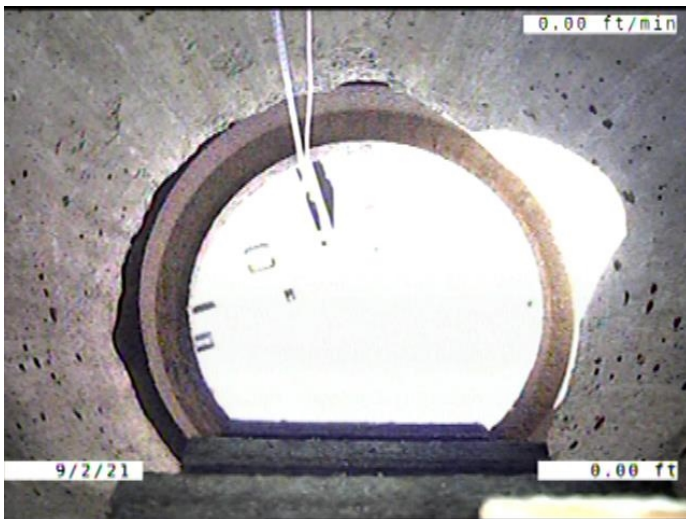

Code: **AMH**  
Description: **Manhole**

Distance (ft): **.0**  
Structural Grade: **0**  
O&M Grade: **0**  
Clock Start/From:  
Clock To:  
1st Value:  
2nd Value:  
Value Percent:  
Continuous Index:  
Within 8" of Joint: **NO**  
Remarks: **M-404-017**



Code:	<b>MWL</b>
Description:	<b>Miscellaneous Water Level</b>
Distance (ft):	<b>.0</b>
Structural Grade:	<b>0</b>
O&M Grade:	<b>0</b>
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	<b>5.000</b>
Continuous Index:	
Within 8" of Joint:	<b>NO</b>
Remarks:	



Code:	<b>DSC</b>
Description:	<b>Deposits Settled Hard/Compacted</b>
Distance (ft):	<b>.0</b>
Structural Grade:	<b>0</b>
O&M Grade:	<b>2</b>
Clock Start/From:	<b>5</b>
Clock To:	<b>7</b>
1st Value:	
2nd Value:	
Value Percent:	<b>5.000</b>
Continuous Index:	<b>S01</b>
Within 8" of Joint:	<b>YES</b>
Remarks:	



Code: **OBN**  
 Description: **Obstruction Construction Debris**

Distance (ft): **.5**  
 Structural Grade: **0**  
 O&M Grade: **2**  
 Clock Start/From: **5**  
 Clock To: **7**  
 1st Value:  
 2nd Value:  
 Value Percent: **5.000**  
 Continuous Index: **S02**  
 Within 8" of Joint: **YES**  
 Remarks:

---




Code: **TFC**  
 Description: **Tap Factory Capped**

Distance (ft): **5.4**  
 Structural Grade: **0**  
 O&M Grade: **0**  
 Clock Start/From: **3**  
 Clock To:  
 1st Value: **4.000**  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **YES**  
 Remarks:

---




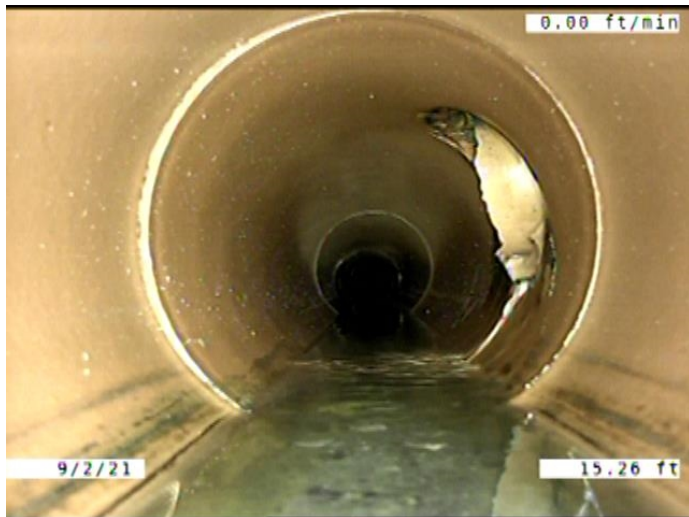

Code: **OBN**  
 Description: **Obstruction Construction Debris**

Distance (ft): **15.3**  
 Structural Grade: **0**  
 O&M Grade: **2**  
 Clock Start/From: **5**  
 Clock To: **7**  
 1st Value:  
 2nd Value:  
 Value Percent: **5.000**  
 Continuous Index: **F02**  
 Within 8" of Joint: **YES**  
 Remarks:


---

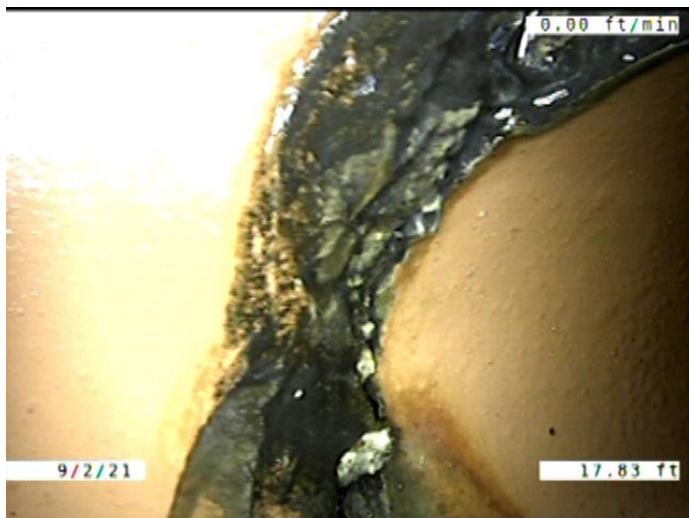

Code: **IRC**  
 Description: **Infiltration Runner Connection**


Distance (ft): **17.8**  
 Structural Grade: **0**  
 O&M Grade: **4**  
 Clock Start/From: **1**  
 Clock To:  
 1st Value:  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **NO**  
 Remarks:

---

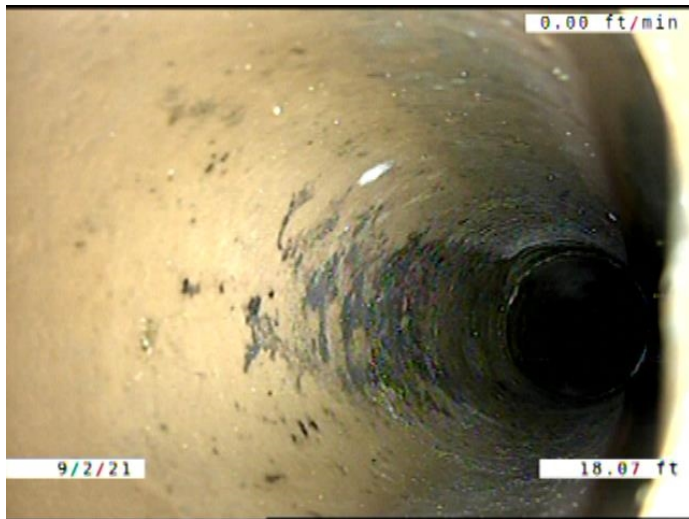


Code: **TBD**  
 Description: **Tap Break-in/Hammer Defective**

Distance (ft): **18.1**  
 Structural Grade: **0**  
 O&M Grade: **3**  
 Clock Start/From: **2**  
 Clock To:  
 1st Value: **6.000**  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **NO**  
 Remarks: **Debris**

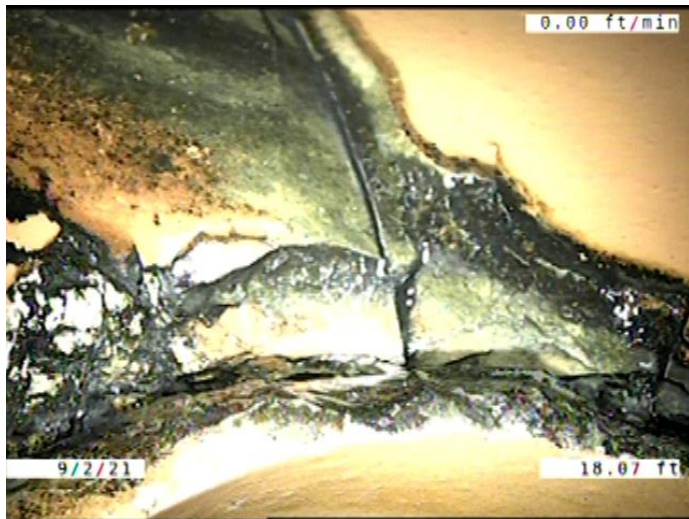

Code: **FM**  
 Description: **Fracture Multiple**


Distance (ft): **18.1**  
 Structural Grade: **4**  
 O&M Grade: **0**  
 Clock Start/From: **1**  
 Clock To: **5**  
 1st Value:  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **NO**  
 Remarks:

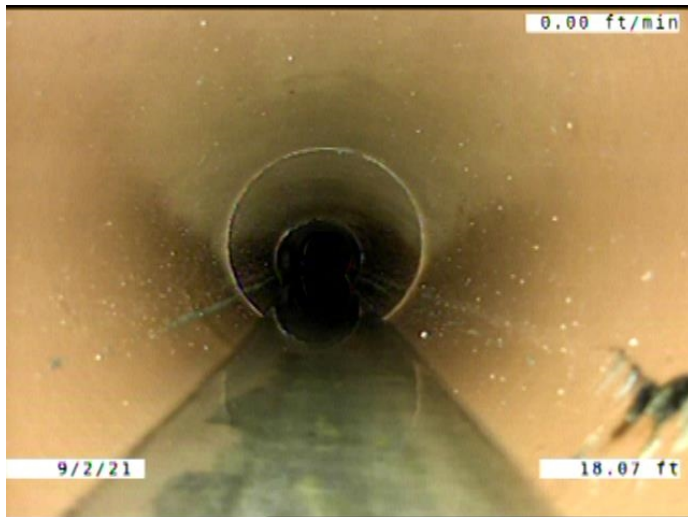

Code: **DSC**  
Description: **Deposits Settled Hard/Compacted**

Distance (ft): **18.1**  
Structural Grade: **0**  
O&M Grade: **2**  
Clock Start/From: **5**  
Clock To: **7**  
1st Value:  
2nd Value:  
Value Percent: **5.000**  
Continuous Index: **F01**  
Within 8" of Joint: **YES**  
Remarks:


---

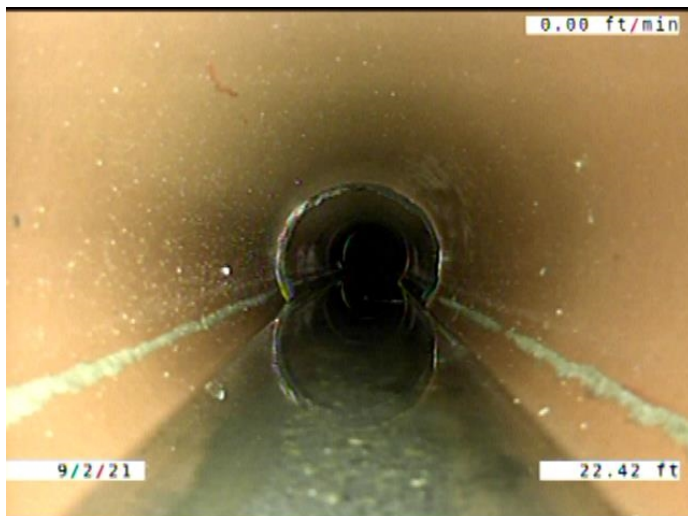

Code: **DSF**  
Description: **Deposits Settled Fine**


Distance (ft): **22.4**  
Structural Grade: **0**  
O&M Grade: **2**  
Clock Start/From: **5**  
Clock To: **7**  
1st Value:  
2nd Value:  
Value Percent: **5.000**  
Continuous Index: **S03**  
Within 8" of Joint: **YES**  
Remarks:

---

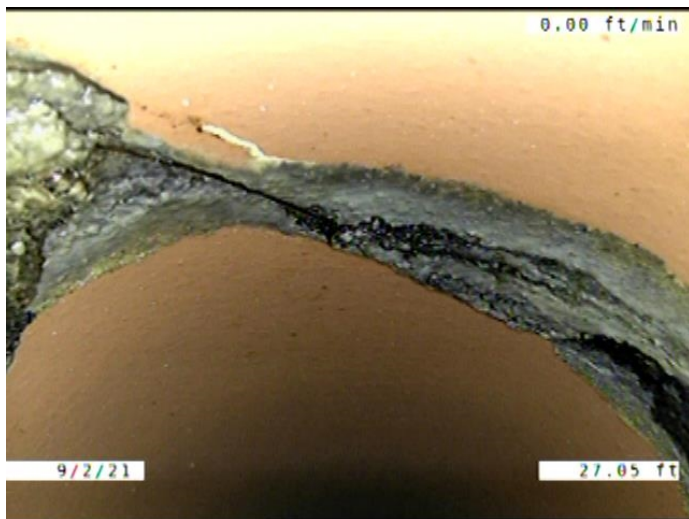

Code: **FS**  
 Description: **Fracture Spiral**


Distance (ft): **27.1**  
 Structural Grade: **3**  
 O&M Grade: **0**  
 Clock Start/From: **11**  
 Clock To: **2**  
 1st Value:  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **YES**  
 Remarks:

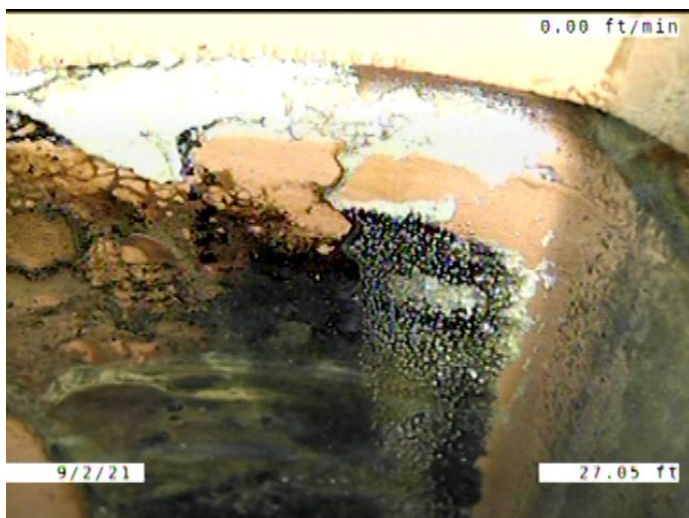


Code: **DAE**  
 Description: **Deposits Attached Encrustation**

Distance (ft): **27.1**  
 Structural Grade: **0**  
 O&M Grade: **2**  
 Clock Start/From: **8**  
 Clock To: **4**  
 1st Value:  
 2nd Value:  
 Value Percent: **5.000**  
 Continuous Index:  
 Within 8" of Joint: **YES**  
 Remarks:




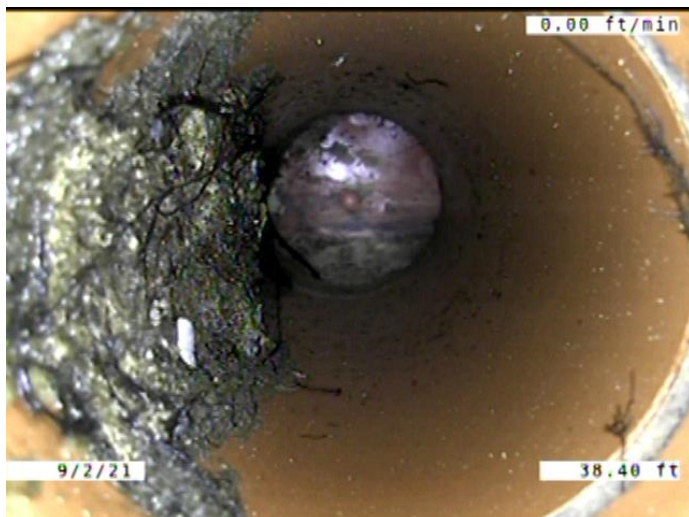

Code:	<b>TFC</b>
Description:	<b>Tap Factory Capped</b>
Distance (ft):	<b>38.4</b>
Structural Grade:	<b>0</b>
O&M Grade:	<b>0</b>
Clock Start/From:	<b>10</b>
Clock To:	
1st Value:	<b>6.000</b>
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	<b>YES</b>
Remarks:	<b>ROOTS GROWING IN AROUND THE CAP</b>

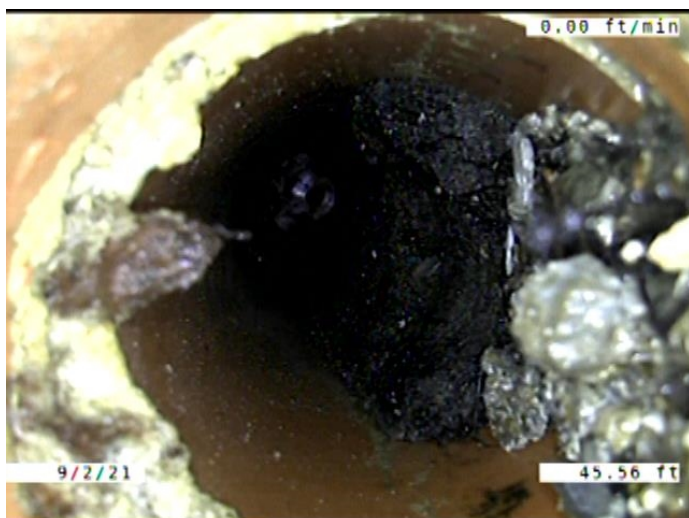


Code:	<b>TFC</b>
Description:	<b>Tap Factory Capped</b>
Distance (ft):	<b>45.6</b>
Structural Grade:	<b>0</b>
O&M Grade:	<b>0</b>
Clock Start/From:	<b>3</b>
Clock To:	
1st Value:	<b>6.000</b>
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	<b>YES</b>
Remarks:	<b>ENCRUSTATION AT THE FIRST JOINT BACK AND ROOTS GROWING IN THE</b>

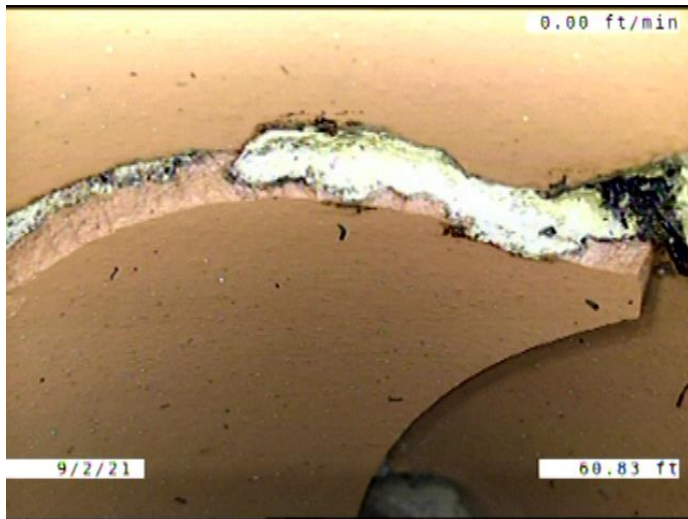


Code: **B**  
 Description: **Broken**

Distance (ft): **60.8**  
 Structural Grade: **4**  
 O&M Grade: **0**  
 Clock Start/From: **10**  
 Clock To: **6**  
 1st Value:  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **YES**  
 Remarks:

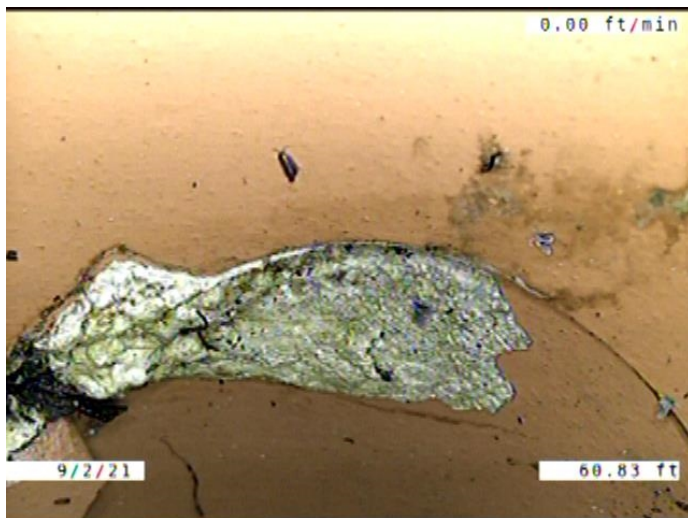


Code: **DAE**  
 Description: **Deposits Attached Encrustation**

Distance (ft): **60.8**  
 Structural Grade: **0**  
 O&M Grade: **2**  
 Clock Start/From: **10**  
 Clock To: **5**  
 1st Value:  
 2nd Value:  
 Value Percent: **5.000**  
 Continuous Index:  
 Within 8" of Joint: **YES**  
 Remarks:

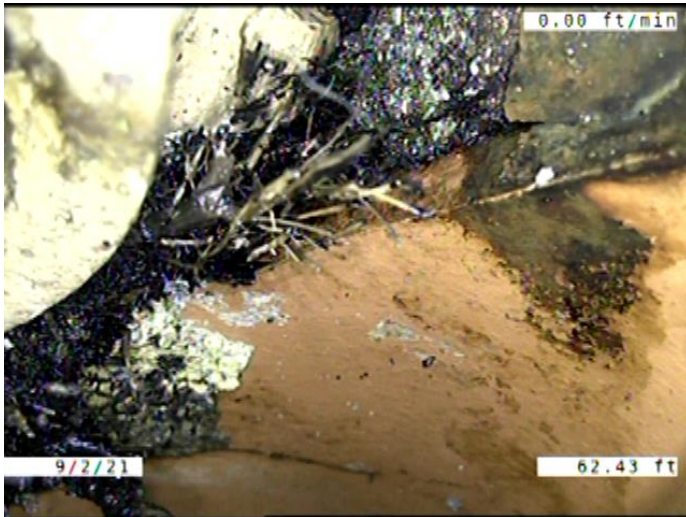

Code: **RFL**  
 Description: **Roots Fine Lateral**


Distance (ft): **62.4**  
 Structural Grade: **0**  
 O&M Grade: **1**  
 Clock Start/From: **1**  
 Clock To: **4**  
 1st Value:  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **NO**  
 Remarks:

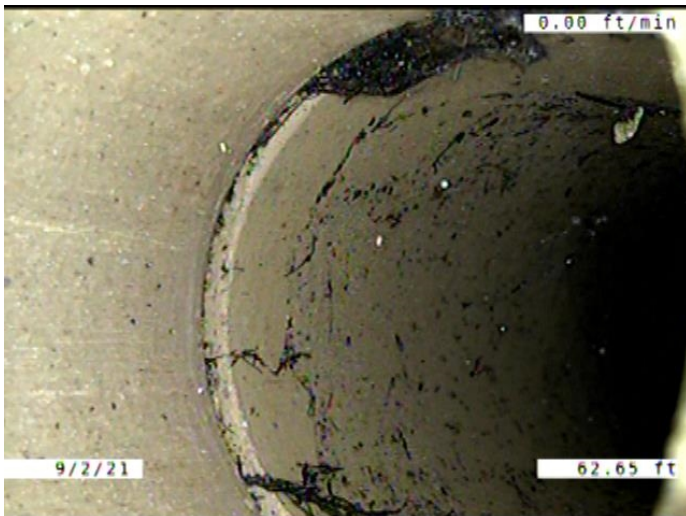

Code: **TBI**  
 Description: **Tap Break-in Intruding**


Distance (ft): **62.6**  
 Structural Grade: **0**  
 O&M Grade: **2**  
 Clock Start/From: **2**  
 Clock To:  
 1st Value: **6.000**  
 2nd Value: **1.000**  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **YES**  
 Remarks:



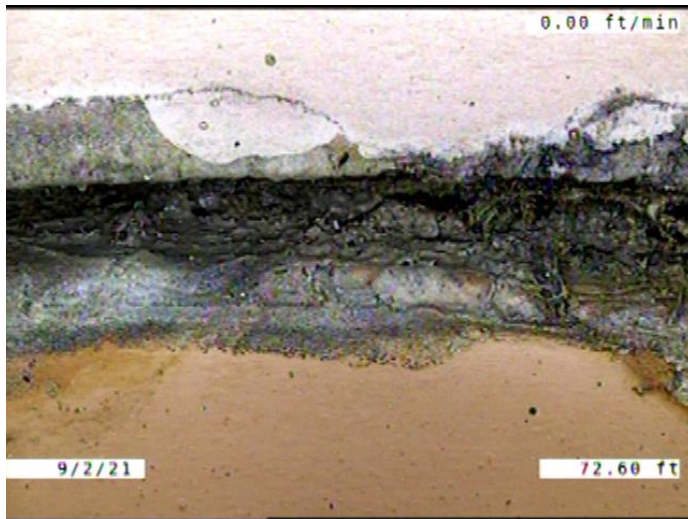

Code: **ISJ**  
Description: **Infiltration Stain Joint**

Distance (ft): **72.6**  
Structural Grade: **0**  
O&M Grade: **1**  
Clock Start/From: **8**  
Clock To: **4**  
1st Value:  
2nd Value:  
Value Percent:  
Continuous Index:  
Within 8" of Joint: **YES**  
Remarks:

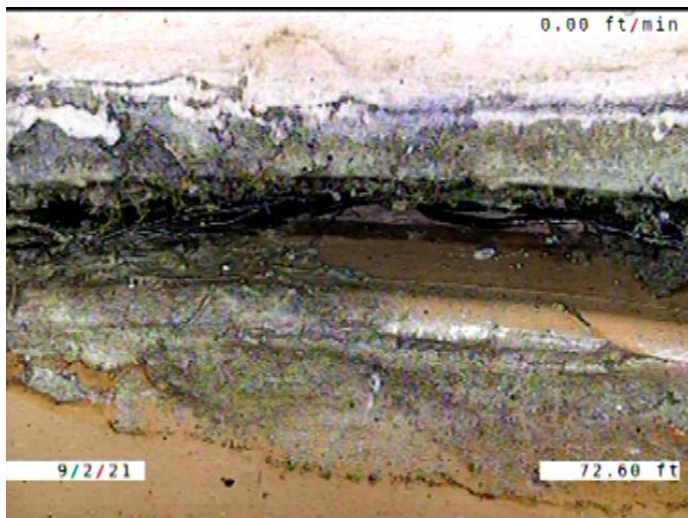

Code: **RFJ**  
Description: **Roots Fine Joint**


Distance (ft): **72.6**  
Structural Grade: **0**  
O&M Grade: **1**  
Clock Start/From: **1**  
Clock To: **2**  
1st Value:  
2nd Value:  
Value Percent:  
Continuous Index:  
Within 8" of Joint: **YES**  
Remarks:






Code: **TFC**  
 Description: **Tap Factory Capped**

Distance (ft): **78.6**  
 Structural Grade: **0**  
 O&M Grade: **0**  
 Clock Start/From: **10**  
 Clock To:  
 1st Value: **6.000**  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **YES**  
 Remarks:

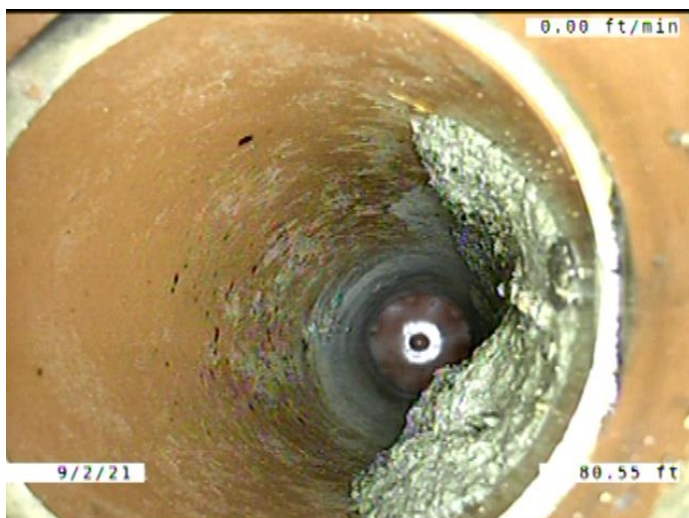


Code: **TFC**  
 Description: **Tap Factory Capped**

Distance (ft): **80.6**  
 Structural Grade: **0**  
 O&M Grade: **0**  
 Clock Start/From: **2**  
 Clock To:  
 1st Value: **6.000**  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **YES**  
 Remarks:

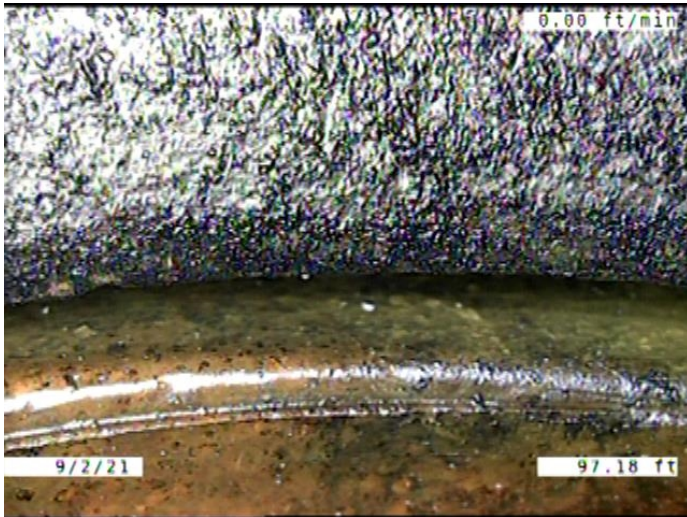


Code: **ISJ**  
 Description: **Infiltration Stain Joint**

Distance (ft): **97.2**  
 Structural Grade: **0**  
 O&M Grade: **1**  
 Clock Start/From: **8**  
 Clock To: **4**  
 1st Value:  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **YES**  
 Remarks:

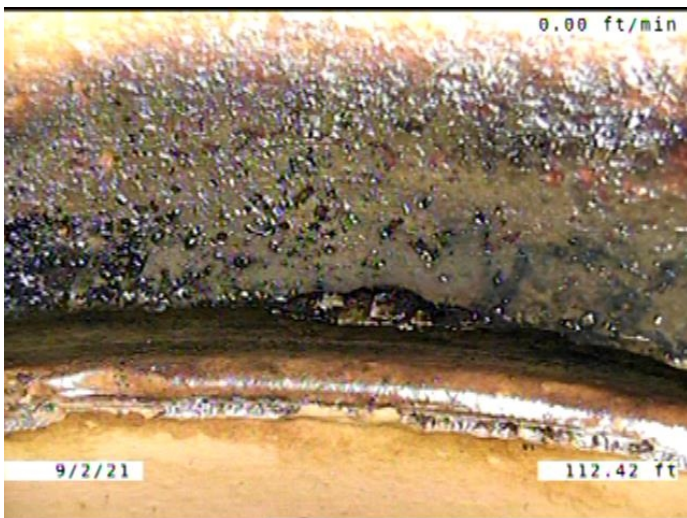


Code: **ISJ**  
 Description: **Infiltration Stain Joint**

Distance (ft): **112.4**  
 Structural Grade: **0**  
 O&M Grade: **1**  
 Clock Start/From: **8**  
 Clock To: **4**  
 1st Value:  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **YES**  
 Remarks:

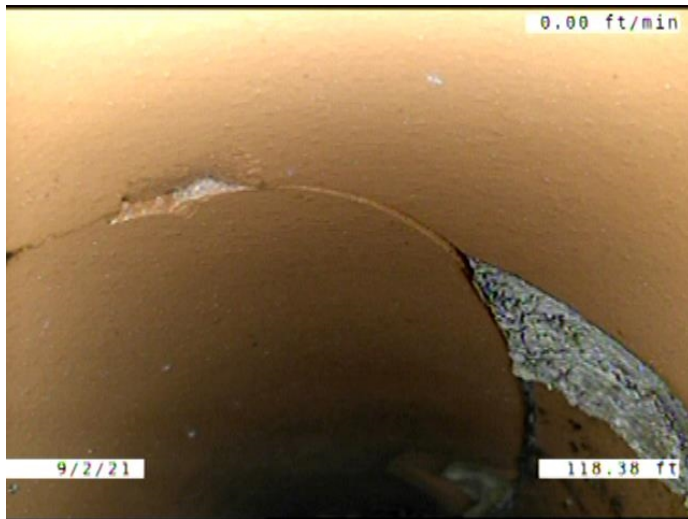

Code: **BSV**  
 Description: **Broken Soil Visible**


Distance (ft): **118.4**  
 Structural Grade: **5**  
 O&M Grade: **0**  
 Clock Start/From: **9**  
 Clock To: **3**  
 1st Value:  
 2nd Value:  
 Value Percent:  
 Continuous Index: **S04**  
 Within 8" of Joint: **YES**  
 Remarks:

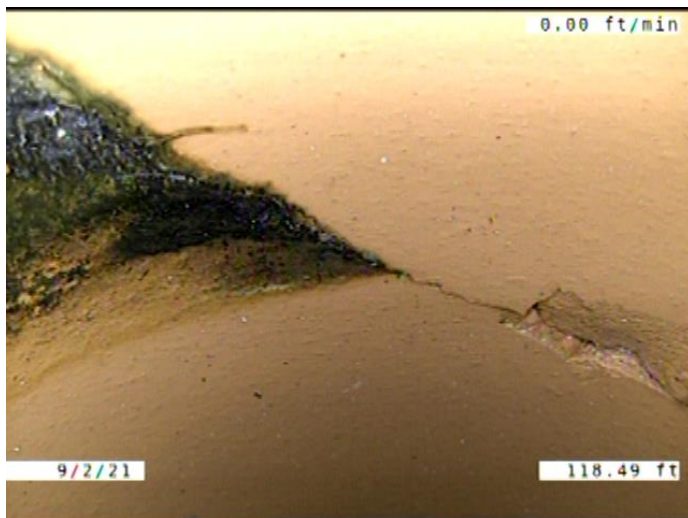

Code: **ISB**  
 Description: **Infiltration Stain Barrel**


Distance (ft): **118.5**  
 Structural Grade: **0**  
 O&M Grade: **1**  
 Clock Start/From: **9**  
 Clock To: **3**  
 1st Value:  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **YES**  
 Remarks:



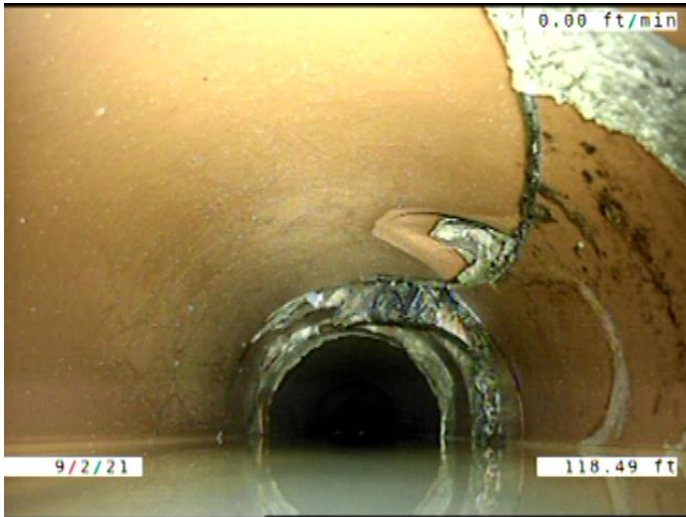

Code: **MWL**  
 Description: **Miscellaneous Water Level**


Distance (ft): **118.5**  
 Structural Grade: **0**  
 O&M Grade: **0**  
 Clock Start/From:  
 Clock To:  
 1st Value:  
 2nd Value:  
 Value Percent: **15.000**  
 Continuous Index:  
 Within 8" of Joint: **NO**  
 Remarks:

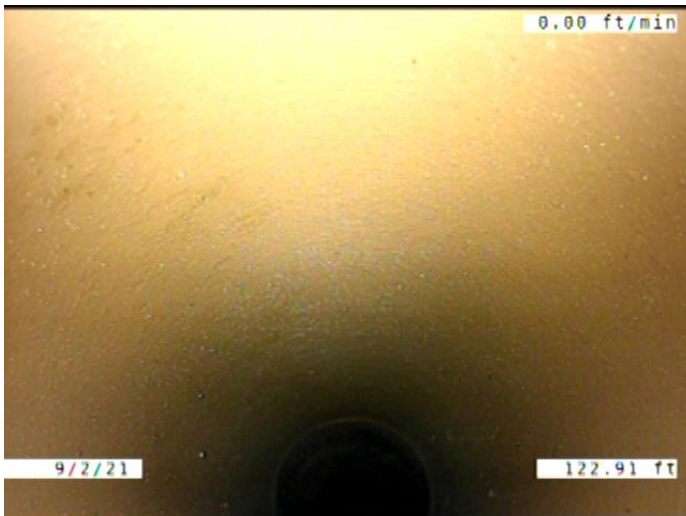

Code: **BSV**  
 Description: **Broken Soil Visible**


Distance (ft): **122.9**  
 Structural Grade: **5**  
 O&M Grade: **0**  
 Clock Start/From: **9**  
 Clock To: **3**  
 1st Value:  
 2nd Value:  
 Value Percent:  
 Continuous Index: **F04**  
 Within 8" of Joint: **YES**  
 Remarks:



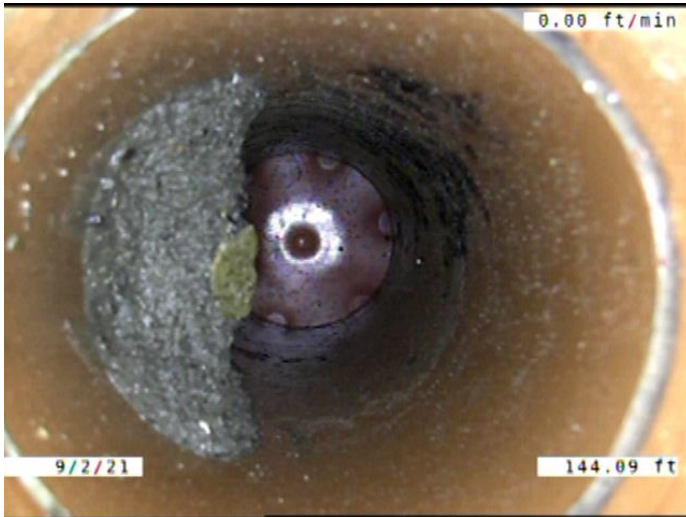


Code: **TFC**  
 Description: **Tap Factory Capped**

Distance (ft): **144.1**  
 Structural Grade: **0**  
 O&M Grade: **0**  
 Clock Start/From: **9**  
 Clock To:  
 1st Value: **6.000**  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **YES**  
 Remarks:

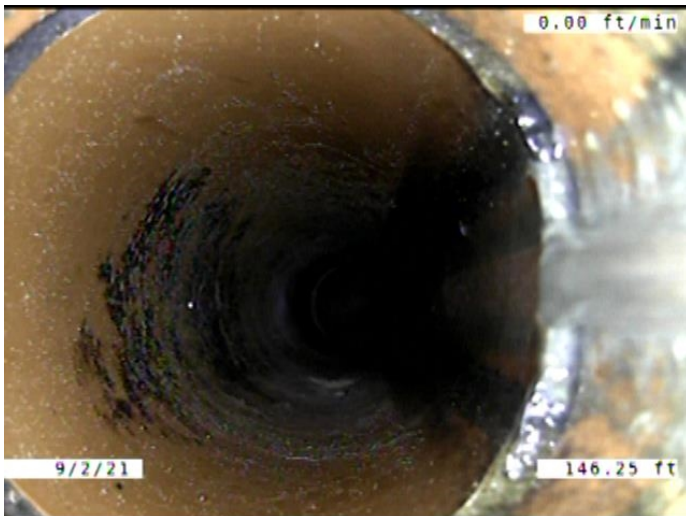


Code: **TFA**  
 Description: **Tap Factory Activity**

Distance (ft): **146.3**  
 Structural Grade: **0**  
 O&M Grade: **0**  
 Clock Start/From: **2**  
 Clock To:  
 1st Value: **6.000**  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **YES**  
 Remarks:

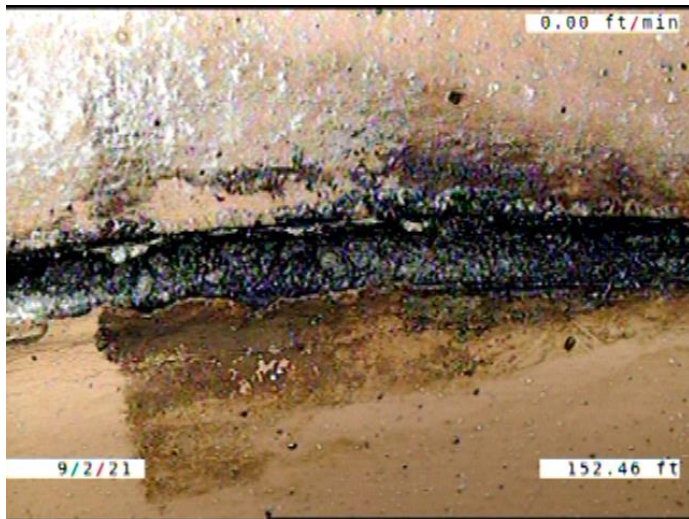


Code: **ISJ**  
 Description: **Infiltration Stain Joint**

Distance (ft): **152.5**  
 Structural Grade: **0**  
 O&M Grade: **1**  
 Clock Start/From: **9**  
 Clock To: **3**  
 1st Value:  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **YES**  
 Remarks:

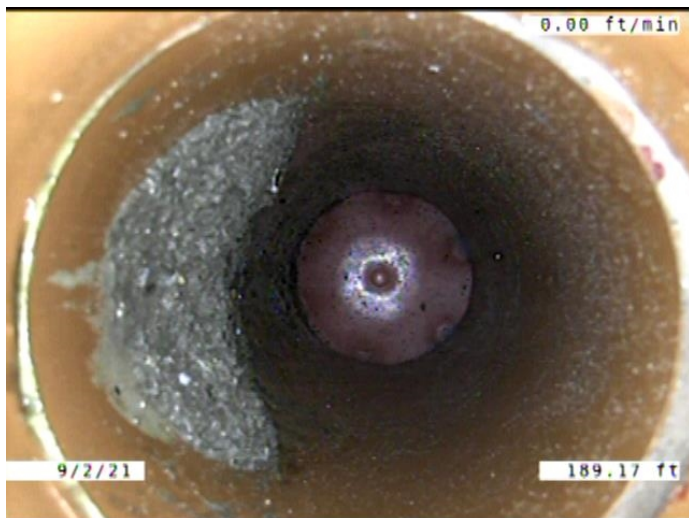


Code: **TFC**  
 Description: **Tap Factory Capped**

Distance (ft): **189.2**  
 Structural Grade: **0**  
 O&M Grade: **0**  
 Clock Start/From: **10**  
 Clock To:  
 1st Value: **4.000**  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **YES**  
 Remarks:

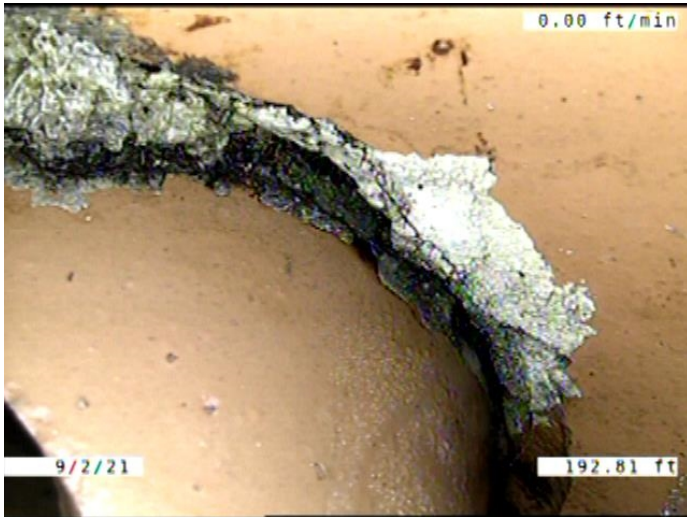


Code: **DAE**  
 Description: **Deposits Attached Encrustation**

Distance (ft): **192.8**  
 Structural Grade: **0**  
 O&M Grade: **2**  
 Clock Start/From: **9**  
 Clock To: **3**  
 1st Value:  
 2nd Value:  
 Value Percent: **5.000**  
 Continuous Index:  
 Within 8" of Joint: **NO**  
 Remarks:

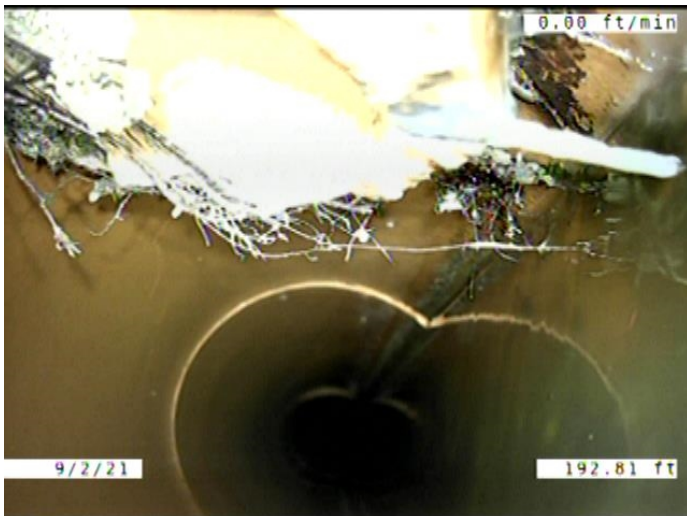

Code: **RML**  
 Description: **Roots Medium Lateral**


Distance (ft): **192.8**  
 Structural Grade: **0**  
 O&M Grade: **3**  
 Clock Start/From: **1**  
 Clock To: **4**  
 1st Value:  
 2nd Value:  
 Value Percent: **5.000**  
 Continuous Index:  
 Within 8" of Joint: **NO**  
 Remarks:

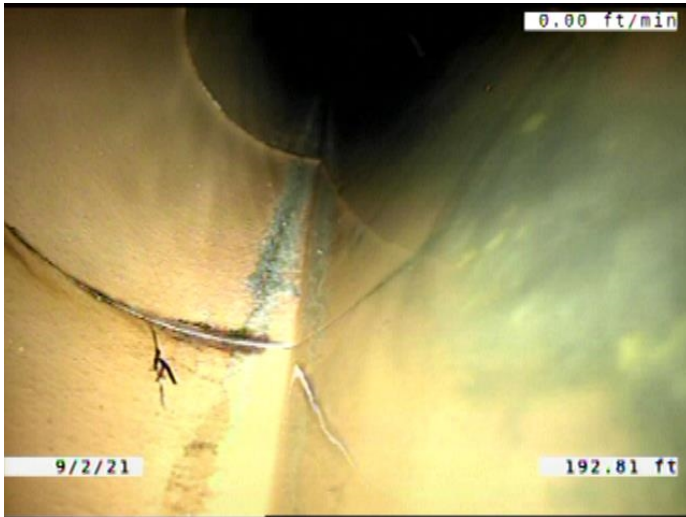

Code: **FM**  
Description: **Fracture Multiple**

Distance (ft): **192.8**  
Structural Grade: **4**  
O&M Grade: **0**  
Clock Start/From: **12**  
Clock To: **12**  
1st Value:  
2nd Value:  
Value Percent:  
Continuous Index:  
Within 8" of Joint: **NO**  
Remarks:

---

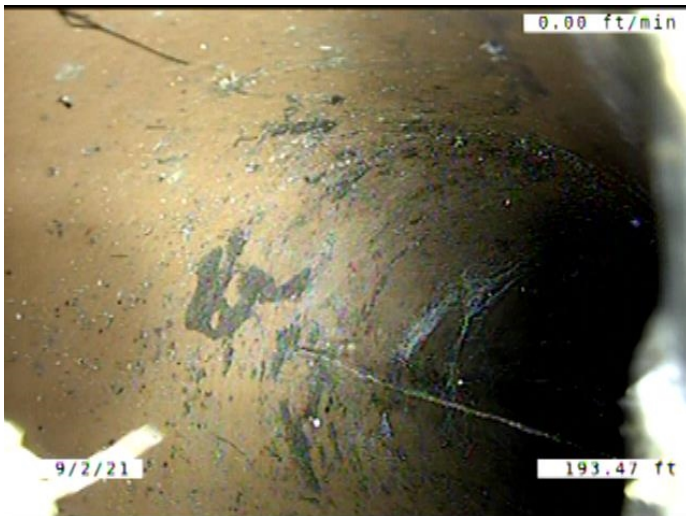

Code: **TBI**  
Description: **Tap Break-in Intruding**

Distance (ft): **193.5**  
Structural Grade: **0**  
O&M Grade: **2**  
Clock Start/From: **2**  
Clock To:  
1st Value: **6.000**  
2nd Value: **3.000**  
Value Percent:  
Continuous Index:  
Within 8" of Joint: **NO**  
Remarks:

---





Code: **DSF**  
 Description: **Deposits Settled Fine**

Distance (ft): **193.5**  
 Structural Grade: **0**  
 O&M Grade: **2**  
 Clock Start/From: **5**  
 Clock To: **7**  
 1st Value:  
 2nd Value:  
 Value Percent: **5.000**  
 Continuous Index: **F03**  
 Within 8" of Joint: **YES**  
 Remarks:



Code: **MSA**  
 Description: **Miscellaneous Survey Abandoned**

Distance (ft): **193.5**  
 Structural Grade: **0**  
 O&M Grade: **0**  
 Clock Start/From:  
 Clock To:  
 1st Value:  
 2nd Value:  
 Value Percent:  
 Continuous Index:  
 Within 8" of Joint: **NO**  
 Remarks: **CAMERA CANT MAKE IT PAST PROTRUDING TAP. MADE IT TO THE**