
Profile/Photo Observation Report



| Profile/Prioto Observation Report | | | | | | | | | |
|-----------------------------------|----------------------|--------------|-----------------|--------|--------------------------|-----------------|--|--|--|
| Date: | 04/25/2018 | Weather: | | | Coding: | PACP 6.0 | | | |
| Pipe Length (ft): | | Owner: | City of Hoba | rt | Pre Clean: | No Pre-Cleaning | | | |
| P.O.#: | 77 | Surveyor: | M. Pielacha | | PSR: | P-405-044-043 | | | |
| Customer: | City of Hobart | Clean Date: | | | Shape: | С | | | |
| Street: 3rd Street | | | Flow Control: | | Not Controlled | Not Controlled | | | |
| City: | Hobart, IN | | Year Renewed | : | | | | | |
| Location: | Light Highway | | Tape/Media# | : | 77 | | | | |
| Purpose: | Routine Assessme | ent | Dia/Height: | | 15" | | | | |
| Use: | Sanitary | | Material: | | СР | | | | |
| Drain Area: | | | Lining: | | | | | | |
| Category: | NA | | | | | | | | |
| Comment: | YES501824 Submi | tal 2 | | | | | | | |
| Location Detai | ls: | | Direction of Su | ırvey: | Downstream | | | | |
| US MH: | M-405-044 | DS MH: | M-405-043 | Tota | Il Length Surveyed (ft): | 61.1 | | | |
| O&M Index: | 3.00 | O&M Quick: | 3. | 300 | O&M Rating: | 9.00 | | | |
| Structural Index | 0.00 | Structural Q | | 000 | Structural Rating: | 0.00 | | | |
| Overall Index: | 3.00 | Overall Quic | k: 3. | 300 | Overall Rating: | 9.00 | | | |

| | Position | Code | Observation | Video (sec) | Grade |
|---------|----------|----------|-----------------------|-------------|-------|
| 405-044 | 4 | | | | |
| . /. | .0 | AMH | Manhole | 0 | NA |
| | .0 | MWL | Water Level | 8 | NA |
| | 7.4 | RMJ | Roots Medium Joint | 39 | M 3 |
| | 13.6 | RMJ | Roots Medium Joint | 76 | M 3 |
| | 56.2 | DSF(S01) | Deposits Settled Fine | 190 | M 3 |
| | 61.1 | DSF(F01) | Deposits Settled Fine | 364 | M 4 |
| | 61.1 | MSA | Abandoned Survey | 371 | NA |
| Ш | | | | | |
| | | | | | |

Code:

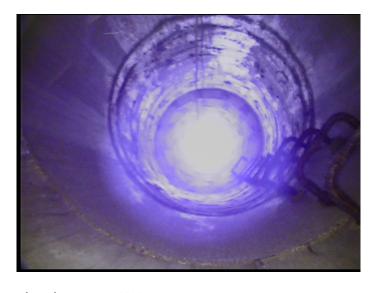

| Description: | Manhole |
|---------------------|-----------|
| Distance (ft): | .0 |
| Structural Grade: | 0 |
| O&M Grade: | 0 |
| Clock Start/From: | |
| Clock To: | |
| 1st Value: | |
| 2nd Value: | |
| Value Percent: | |
| Continuous Index: | |
| Within 8" of Joint: | NO |
| Remarks: | M-405-044 |
| | |

AMH



Code: MWL

Description: Water Level

Distance (ft): .0
Structural Grade: 0
O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value:

Value Percent: 10.000

Continuous Index:

Within 8" of Joint: NO

Remarks:



Code: RMJ

Description: Roots Medium Joint

Distance (ft): 7.4
Structural Grade: 0
O&M Grade: 3
Clock Start/From: 7
Clock To: 12
1st Value:

2nd Value:

Value Percent: 15.000

Continuous Index:

Within 8" of Joint: YES

Remarks:



Code: RMJ

Description: **Roots Medium Joint**

Distance (ft): 13.6 Structural Grade: 0 3 O&M Grade: Clock Start/From: 7 Clock To: 11

1st Value: 2nd Value:

Value Percent: 10.000

Continuous Index:

Within 8" of Joint:

Remarks:

YES



DSF Code:

Description: **Deposits Settled Fine**

Distance (ft): 56.2 Structural Grade: 0 O&M Grade: 3 Clock Start/From: 5 7 Clock To: 1st Value:

Value Percent: 15.000 Continuous Index: **S01** Within 8" of Joint: YES

Remarks:

2nd Value:

Thursday, May 4, 2023



Code: **DSF**

Description: Deposits Settled Fine

Distance (ft): 61.1
Structural Grade: 0
O&M Grade: 4
Clock Start/From: 5
Clock To: 7

1st Value: 2nd Value:

Value Percent: 25.000
Continuous Index: F01
Within 8" of Joint: NO

Remarks:

Code: MSA

Description: Abandoned Survey

Distance (ft): 61.1
Structural Grade: 0
O&M Grade: 0

Clock Start/From:

Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:

Within 8" of Joint: NO

Remarks: deep sediment