

Profile/Photo Observation Report



Date:	10/21/2021	Weather:		Coding:	PACP 7.0
Pipe Length (ft):	319.0	Owner:	City of Hobart	Pre Clean:	Heavy Cleaning
P.O.#:	YES502259	Surveyor:	S. Bucklin	PSR:	P-503-077-076
Customer:	City of Hobart	Clean Date:	08/23/2021	Shape:	C


Street:	North Guyer Street	Flow Control:	Not Controlled
City:	Hobart, IN	Year Renewed:	
Location:	Alley	Tape/Media #:	
Purpose:	Routine Assessment	Dia/Height:	10"
Use:	Sanitary Sewage Pipe	Material:	VCP
Drain Area:		Lining:	None
Category:	NA		
Comment:			
Location Details:		Direction of Survey:	Upstream
US MH:	M-503-076	DS MH:	M-503-077
		Total Length Surveyed (ft):	138.1

O&M Index:	1.96	O&M Quick:	3A24	O&M Rating:	53.00
Structural Index:	4.00	Structural Quick:	514B	Structural Rating:	72.00
Overall Index:	2.78	Overall Quick:	514B	Overall Rating:	125.00

	Position	Code	Observation	Video (sec)	Grade
	.0	AMH	Manhole	1	NA
	.0	MWL	Miscellaneous Water Level	63	NA
	.9	B	Broken	125	S 4
	.9	ISB	Infiltration Stain Barrel	157	M 1
	2.2	RTJ	Roots Tap Joint	205	M 2
	6.7	RTJ	Roots Tap Joint	247	M 2
	6.7	FH4(S01)	Fracture Longitudinal Hinge, 4	272	S 4
	16.9	ISJ	Infiltration Stain Joint	341	M 1
	21.8	RFJ	Roots Fine Joint	408	M 1
	21.9	DR	Deformed Rigid	422	S 5
	26.6	B	Broken	438	S 4
	27.5	DR	Deformed Rigid	458	S 4
	29.6	B	Broken	473	S 4
	36.7	FH4(F01)	Fracture Longitudinal Hinge, 4	503	S 4
	46.4	B(S02)	Broken	554	S 4
	51.7	RMJ	Roots Medium Joint	595	M 3
	53.2	TFD	Tap Factory Defective	630	M 3
	54.0	RFJ	Roots Fine Joint	659	M 1
	54.0	B(F02)	Broken	672	S 4


58.7	FS	Fracture Spiral	745	S 3
63.7	RFJ	Roots Fine Joint	803	M 1
78.9	RFJ	Roots Fine Joint	892	M 1
80.1	TFD	Tap Factory Defective	916	M 3
81.2	FM(S03)	Fracture Multiple	959	S 4
85.4	OBN	Obstruction Construction Debris	994	M 2
85.9	RFJ	Roots Fine Joint	1039	M 1
90.7	RMJ	Roots Medium Joint	1085	M 3
92.3	FM(F03)	Fracture Multiple	1123	S 4
105.8	RFJ	Roots Fine Joint	1203	M 1
105.8	ISJ	Infiltration Stain Joint	1236	M 1
110.8	RMJ(S04)	Roots Medium Joint	1277	M 3
124.0	OBN	Obstruction Construction Debris	1354	M 3
124.3	B	Broken	1432	S 4
124.3	ISB	Infiltration Stain Barrel	1459	M 1
130.0	B	Broken	1521	S 4
131.4	ISB	Infiltration Stain Barrel	1556	M 1
136.8	TFD	Tap Factory Defective	1627	M 3
137.4	RTJ	Roots Tap Joint	1661	M 2
137.4	RMJ(F04)	Roots Medium Joint	1675	M 3
138.1	ISJ	Infiltration Stain Joint	1753	M 1
138.1	MSA	Miscellaneous Survey Abandoned	1782	NA

M-503-076

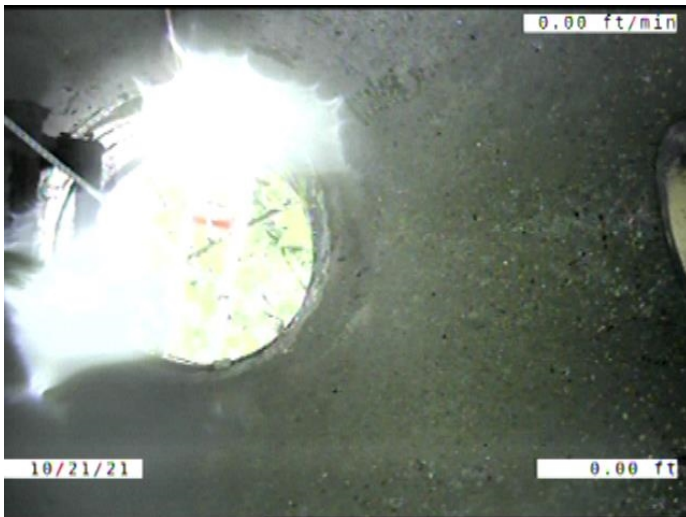


Code: **AMH**
Description: **Manhole**

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks: **M-503-077**

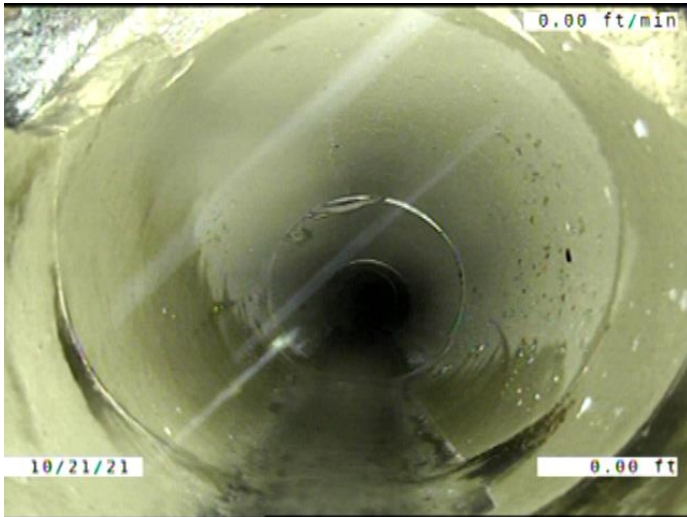


Code: **MWL**
 Description: **Miscellaneous Water Level**

Distance (ft): **.0**
 Structural Grade: **0**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks:

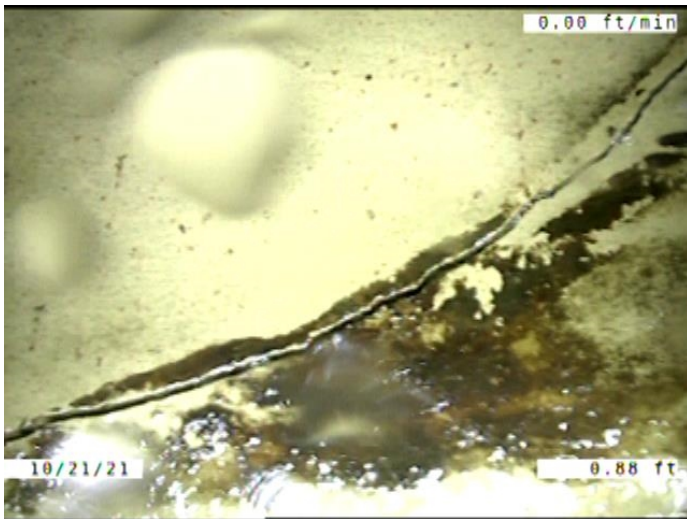

Code: **B**
 Description: **Broken**

Distance (ft): **.9**
 Structural Grade: **4**
 O&M Grade: **0**
 Clock Start/From: **12**
 Clock To: **12**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

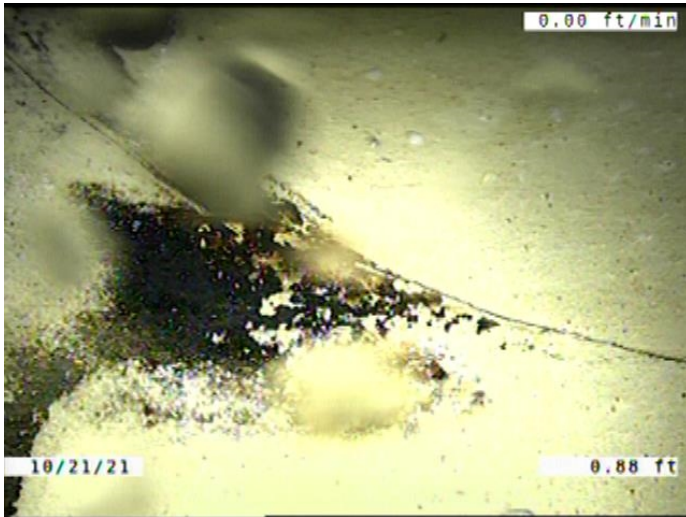


Code: **ISB**
 Description: **Infiltration Stain Barrel**

Distance (ft): **.9**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **3**
 Clock To: **9**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:



Code: **RTJ**
 Description: **Roots Tap Joint**

Distance (ft): **2.2**
 Structural Grade: **0**
 O&M Grade: **2**
 Clock Start/From: **10**
 Clock To: **1**
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

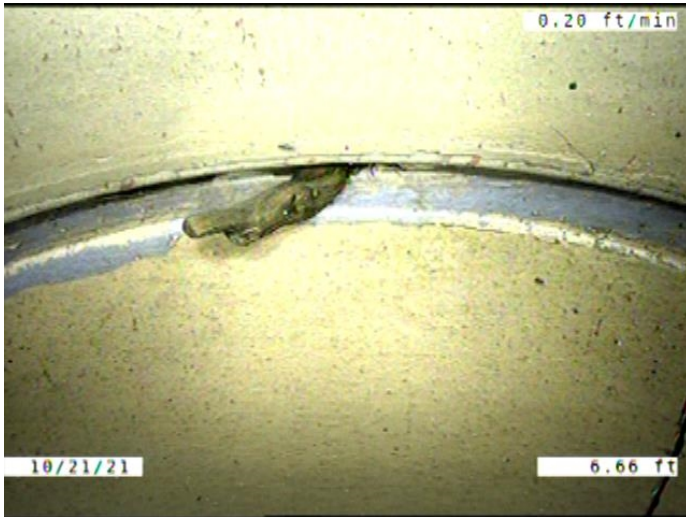


Code: **RTJ**
 Description: **Roots Tap Joint**

Distance (ft): **6.7**
 Structural Grade: **0**
 O&M Grade: **2**
 Clock Start/From: **11**
 Clock To:
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:




Code: **FH4**
 Description: **Fracture Longitudinal Hinge, 4**

Distance (ft): **6.7**
 Structural Grade: **4**
 O&M Grade: **0**
 Clock Start/From: **12**
 Clock To: **12**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index: **S01**
 Within 8" of Joint: **YES**
 Remarks:

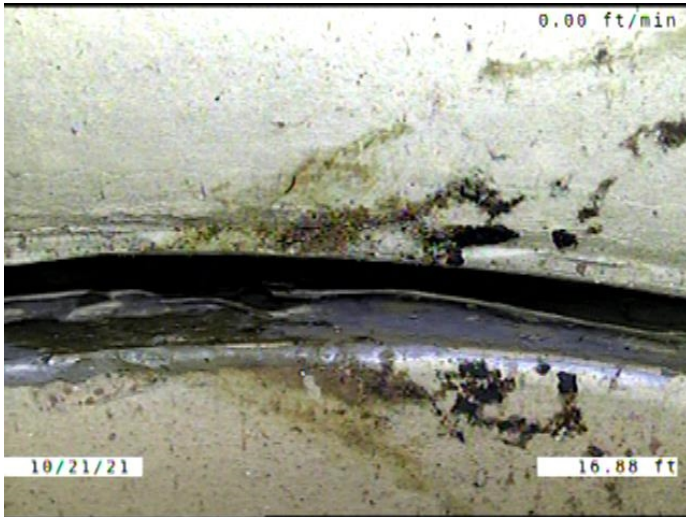

Code: **ISJ**
 Description: **Infiltration Stain Joint**

Distance (ft): **16.9**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **2**
 Clock To: **5**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

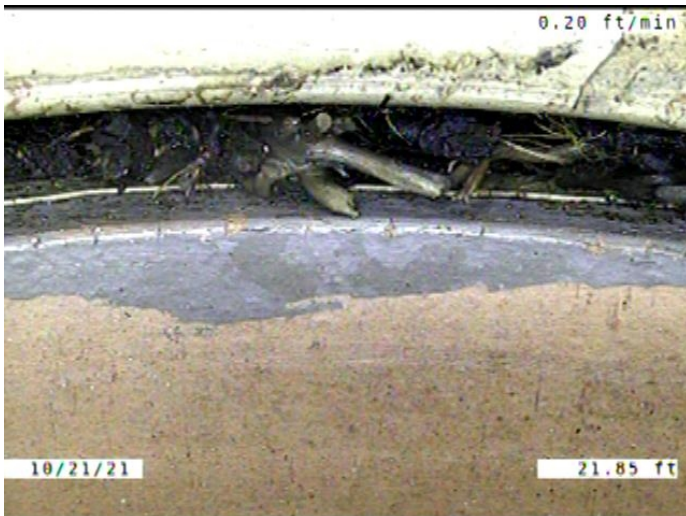

Code: **RFJ**
 Description: **Roots Fine Joint**

Distance (ft): **21.8**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **10**
 Clock To: **4**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:



Code: **DR**
Description: **Deformed Rigid**

Distance (ft): **21.9**
Structural Grade: **5**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent: **10.000**
Continuous Index:
Within 8" of Joint: **NO**
Remarks:




Code: **B**
Description: **Broken**

Distance (ft): **26.6**
Structural Grade: **4**
O&M Grade: **0**
Clock Start/From: **6**
Clock To: **8**
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks:




Code: **DR**
 Description: **Deformed Rigid**

Distance (ft): **27.5**
 Structural Grade: **4**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks:

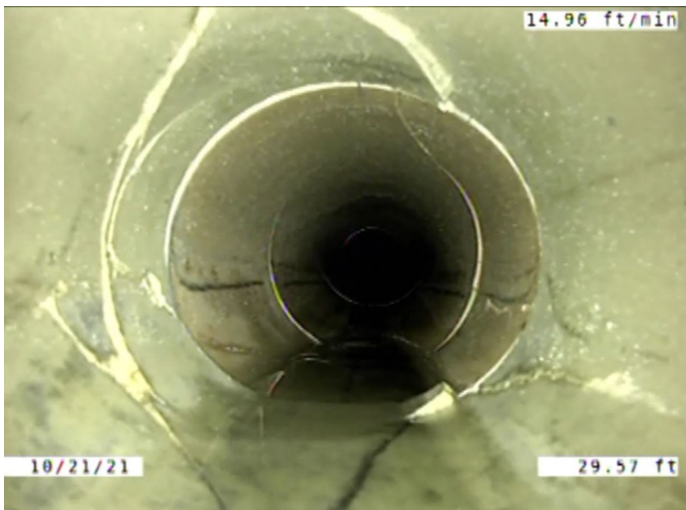


Code: **B**
 Description: **Broken**

Distance (ft): **29.6**
 Structural Grade: **4**
 O&M Grade: **0**
 Clock Start/From: **12**
 Clock To: **12**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

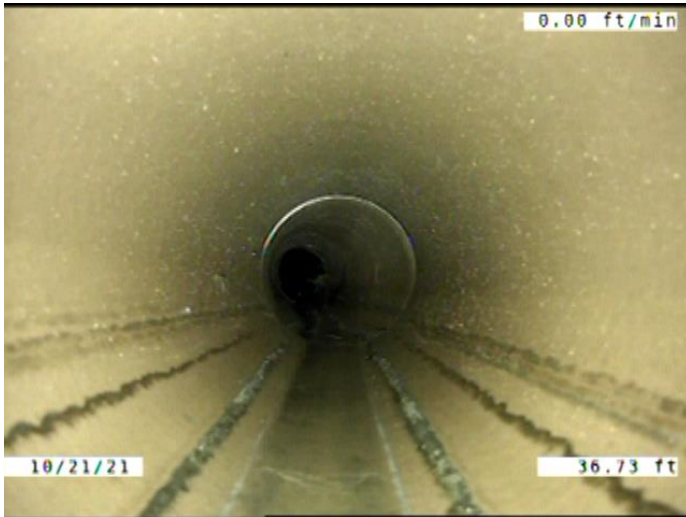

Code: **FH4**
Description: **Fracture Longitudinal Hinge, 4**

Distance (ft): **36.7**
Structural Grade: **4**
O&M Grade: **0**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Continuous Index: **F01**
Within 8" of Joint: **YES**
Remarks:

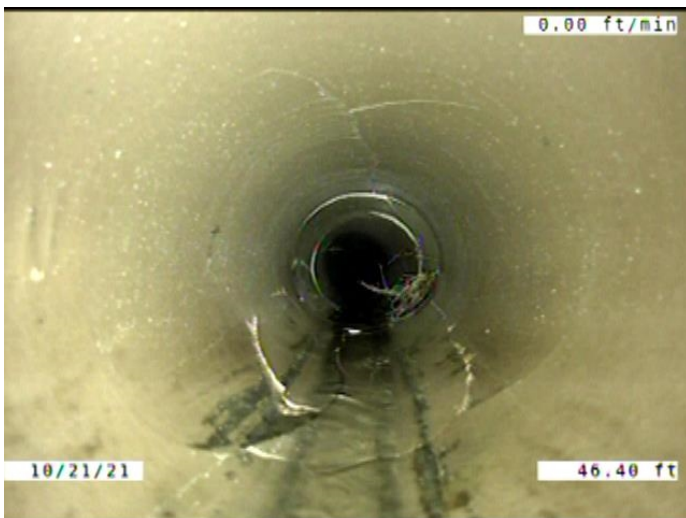

Code: **B**
Description: **Broken**

Distance (ft): **46.4**
Structural Grade: **4**
O&M Grade: **0**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Continuous Index: **S02**
Within 8" of Joint: **YES**
Remarks:




Code: **RMJ**
 Description: **Roots Medium Joint**

Distance (ft): **51.7**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **2**
 Clock To: **5**
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:



Code: **TFD**
 Description: **Tap Factory Defective**

Distance (ft): **53.2**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **1**
 Clock To:
 1st Value: **4.000**
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks: **Defective**

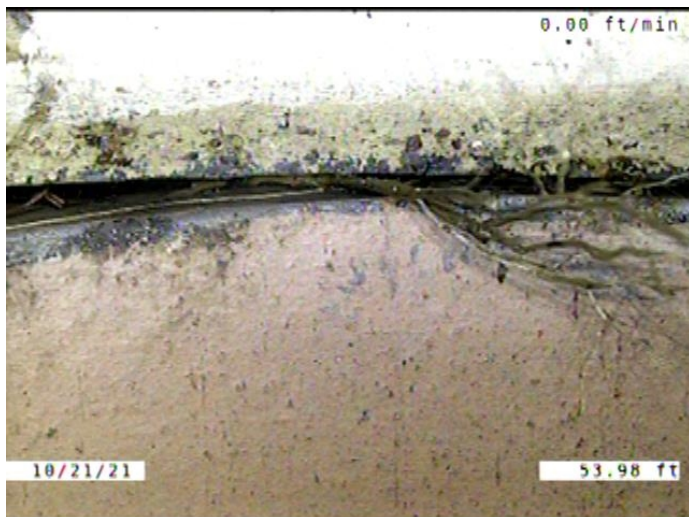


Code: **RFJ**
 Description: **Roots Fine Joint**

Distance (ft): **54.0**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **8**
 Clock To: **10**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:




Code: **B**
 Description: **Broken**

Distance (ft): **54.0**
 Structural Grade: **4**
 O&M Grade: **0**
 Clock Start/From: **12**
 Clock To: **12**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index: **F02**
 Within 8" of Joint: **YES**
 Remarks:

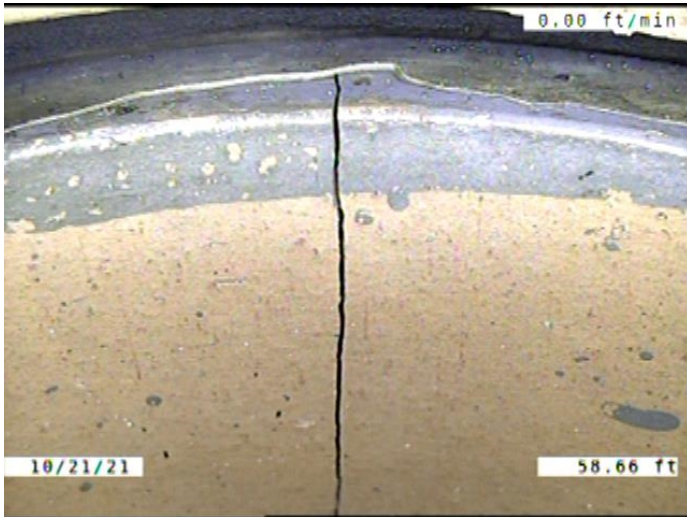

Code: **FS**
 Description: **Fracture Spiral**

Distance (ft): **58.7**
 Structural Grade: **3**
 O&M Grade: **0**
 Clock Start/From: **12**
 Clock To: **1**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

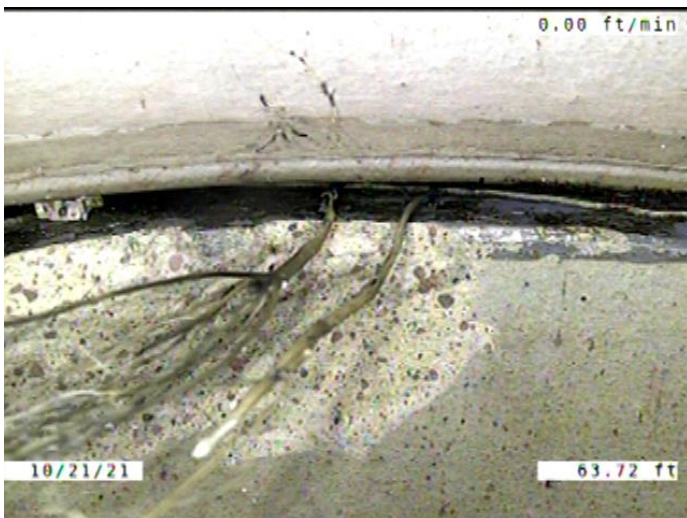

Code: **RFJ**
 Description: **Roots Fine Joint**

Distance (ft): **63.7**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **8**
 Clock To: **4**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:



Code: **RFJ**
Description: **Roots Fine Joint**

Distance (ft): **78.9**
Structural Grade: **0**
O&M Grade: **1**
Clock Start/From: **10**
Clock To: **2**
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **YES**
Remarks:



Code: **TFD**
Description: **Tap Factory Defective**

Distance (ft): **80.1**
Structural Grade: **0**
O&M Grade: **3**
Clock Start/From: **10**
Clock To:
1st Value: **4.000**
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **YES**
Remarks: **Defective**




Code: **FM**
 Description: **Fracture Multiple**

Distance (ft): **81.2**
 Structural Grade: **4**
 O&M Grade: **0**
 Clock Start/From: **12**
 Clock To: **12**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index: **S03**
 Within 8" of Joint: **YES**
 Remarks:




Code: **OBN**
 Description: **Obstruction Construction Debris**

Distance (ft): **85.4**
 Structural Grade: **0**
 O&M Grade: **2**
 Clock Start/From: **6**
 Clock To: **7**
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

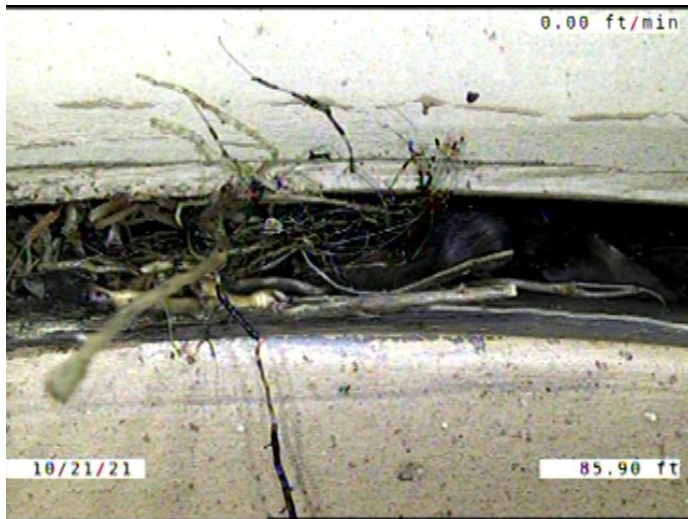

Code: **RFJ**
 Description: **Roots Fine Joint**

Distance (ft): **85.9**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **10**
 Clock To: **2**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

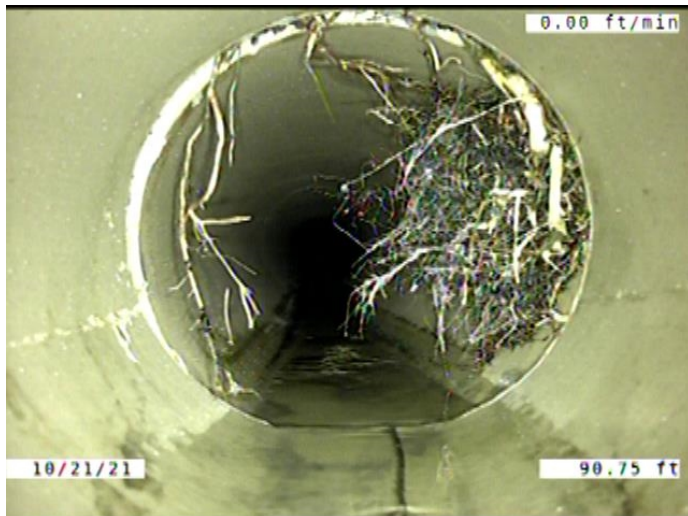


Code: **RMJ**
 Description: **Roots Medium Joint**

Distance (ft): **90.7**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **10**
 Clock To: **4**
 1st Value:
 2nd Value:
 Value Percent: **15.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:




Code: **FM**
 Description: **Fracture Multiple**

Distance (ft): **92.3**
 Structural Grade: **4**
 O&M Grade: **0**
 Clock Start/From: **12**
 Clock To: **12**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index: **F03**
 Within 8" of Joint: **YES**
 Remarks:

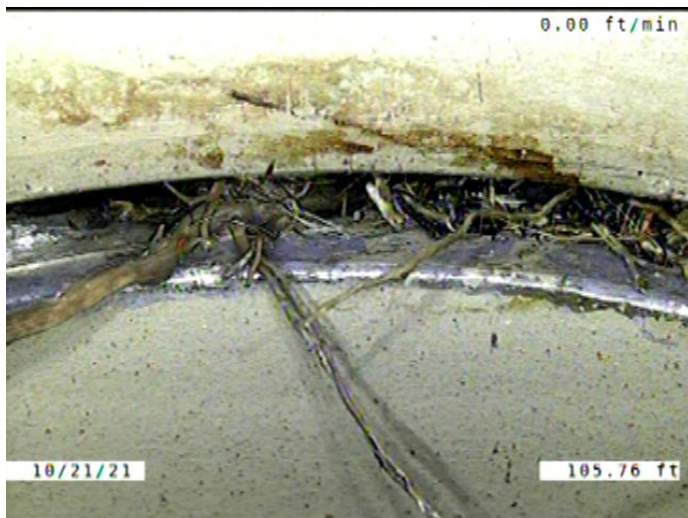


Code: **RFJ**
 Description: **Roots Fine Joint**

Distance (ft): **105.8**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **10**
 Clock To: **3**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

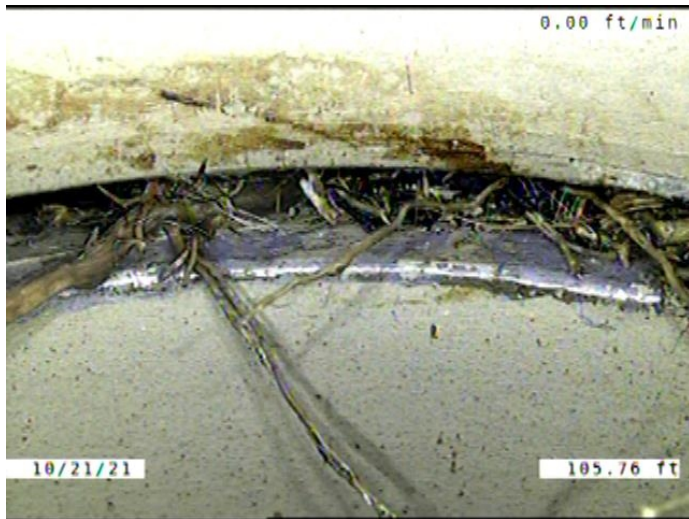


Code: **ISJ**
 Description: **Infiltration Stain Joint**

Distance (ft): **105.8**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **8**
 Clock To: **1**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

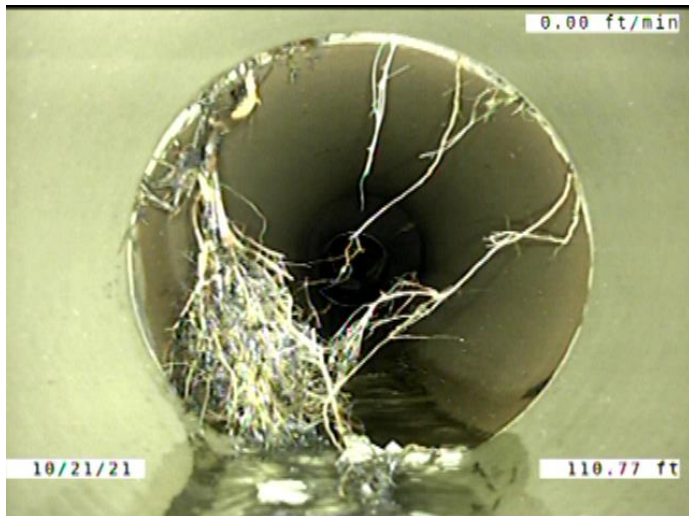


Code: **RMJ**
 Description: **Roots Medium Joint**


Distance (ft): **110.8**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **7**
 Clock To: **3**
 1st Value:
 2nd Value:
 Value Percent: **10.000**
 Continuous Index: **S04**
 Within 8" of Joint: **YES**
 Remarks:

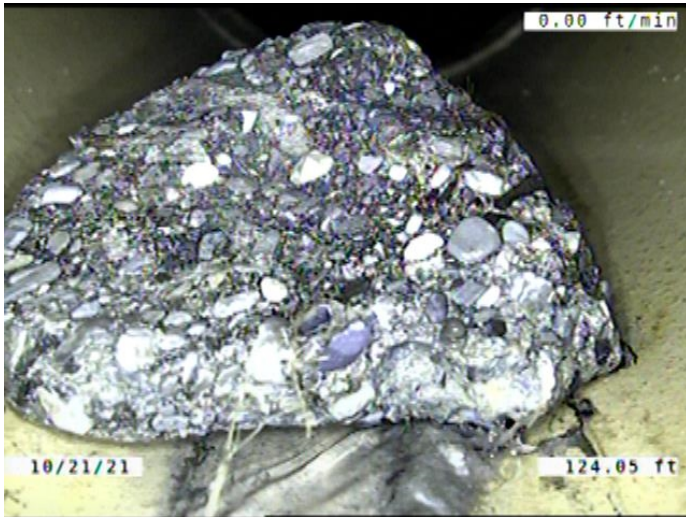

Code:	OBN
Description:	Obstruction Construction Debris
Distance (ft):	124.0
Structural Grade:	0
O&M Grade:	3
Clock Start/From:	5
Clock To:	7
1st Value:	
2nd Value:	
Value Percent:	15.000
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	

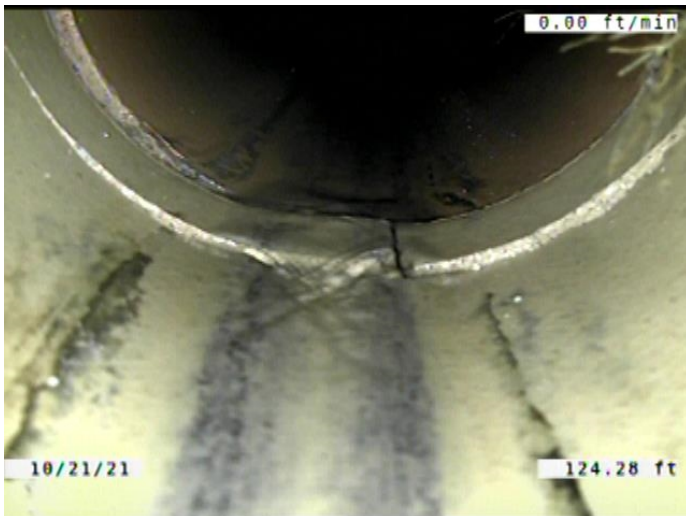


Code:	B
Description:	Broken
Distance (ft):	124.3
Structural Grade:	4
O&M Grade:	0
Clock Start/From:	2
Clock To:	9
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	

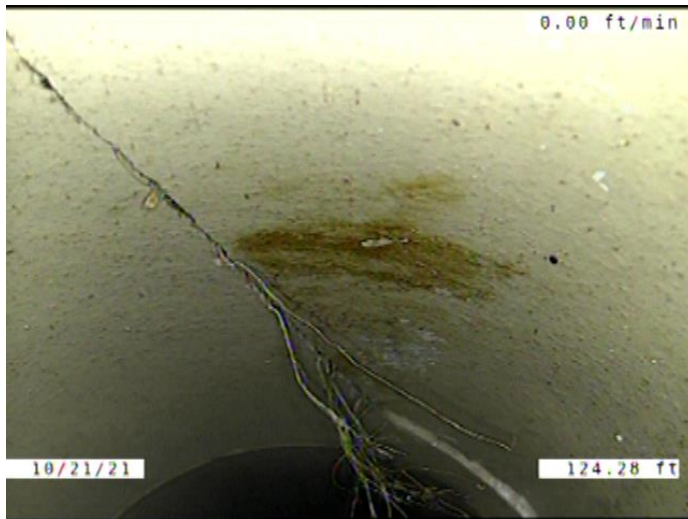


Code: **ISB**
 Description: **Infiltration Stain Barrel**

Distance (ft): **124.3**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **3**
 Clock To: **4**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

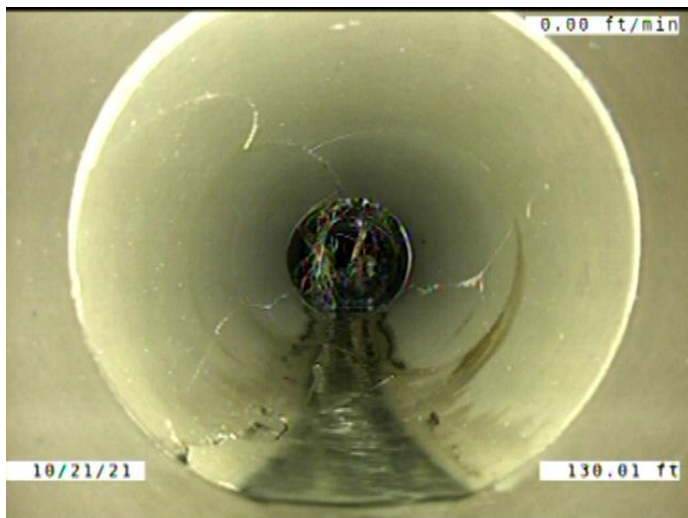


Code: **B**
 Description: **Broken**

Distance (ft): **130.0**
 Structural Grade: **4**
 O&M Grade: **0**
 Clock Start/From: **12**
 Clock To: **12**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

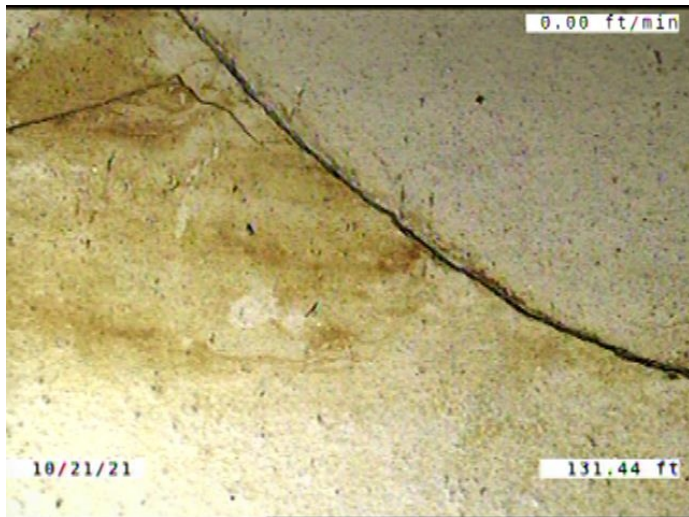


Code: **ISB**
 Description: **Infiltration Stain Barrel**

Distance (ft): **131.4**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **3**
 Clock To: **5**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks:

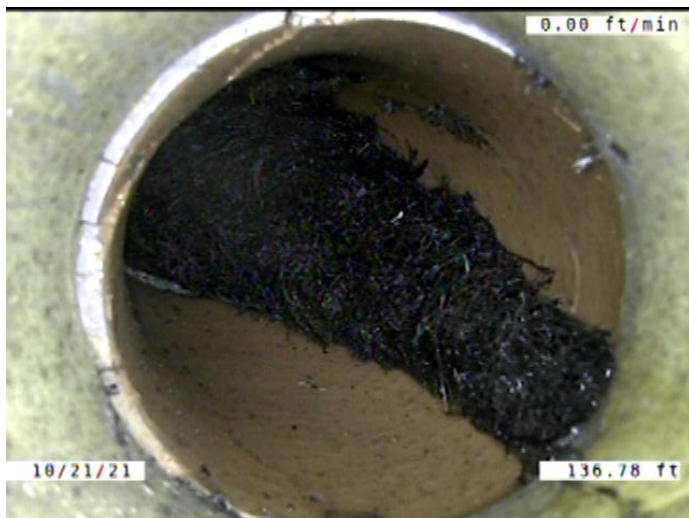

Code: **TFD**
 Description: **Tap Factory Defective**

Distance (ft): **136.8**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **2**
 Clock To:
 1st Value: **4.000**
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks: **Defective**

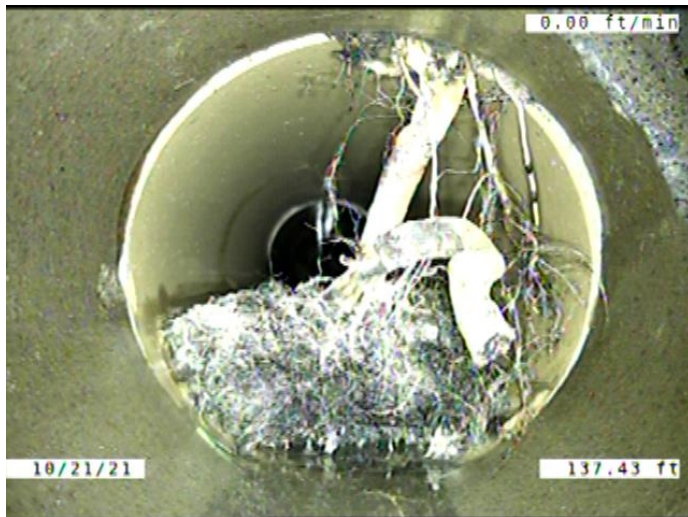


Code: **RTJ**
 Description: **Roots Tap Joint**

Distance (ft): **137.4**
 Structural Grade: **0**
 O&M Grade: **2**
 Clock Start/From: **12**
 Clock To: **8**
 1st Value:
 2nd Value:
 Value Percent: **35.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:



Code: **RMJ**
 Description: **Roots Medium Joint**

Distance (ft): **137.4**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **7**
 Clock To: **3**
 1st Value:
 2nd Value:
 Value Percent: **10.000**
 Continuous Index: **F04**
 Within 8" of Joint: **YES**
 Remarks:

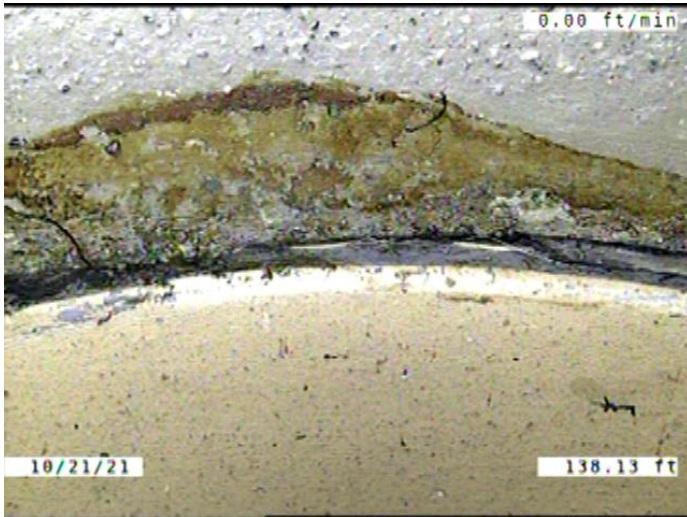

Code: **ISJ**
 Description: **Infiltration Stain Joint**

Distance (ft): **138.1**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **9**
 Clock To: **11**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:



Code: **MSA**
 Description: **Miscellaneous Survey Abandoned**

Distance (ft): **138.1**
 Structural Grade: **0**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks: **CAMERA CANT MAKE IT PAST TAP ROOT**