
Profile/Ph	oto Observatio	n Report			RedZone
Date: Pipe Length (ft P.O.#:	04/24/2018 :): 146.2	Weather: Owner: Surveyor:	NA Jen Costello	Coding: Pre Clean: PSR:	PACP 6.0 No Pre-Cleaning P-504-012-011
Customer:		, Clean Date:	01/01/1900	Shape:	С
Street:	W HOME AVE		Flow Control:	Not Controlle	d
City:	Hobart, IN		Year Renewed:		
Location:	Yard		Tape/Media #:		
Purpose:	Routine Assessme	ent	Dia/Height:	12"	
Use:	Sanitary		Material:	VCP	
Drain Area:	NA		Lining:		
Category:	NA				
Comment:	P_C at 19 ft build	up on the pipe. Flo	ow direction wron	g	
Location Detai	ls:		Direction of Surv	vey: Upstream	
US MH:	M-504-011	DS MH:	M-504-012	Total Length Surveyed (f	t): 20.5
0&M Index:	3.00	O&M Quick:	340	0 O&M Rating:	12.00
Structural Index:	0.00	Structural Qu	ick: 000		. 0.00
Overall Index:	3.00	Overall Quick	: 340	Overall Rating:	12.00





Code:	АМН
Description:	Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-504-012

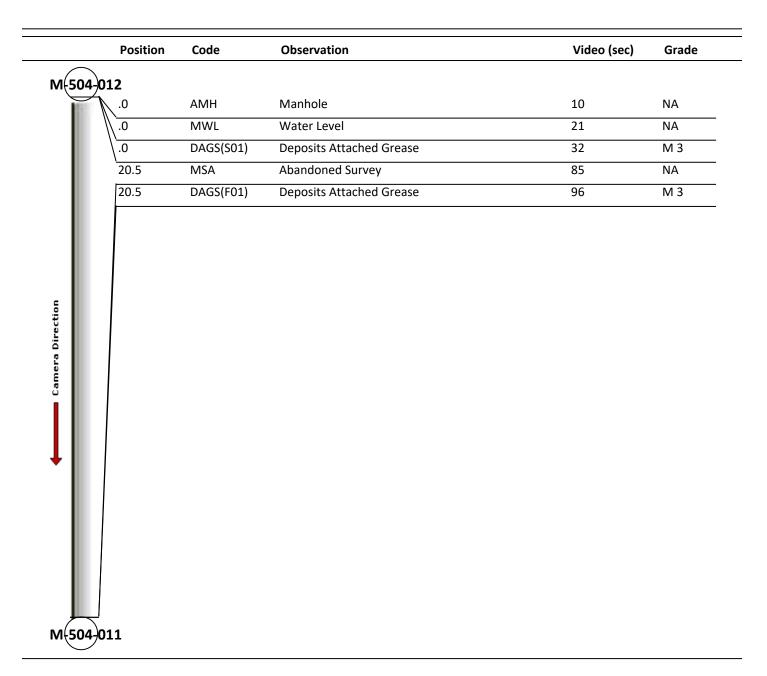

Code: MWL Description: Water Level

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	10.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	



Code:	DAGS
Description:	Deposits Attached Grease

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	3
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	20.000
Continuous Index:	S01
Within 8" of Joint:	NO
Remarks:	



Code: Description:	MSA Abandoned Survey
Distance (ft):	20.5
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	dags

DAGS

Deposits Attached Grease



Distance (ft):	20.5
Structural Grade:	0
O&M Grade:	3
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	20.000
Continuous Index:	F01
Within 8" of Joint:	NO
Remarks:	

Code:

Description:

Thursday, November 16, 2023