

Profile/Photo Observation Report



Date:	10/22/2021	Weather:		Coding:	PACP 7.0
Pipe Length (ft):	241.0	Owner:	City of Hobart	Pre Clean:	Light Cleaning
P.O.#:	YES502259	Surveyor:	S. Bucklin	PSR:	P-504-107-106
Customer:	City of Hobart	Clean Date:	08/30/2021	Shape:	C

Street:	42nd Avenue	Flow Control:	Not Controlled
City:	Hobart, IN	Year Renewed:	
Location:	Alley	Tape/Media #:	
Purpose:	Routine Assessment	Dia/Height:	8"
Use:	Sanitary Sewage Pipe	Material:	CP
Drain Area:		Lining:	
Category:	NA		
Comment:			
Location Details:		Direction of Survey:	Upstream
US MH:	M-504-106	DS MH:	M-504-107
		Total Length Surveyed (ft):	105.6

O&M Index:	1.86	O&M Quick:	4131	O&M Rating:	54.00
Structural Index:	2.72	Structural Quick:	5142	Structural Rating:	49.00
Overall Index:	2.19	Overall Quick:	5143	Overall Rating:	103.00

Position	Code	Observation	Video (sec)	Grade
.0	AMH	Manhole	1	NA
.0	MWL	Miscellaneous Water Level	80	NA
.2	DSC	Deposits Settled Hard/Compacted	109	M 2
.3	FC	Fracture Circumferential	175	S 2
.3	IWB	Infiltration Weeper Barrel	190	M 2
.3	ISB	Infiltration Stain Barrel	207	M 1
1.1	JAM	Joint Angular Medium	260	S 3
4.2	ISJ	Infiltration Stain Joint	318	M 1
4.6	FC	Fracture Circumferential	385	S 2
7.3	IRJ	Infiltration Runner Joint	433	M 4
24.0	MMC	Miscellaneous Material Change	563	NA
27.8	TF	Tap Factory	605	NA
29.8	MMC	Miscellaneous Material Change	654	NA
30.9	CS	Crack Spiral	709	S 2
30.9	DAE	Deposits Attached Encrustation	732	M 2
31.4	DSF(S01)	Deposits Settled Fine	756	M 2
38.6	MWLS(S02)	Miscellaneous Water Level Sag	800	S 2
48.7	DAE	Deposits Attached Encrustation	883	M 2
49.4	MWLS(F02)	Miscellaneous Water Level Sag	903	S 2

52.1	SMW	Surface Damage Missing Wall	979	S 5
52.1	FM	Fracture Multiple	1012	S 4
56.8	ISB	Infiltration Stain Barrel	1088	M 1
56.9	CM	Crack Multiple	1124	S 3
58.3	ISJ	Infiltration Stain Joint	1180	M 1
61.1	MMC	Miscellaneous Material Change	1235	NA
61.1	CM	Crack Multiple	1249	S 3
61.2	ISJ	Infiltration Stain Joint	1261	M 1
63.2	TF	Tap Factory	1292	NA
64.3	ISJ	Infiltration Stain Joint	1333	M 1
64.3	MMC	Miscellaneous Material Change	1344	NA
72.7	JOM	Joint Offset Medium	1408	S 3
74.7	MWLS(S03)	Miscellaneous Water Level Sag	1432	S 2
78.9	JOM	Joint Offset Medium	1467	S 3
79.5	MWLS(F03)	Miscellaneous Water Level Sag	1488	S 2
80.8	ISB	Infiltration Stain Barrel	1544	M 1
84.6	MWLS(S04)	Miscellaneous Water Level Sag	1602	S 2
94.2	MMC	Miscellaneous Material Change	1680	NA
96.3	TFD	Tap Factory Defective	1711	M 3
97.0	MMC	Miscellaneous Material Change	1759	NA
97.7	MWLS(F04)	Miscellaneous Water Level Sag	1782	S 2
102.8	JOM	Joint Offset Medium	1820	S 3
104.1	B	Broken	1876	S 4
105.0	TBI	Tap Break-in Intruding	1907	M 2
105.6	DSF(F01)	Deposits Settled Fine	1982	M 2
105.6	MSA	Miscellaneous Survey Abandoned	1991	NA

M-504-106




Code: **AMH**
Description: **Manhole**


Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks: **M-504-107**



Code:	MWL
Description:	Miscellaneous Water Level
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	

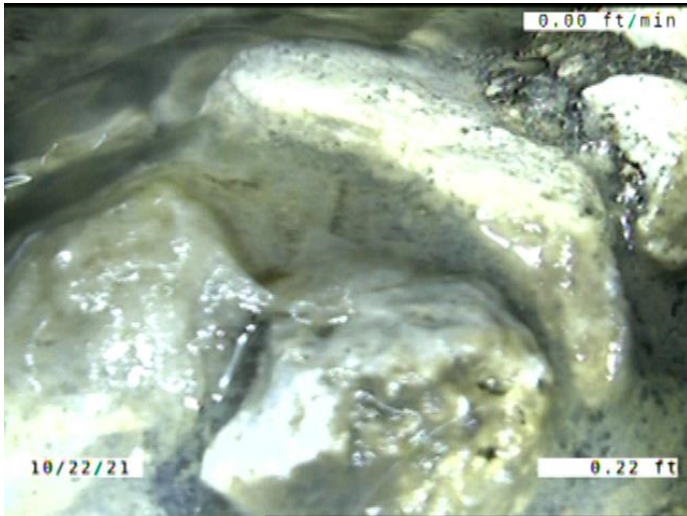


Code:	DSC
Description:	Deposits Settled Hard/Compacted
Distance (ft):	.2
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	4
Clock To:	7
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	

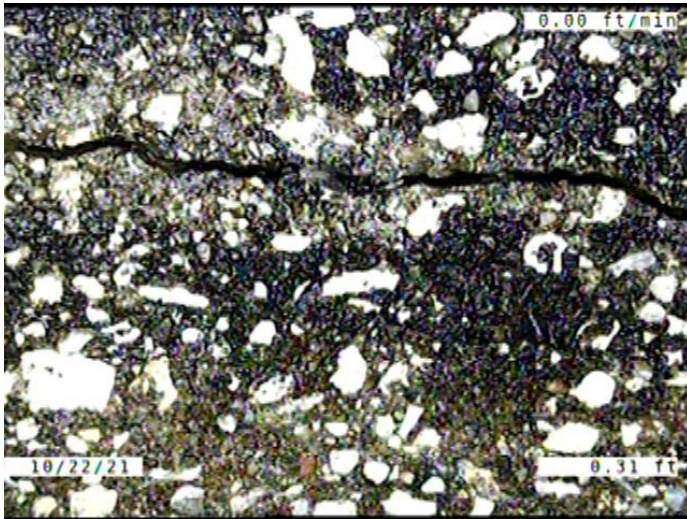


Code: **FC**
 Description: **Fracture Circumferential**

Distance (ft): **.3**
 Structural Grade: **2**
 O&M Grade: **0**
 Clock Start/From: **12**
 Clock To: **12**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

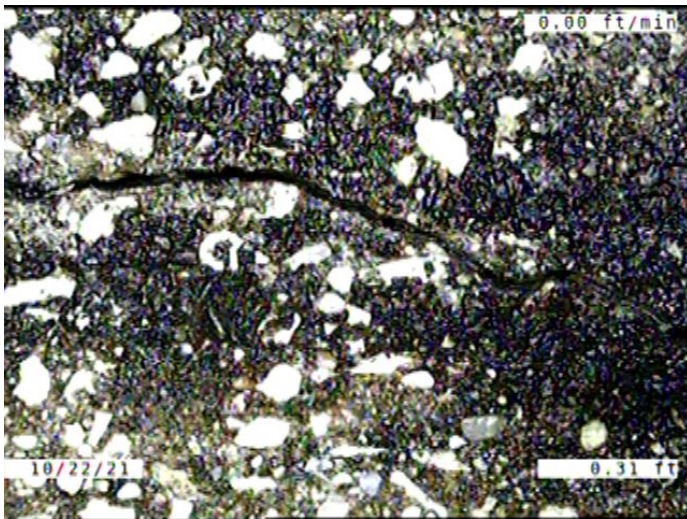


Code: **IWB**
 Description: **Infiltration Weeper Barrel**

Distance (ft): **.3**
 Structural Grade: **0**
 O&M Grade: **2**
 Clock Start/From: **11**
 Clock To: **12**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

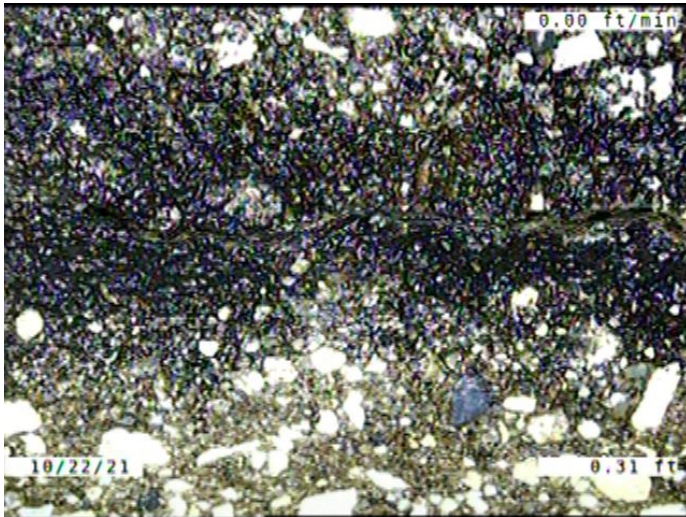


Code: **ISB**
 Description: **Infiltration Stain Barrel**

Distance (ft): **.3**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **8**
 Clock To: **4**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

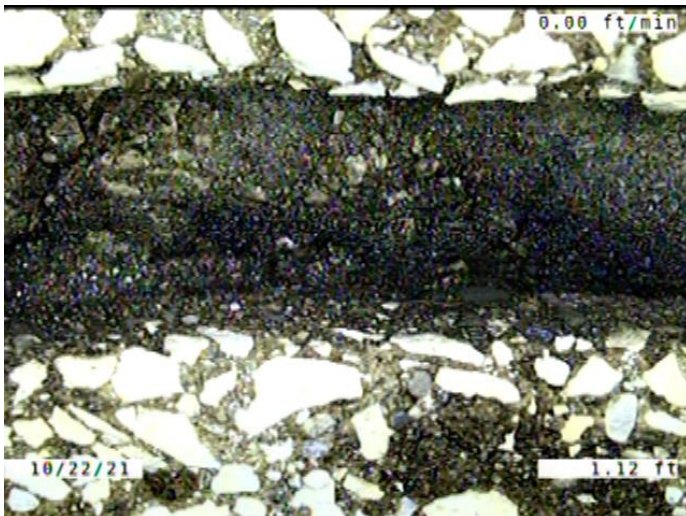


Code: **JAM**
 Description: **Joint Angular Medium**

Distance (ft): **1.1**
 Structural Grade: **3**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks:

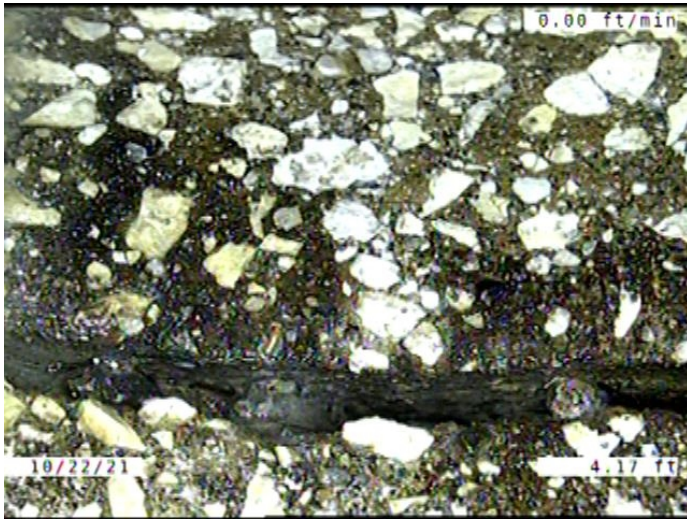


Code: **ISJ**
 Description: **Infiltration Stain Joint**

Distance (ft): **4.2**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **4**
 Clock To: **5**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

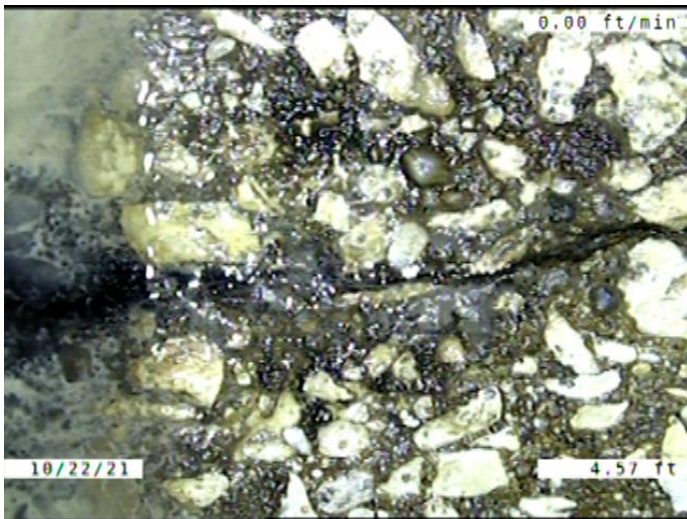


Code: **FC**
 Description: **Fracture Circumferential**

Distance (ft): **4.6**
 Structural Grade: **2**
 O&M Grade: **0**
 Clock Start/From: **1**
 Clock To: **10**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

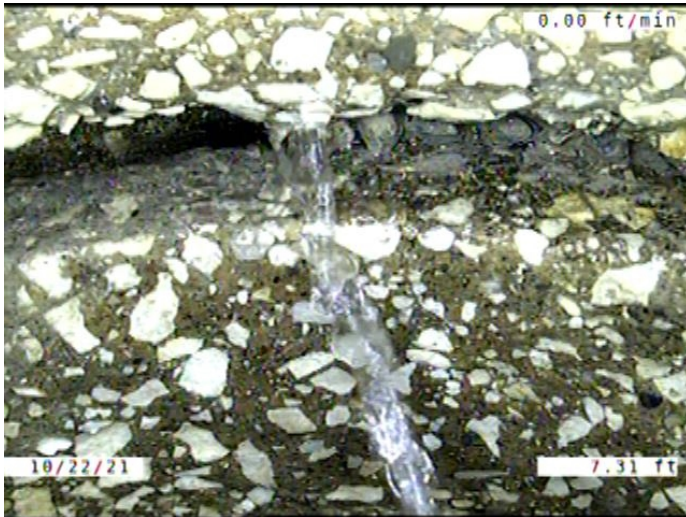


Code: **IRJ**
Description: **Infiltration Runner Joint**

Distance (ft): **7.3**
Structural Grade: **0**
O&M Grade: **4**
Clock Start/From: **12**
Clock To: **1**
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **YES**
Remarks:

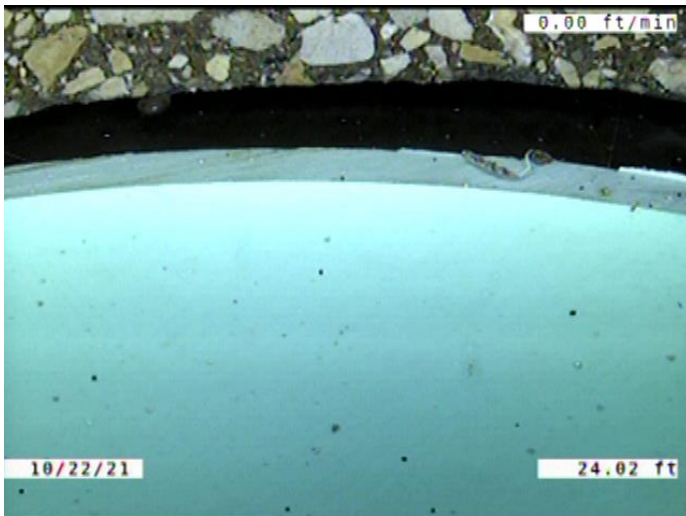


Code: **MMC**
Description: **Miscellaneous Material Change**

Distance (ft): **24.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks: **CONCRETE TO PVC.**

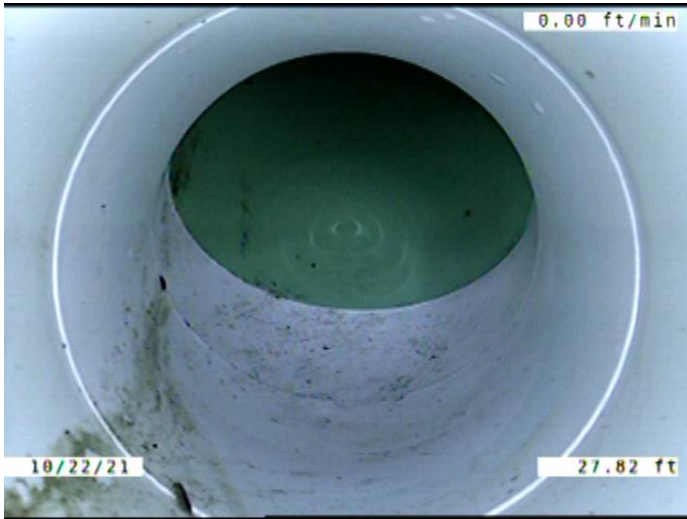


Code: **TF**
Description: **Tap Factory**

Distance (ft): **27.8**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From: **10**
Clock To:
1st Value: **4.000**
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **YES**
Remarks:

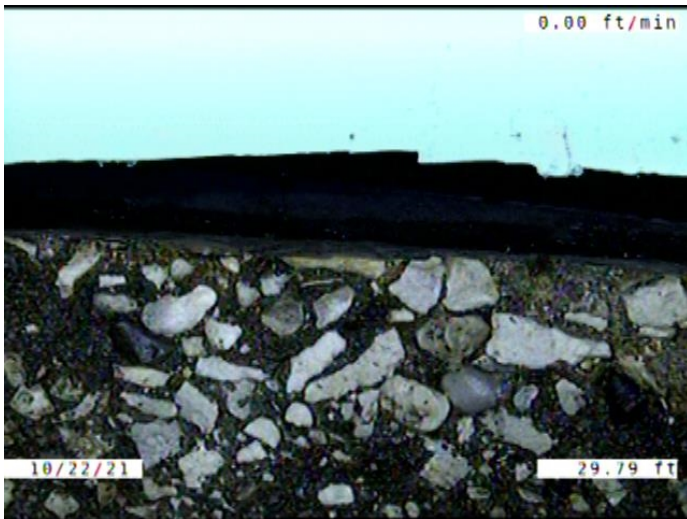


Code: **MMC**
Description: **Miscellaneous Material Change**

Distance (ft): **29.8**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks: **PVC TO CONCRETE**

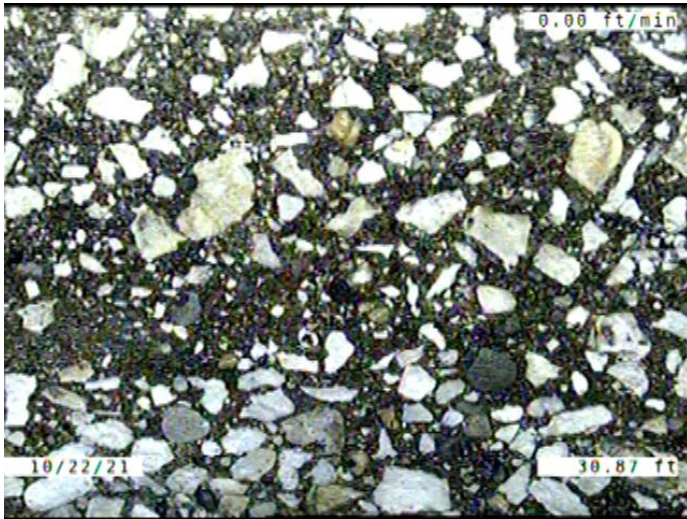


Code: **CS**
 Description: **Crack Spiral**

Distance (ft): **30.9**
 Structural Grade: **2**
 O&M Grade: **0**
 Clock Start/From: **12**
 Clock To: **12**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

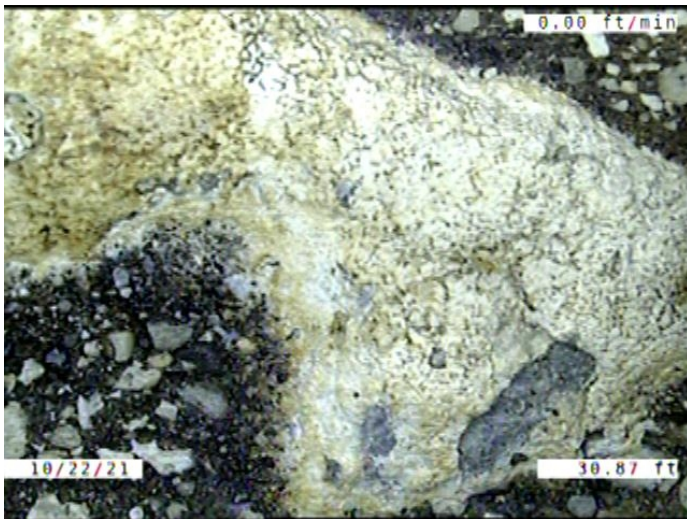


Code: **DAE**
 Description: **Deposits Attached Encrustation**

Distance (ft): **30.9**
 Structural Grade: **0**
 O&M Grade: **2**
 Clock Start/From: **7**
 Clock To: **9**
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

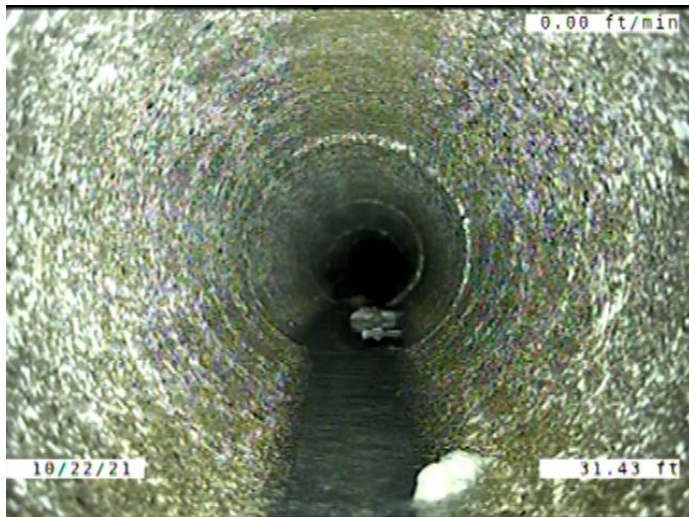


Code: **DSF**
 Description: **Deposits Settled Fine**

Distance (ft): **31.4**
 Structural Grade: **0**
 O&M Grade: **2**
 Clock Start/From: **5**
 Clock To: **7**
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index: **S01**
 Within 8" of Joint: **YES**
 Remarks:

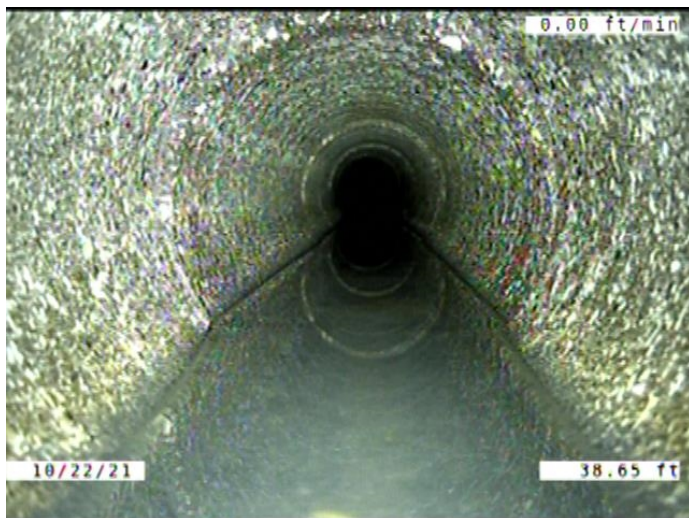

Code: **MWLS**
 Description: **Miscellaneous Water Level Sag**


Distance (ft): **38.6**
 Structural Grade: **2**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index: **S02**
 Within 8" of Joint: **NO**
 Remarks:

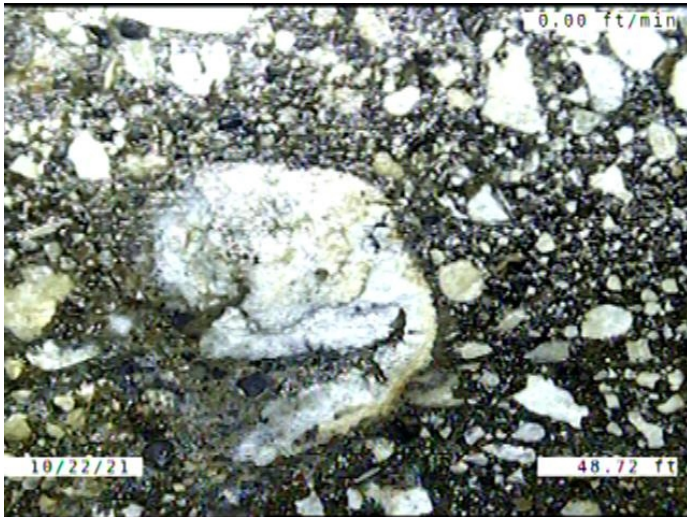

Code:	DAE
Description:	Deposits Attached Encrustation
Distance (ft):	48.7
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	7
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	




Code:	MWLS
Description:	Miscellaneous Water Level Sag
Distance (ft):	49.4
Structural Grade:	2
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	F02
Within 8" of Joint:	NO
Remarks:	

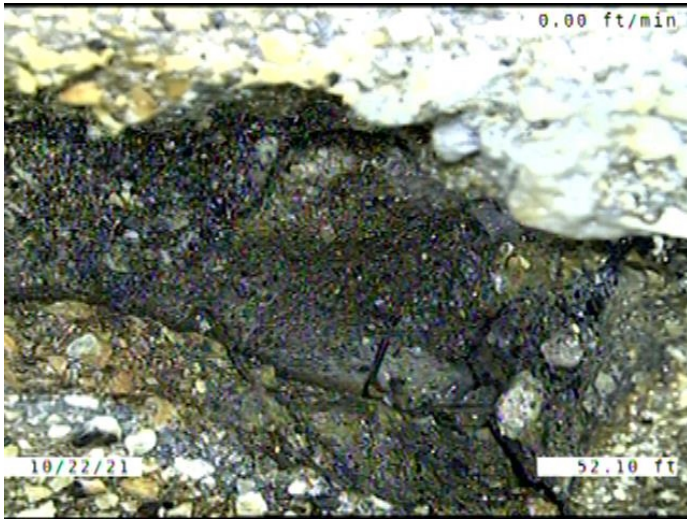


Code: **SMW**
Description: **Surface Damage Missing Wall**

Distance (ft): **52.1**
Structural Grade: **5**
O&M Grade: **0**
Clock Start/From: **9**
Clock To: **4**
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **YES**
Remarks: **INSIDE OF THE JOINT**

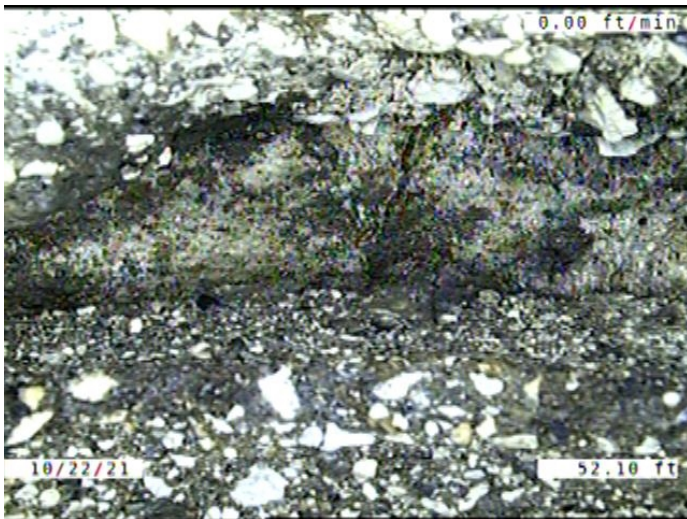


Code: **FM**
Description: **Fracture Multiple**

Distance (ft): **52.1**
Structural Grade: **4**
O&M Grade: **0**
Clock Start/From: **12**
Clock To: **3**
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **YES**
Remarks:

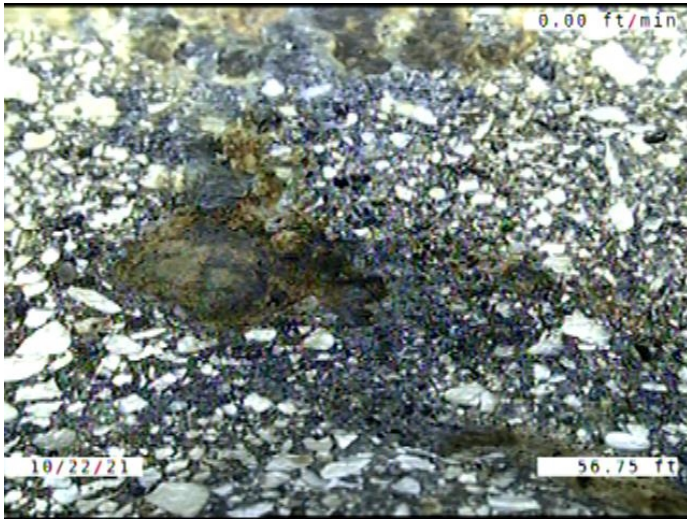


Code: **ISB**
 Description: **Infiltration Stain Barrel**

Distance (ft): **56.8**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **8**
 Clock To: **5**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

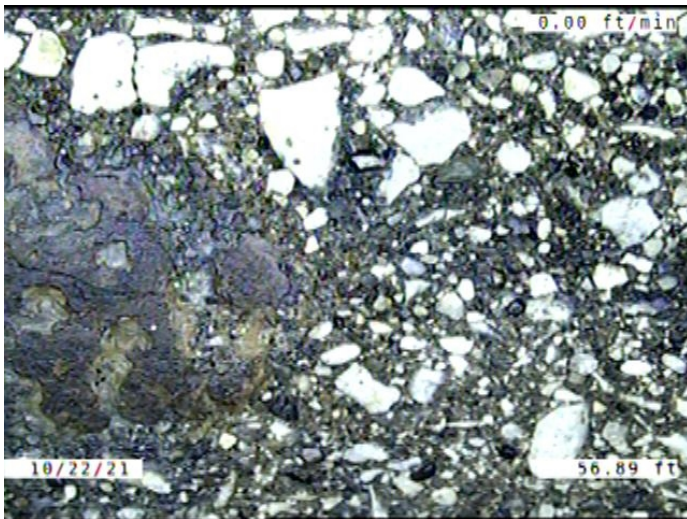


Code: **CM**
 Description: **Crack Multiple**

Distance (ft): **56.9**
 Structural Grade: **3**
 O&M Grade: **0**
 Clock Start/From: **7**
 Clock To: **5**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

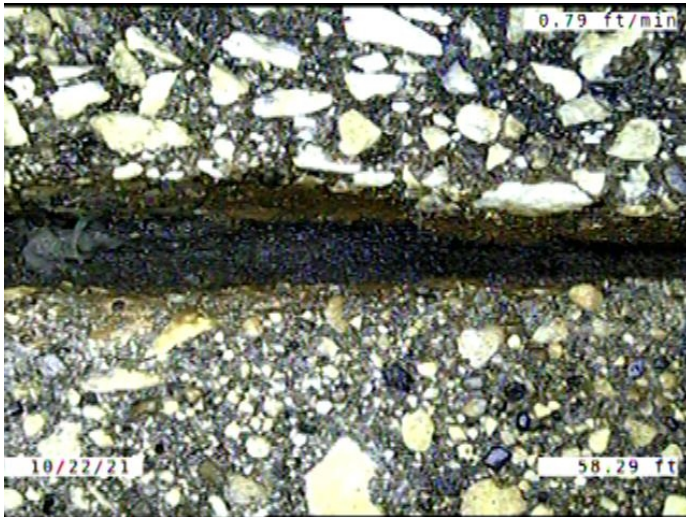


Code: **ISJ**
 Description: **Infiltration Stain Joint**

Distance (ft): **58.3**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **7**
 Clock To: **5**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

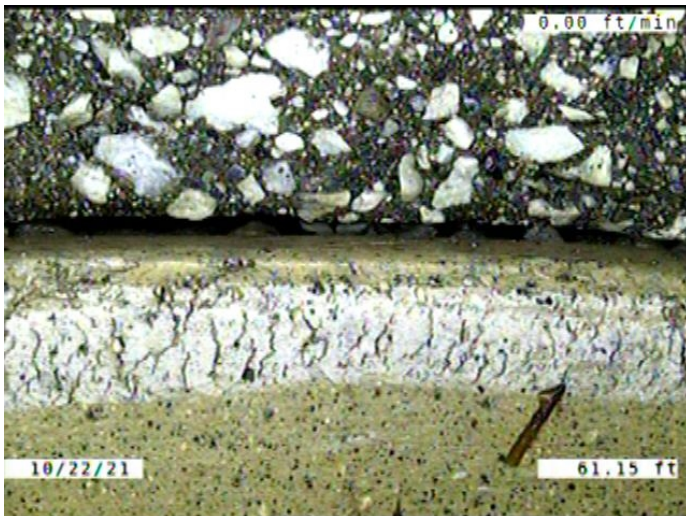


Code: **MMC**
 Description: **Miscellaneous Material Change**

Distance (ft): **61.1**
 Structural Grade: **0**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks: **CONCRETE TO VCP**

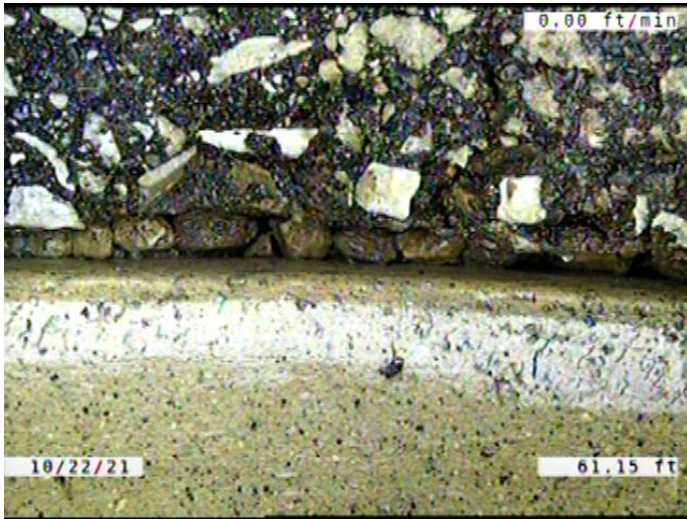


Code: **CM**
 Description: **Crack Multiple**

Distance (ft): **61.1**
 Structural Grade: **3**
 O&M Grade: **0**
 Clock Start/From: **12**
 Clock To: **12**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks:

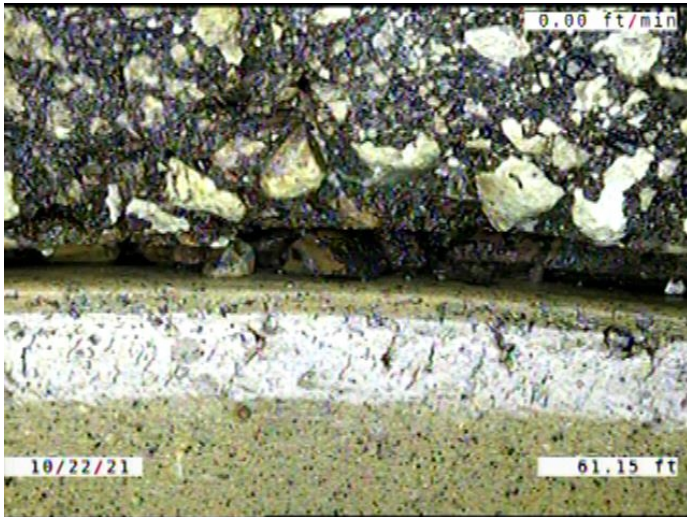


Code: **ISJ**
 Description: **Infiltration Stain Joint**

Distance (ft): **61.2**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **7**
 Clock To: **5**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

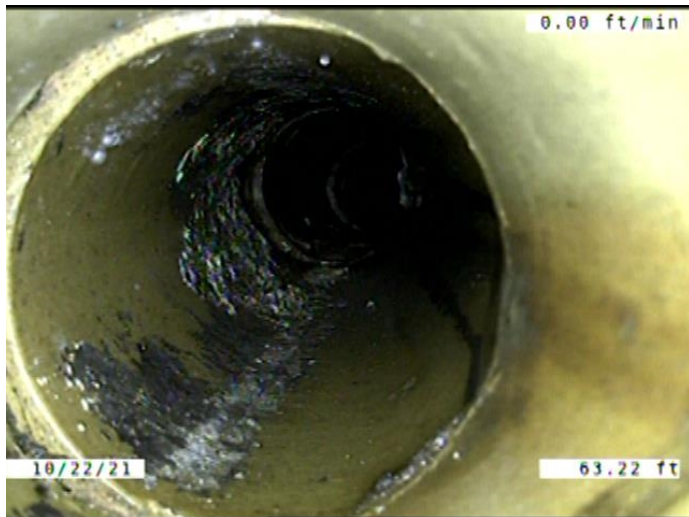


Code: **TF**
 Description: **Tap Factory**

Distance (ft): **63.2**
 Structural Grade: **0**
 O&M Grade: **0**
 Clock Start/From: **3**
 Clock To:
 1st Value: **4.000**
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

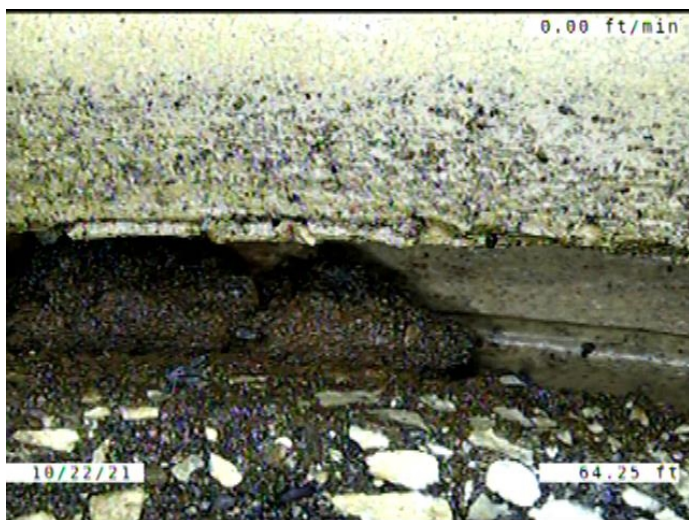


Code: **ISJ**
 Description: **Infiltration Stain Joint**

Distance (ft): **64.3**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **1**
 Clock To: **5**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

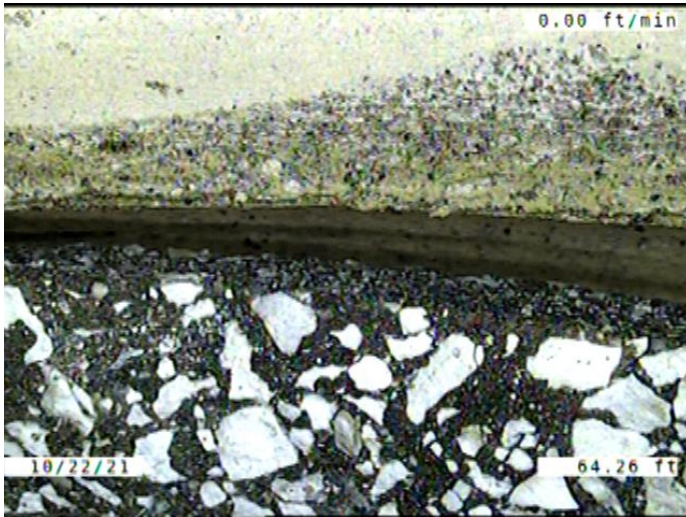


Code: **MMC**
Description: **Miscellaneous Material Change**

Distance (ft): **64.3**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks: **VCP TO CONCRETE**

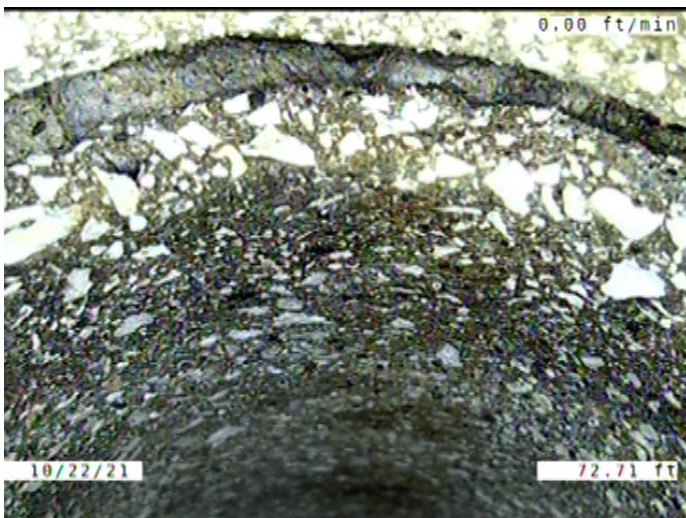


Code: **JOM**
Description: **Joint Offset Medium**

Distance (ft): **72.7**
Structural Grade: **3**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks:

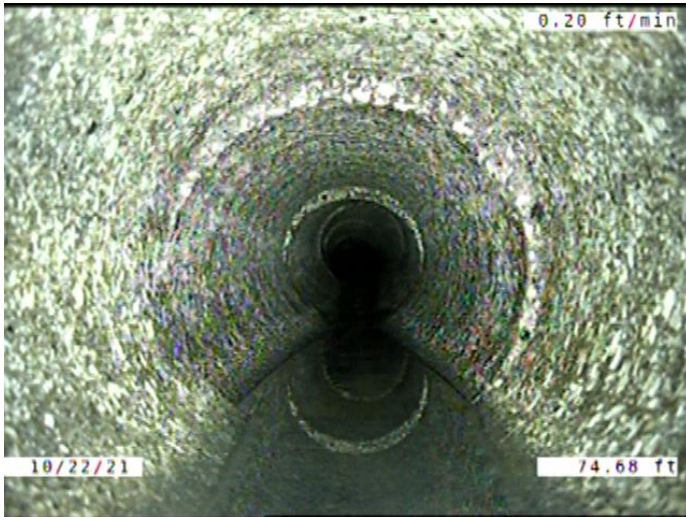

Code: **MWLS**
 Description: **Miscellaneous Water Level Sag**

Distance (ft): **74.7**
 Structural Grade: **2**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index: **S03**
 Within 8" of Joint: **NO**
 Remarks:

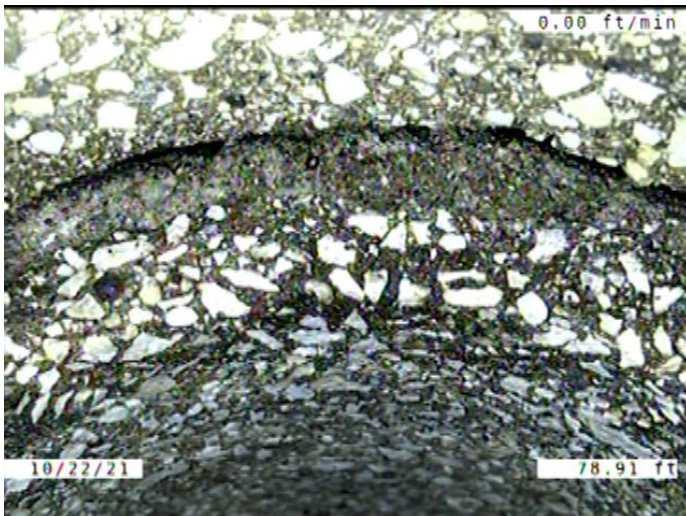


Code: **JOM**
 Description: **Joint Offset Medium**

Distance (ft): **78.9**
 Structural Grade: **3**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks:




Code: **MWLS**
 Description: **Miscellaneous Water Level Sag**

Distance (ft): **79.5**
 Structural Grade: **2**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index: **F03**
 Within 8" of Joint: **NO**
 Remarks:

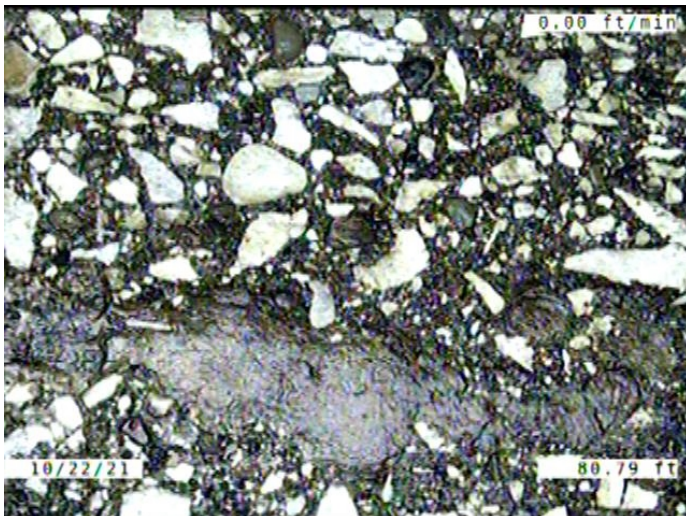


Code: **ISB**
 Description: **Infiltration Stain Barrel**

Distance (ft): **80.8**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **8**
 Clock To: **4**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks:

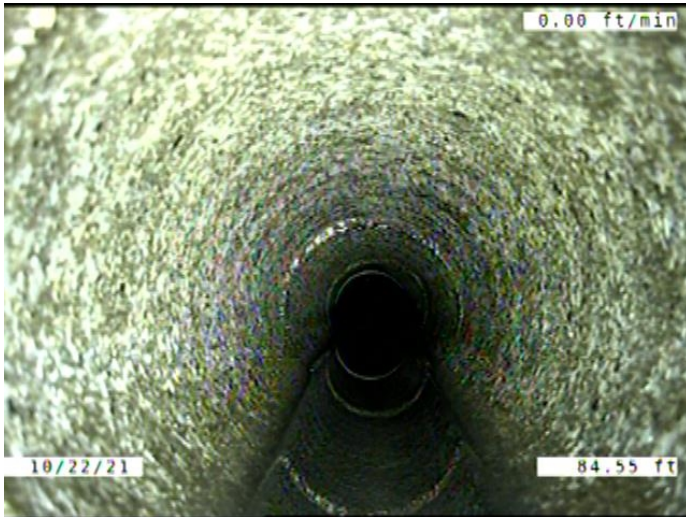


Code: **MWLS**
Description: **Miscellaneous Water Level Sag**

Distance (ft): **84.6**
Structural Grade: **2**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent: **10.000**
Continuous Index: **S04**
Within 8" of Joint: **NO**
Remarks:

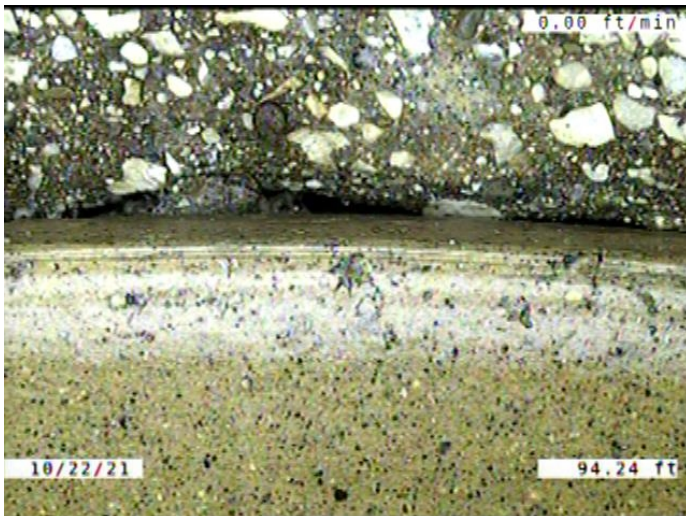


Code: **MMC**
Description: **Miscellaneous Material Change**

Distance (ft): **94.2**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks: **CONCRETE TO VCP**

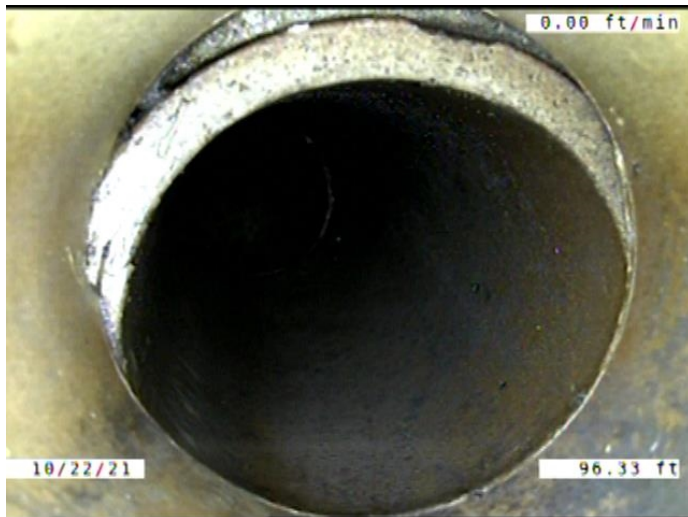

Code:	TFD
Description:	Tap Factory Defective
Distance (ft):	96.3
Structural Grade:	0
O&M Grade:	3
Clock Start/From:	11
Clock To:	
1st Value:	4.000
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	LARGE OFFSET AT THE FIRST JOINT BACK. CONSTANTLY RUNNING WAT

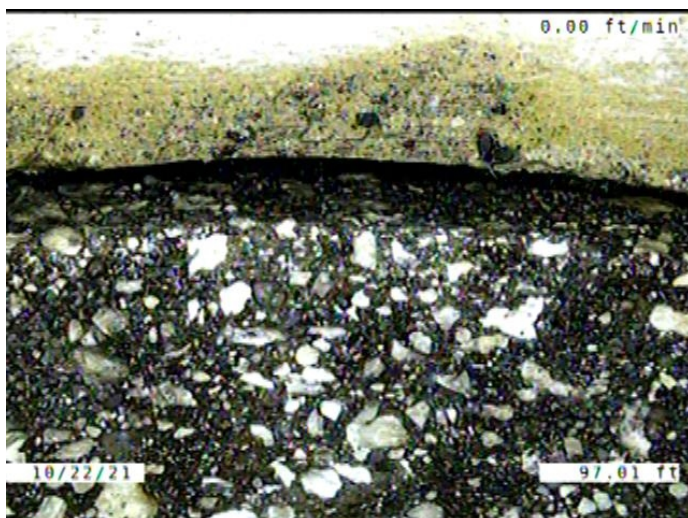


Code:	MMC
Description:	Miscellaneous Material Change
Distance (ft):	97.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	VCP TO CONCRETE




Code: **MWLS**
 Description: **Miscellaneous Water Level Sag**

Distance (ft): **97.7**
 Structural Grade: **2**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent: **10.000**
 Continuous Index: **F04**
 Within 8" of Joint: **NO**
 Remarks:

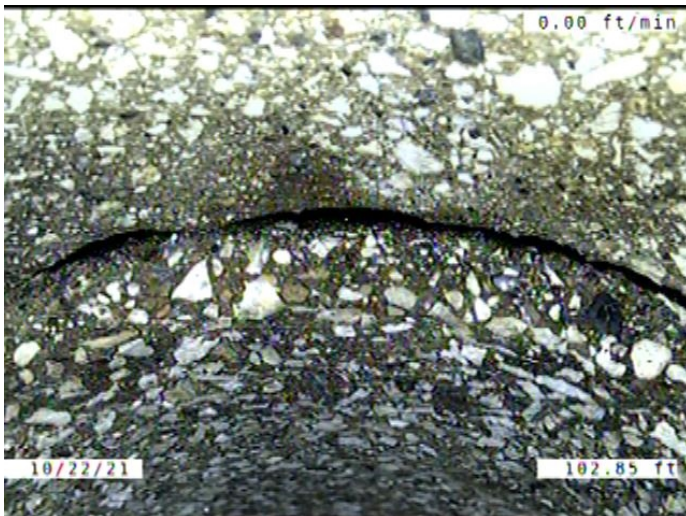

Code: **JOM**
 Description: **Joint Offset Medium**

Distance (ft): **102.8**
 Structural Grade: **3**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks:

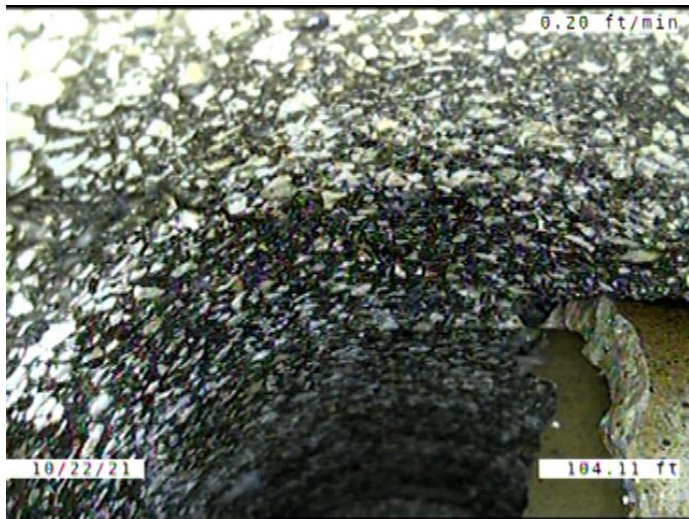


Code: **B**
 Description: **Broken**

Distance (ft): **104.1**
 Structural Grade: **4**
 O&M Grade: **0**
 Clock Start/From: **12**
 Clock To: **3**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:




Code: **TBI**
 Description: **Tap Break-in Intruding**

Distance (ft): **105.0**
 Structural Grade: **0**
 O&M Grade: **2**
 Clock Start/From: **1**
 Clock To:
 1st Value: **4.000**
 2nd Value: **2.000**
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

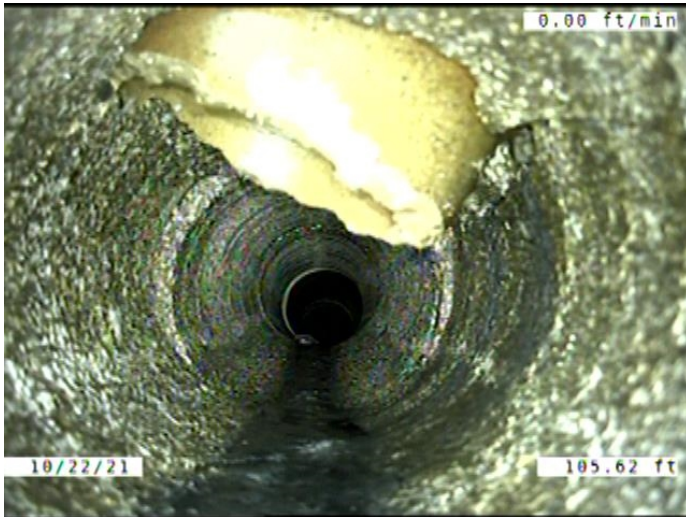

Code: **DSF**
 Description: **Deposits Settled Fine**

Distance (ft): **105.6**
 Structural Grade: **0**
 O&M Grade: **2**
 Clock Start/From: **5**
 Clock To: **7**
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index: **F01**
 Within 8" of Joint: **YES**
 Remarks:

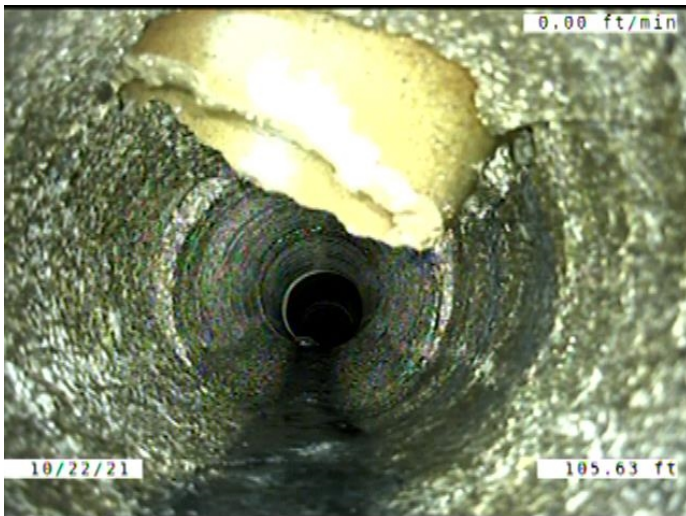

Code: **MSA**
 Description: **Miscellaneous Survey Abandoned**

Distance (ft): **105.6**
 Structural Grade: **0**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks: **MADE IT TO THE POINT OF OVERLAP.
 REVERSAL COMPLETE**