

Profile/Photo Observation Report




Date:	09/11/2021	Weather:		Coding:	PACP 7.0
Pipe Length (ft):	260.0	Owner:	City of Hobart	Pre Clean:	Heavy Cleaning
P.O.#:	YES502259	Surveyor:	S. Bucklin	PSR:	P-504-111-104
Customer:	City of Hobart	Clean Date:	09/11/2021	Shape:	C

Street:	North Colorado Street	Flow Control:	Not Controlled
City:	Hobart, IN	Year Renewed:	
Location:	Alley	Tape/Media #:	
Purpose:	Routine Assessment	Dia/Height:	12"
Use:	Sanitary Sewage Pipe	Material:	CP
Drain Area:		Lining:	None
Category:	NA		
Comment:			

Location Details:		Direction of Survey:	Downstream
US MH:	M-504-104	DS MH:	M-504-111
		Total Length Surveyed (ft):	65.9


O&M Index:	2.42	O&M Quick:	413A	O&M Rating:	46.00
Structural Index:	3.20	Structural Quick:	4322	Structural Rating:	16.00
Overall Index:	2.58	Overall Quick:	443A	Overall Rating:	62.00

	Position	Code	Observation	Video (sec)	Grade
					
	.0	AMH	Manhole	1	NA
	.0	MWL	Miscellaneous Water Level	62	NA
	1.5	CS	Crack Spiral	127	S 2
	1.6	ISB	Infiltration Stain Barrel	112	M 1
	1.6	CS	Crack Spiral	191	S 2
	1.6	DAE	Deposits Attached Encrustation	203	M 2
	18.4	RFJ	Roots Fine Joint	437	M 1
	21.3	RMJ	Roots Medium Joint	500	M 3
	24.5	RMJ	Roots Medium Joint	595	M 3
	27.4	RMJ	Roots Medium Joint	669	M 3
	33.5	RFJ	Roots Fine Joint	767	M 1
	36.5	RMJ	Roots Medium Joint	826	M 3
	39.7	MMC	Miscellaneous Material Change	909	NA
	40.7	TFD	Tap Factory Defective	949	M 3
	42.4	RMJ	Roots Medium Joint	1027	M 3
	43.6	TFD	Tap Factory Defective	1066	M 3
	45.5	MMC	Miscellaneous Material Change	1140	NA
	48.5	RMJ	Roots Medium Joint	1268	M 3
	49.1	FM(S01)	Fracture Multiple	1324	S 4
	51.4	RFJ	Roots Fine Joint	1391	M 1
	51.4	DSF	Deposits Settled Fine	1406	M 2
	54.6	RMJ	Roots Medium Joint	1480	M 3
	57.4	RMJ	Roots Medium Joint	1530	M 3
	60.4	RFJ	Roots Fine Joint	1631	M 1
	63.3	RMJ	Roots Medium Joint	1702	M 3
	64.9	RBJ	Roots Ball Joint	1804	M 4
	65.9	FM(F01)	Fracture Multiple	1820	S 4
	65.9	MSA	Miscellaneous Survey Abandoned	1829	NA




Code: **AMH**
 Description: **Manhole**

Distance (ft): **.0**
 Structural Grade: **0**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks: **M-504-104**

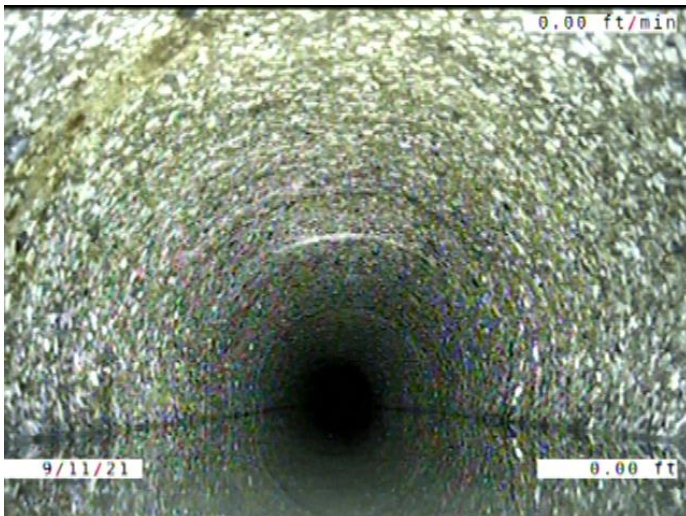


Code: **MWL**
 Description: **Miscellaneous Water Level**

Distance (ft): **.0**
 Structural Grade: **0**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent: **15.000**
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks:

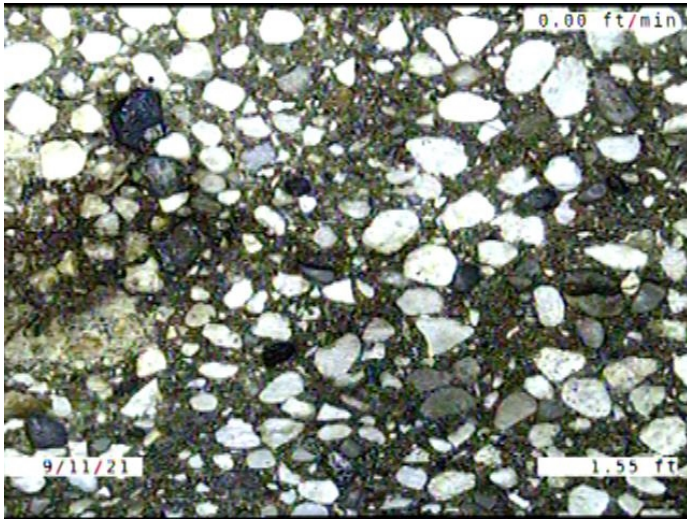


Code: **CS**
Description: **Crack Spiral**

Distance (ft): **1.5**
Structural Grade: **2**
O&M Grade: **0**
Clock Start/From: **10**
Clock To: **1**
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks:

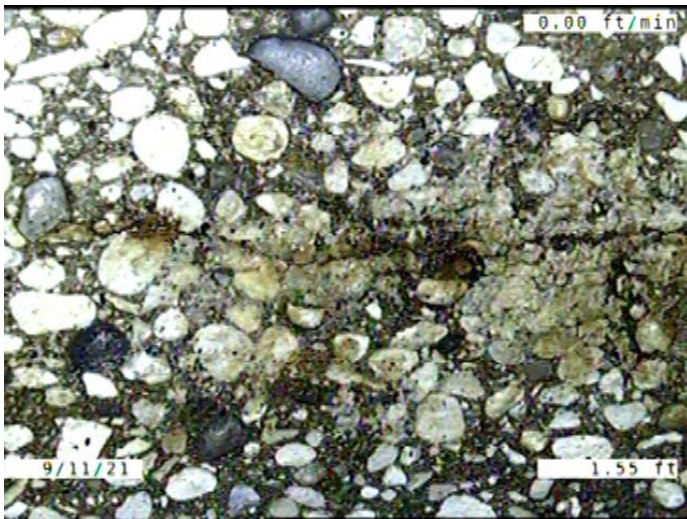


Code: **ISB**
Description: **Infiltration Stain Barrel**

Distance (ft): **1.6**
Structural Grade: **0**
O&M Grade: **1**
Clock Start/From: **10**
Clock To: **1**
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks:

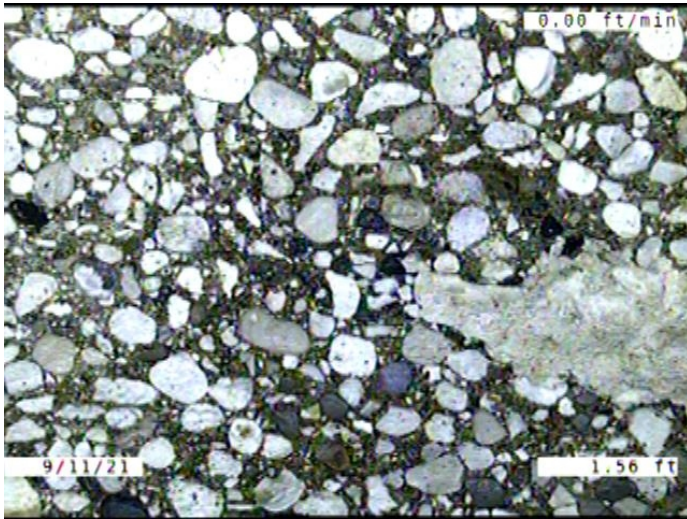


Code: **CS**
 Description: **Crack Spiral**

Distance (ft): **1.6**
 Structural Grade: **2**
 O&M Grade: **0**
 Clock Start/From: **10**
 Clock To: **1**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks:

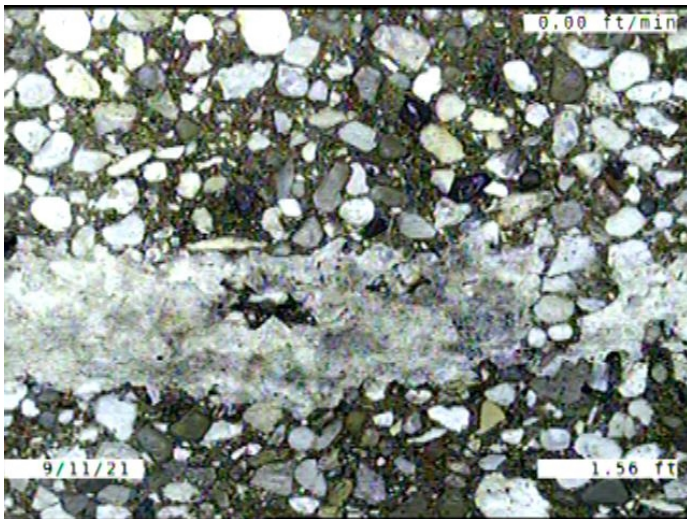


Code: **DAE**
 Description: **Deposits Attached Encrustation**

Distance (ft): **1.6**
 Structural Grade: **0**
 O&M Grade: **2**
 Clock Start/From: **11**
 Clock To: **1**
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

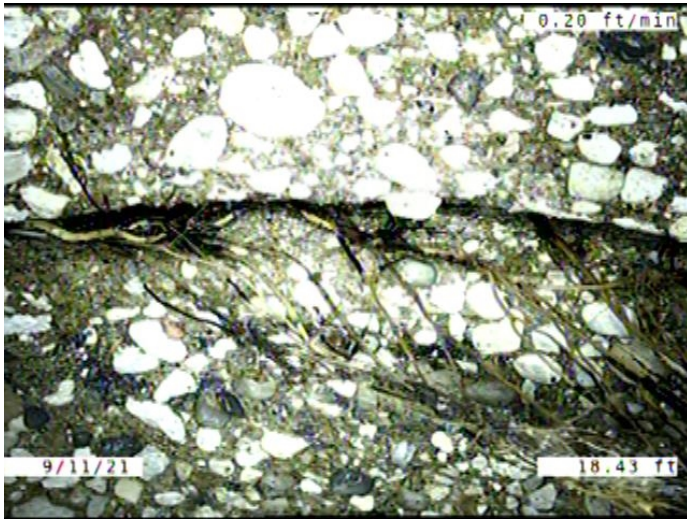


Code: **RFJ**
 Description: **Roots Fine Joint**

Distance (ft): **18.4**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **1**
 Clock To: **3**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

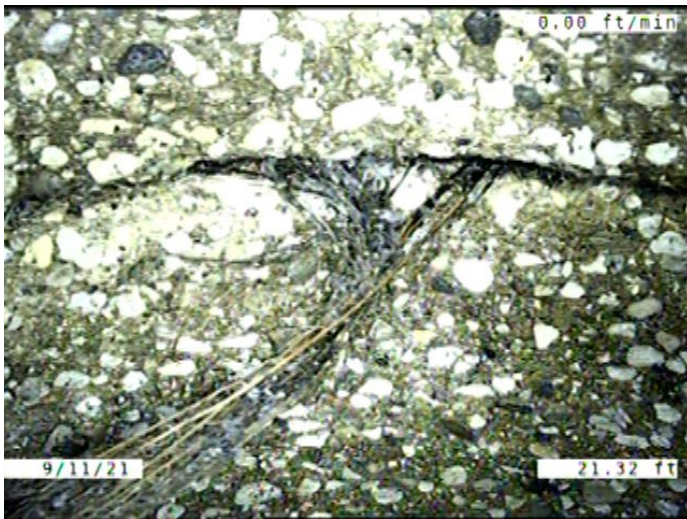


Code: **RMJ**
 Description: **Roots Medium Joint**

Distance (ft): **21.3**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **10**
 Clock To: **12**
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

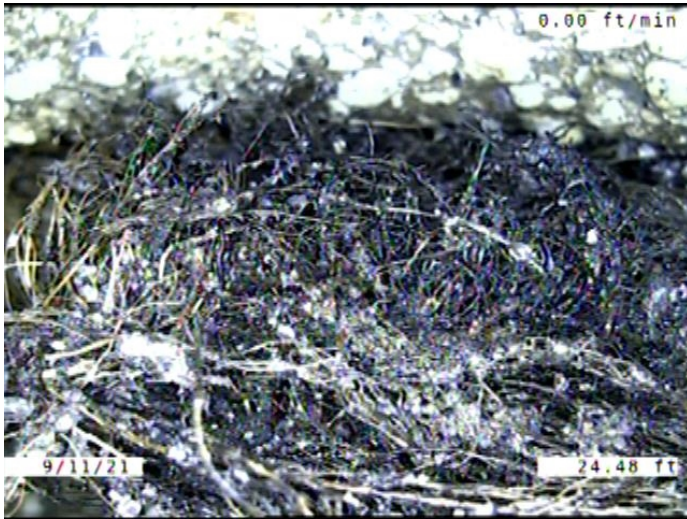


Code: **RMJ**
 Description: **Roots Medium Joint**

Distance (ft): **24.5**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **9**
 Clock To: **2**
 1st Value:
 2nd Value:
 Value Percent: **10.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

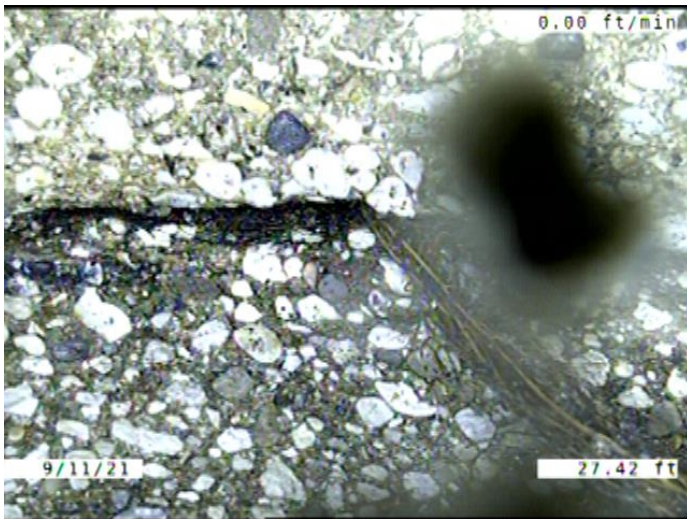


Code: **RMJ**
 Description: **Roots Medium Joint**

Distance (ft): **27.4**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **1**
 Clock To: **2**
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

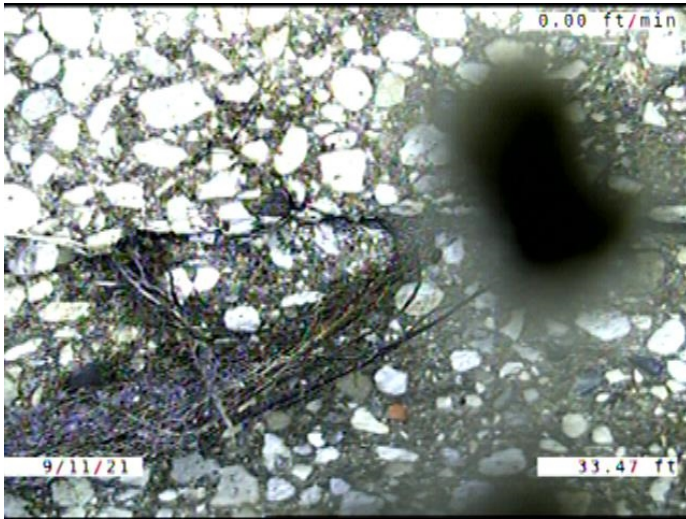


Code: **RFJ**
 Description: **Roots Fine Joint**

Distance (ft): **33.5**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **9**
 Clock To: **11**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

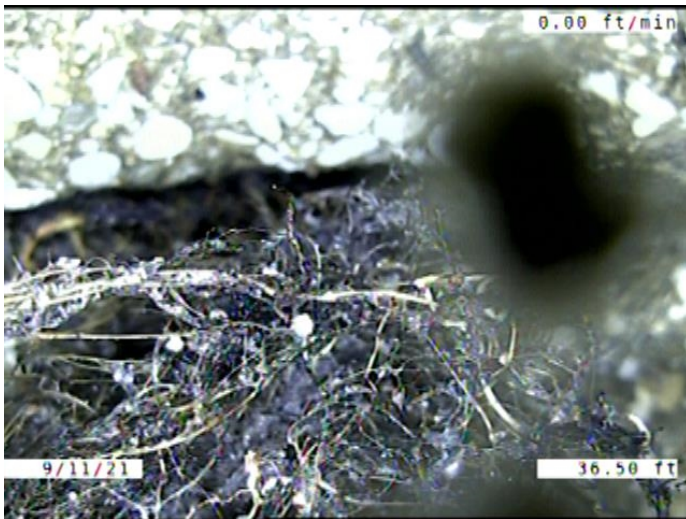


Code: **RMJ**
 Description: **Roots Medium Joint**

Distance (ft): **36.5**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **10**
 Clock To: **11**
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

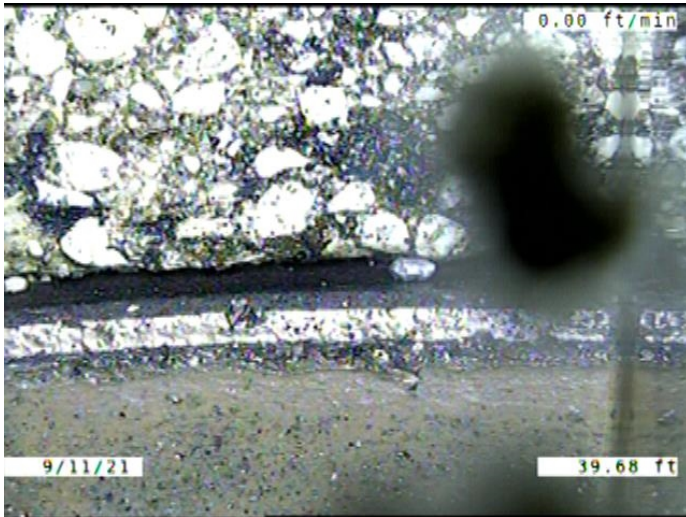


Code: **MMC**
 Description: **Miscellaneous Material Change**

Distance (ft): **39.7**
 Structural Grade: **0**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks: **CONCRETE TO VCP**

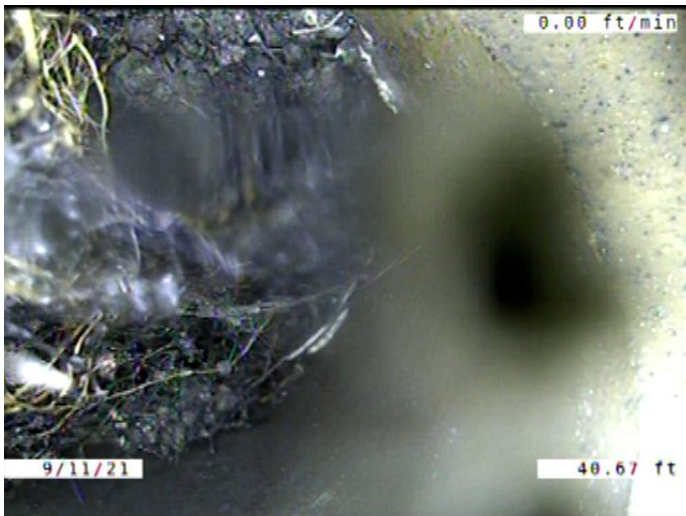

Code: **TFD**
 Description: **Tap Factory Defective**

Distance (ft): **40.7**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **11**
 Clock To:
 1st Value: **4.000**
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks: **Defective**

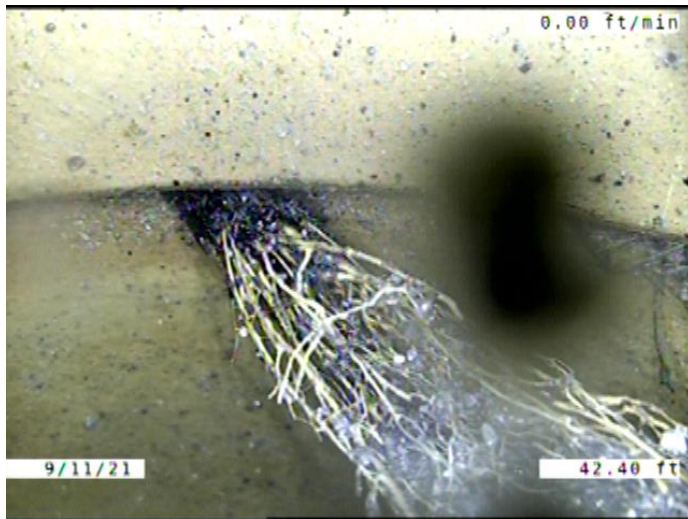


Code: **RMJ**
 Description: **Roots Medium Joint**

Distance (ft): **42.4**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **9**
 Clock To: **3**
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:




Code: **TFD**
 Description: **Tap Factory Defective**

Distance (ft): **43.6**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **1**
 Clock To:
 1st Value: **4.000**
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks: **Defective**

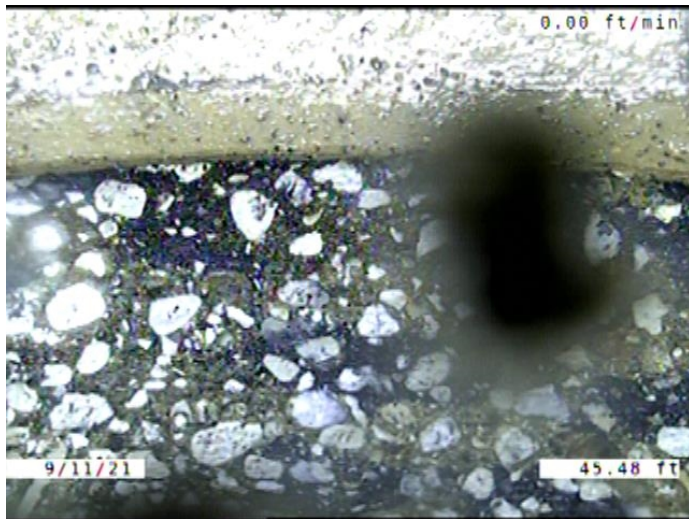


Code: **MMC**
 Description: **Miscellaneous Material Change**

Distance (ft): **45.5**
 Structural Grade: **0**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks: **VCP TO CONCRETE**

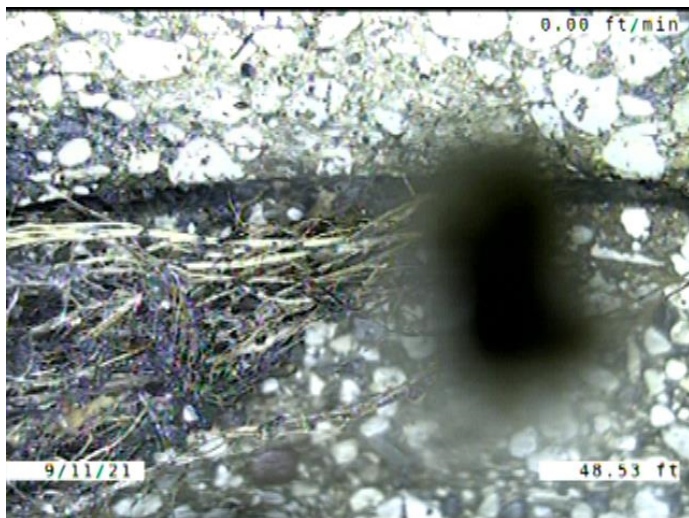


Code: **RMJ**
 Description: **Roots Medium Joint**

Distance (ft): **48.5**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **10**
 Clock To: **11**
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

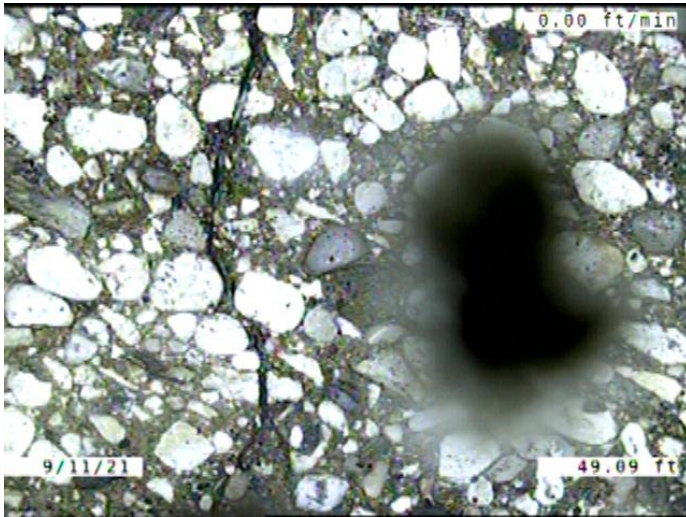


Code: **FM**
 Description: **Fracture Multiple**

Distance (ft): **49.1**
 Structural Grade: **4**
 O&M Grade: **0**
 Clock Start/From: **11**
 Clock To: **1**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index: **S01**
 Within 8" of Joint: **YES**
 Remarks:

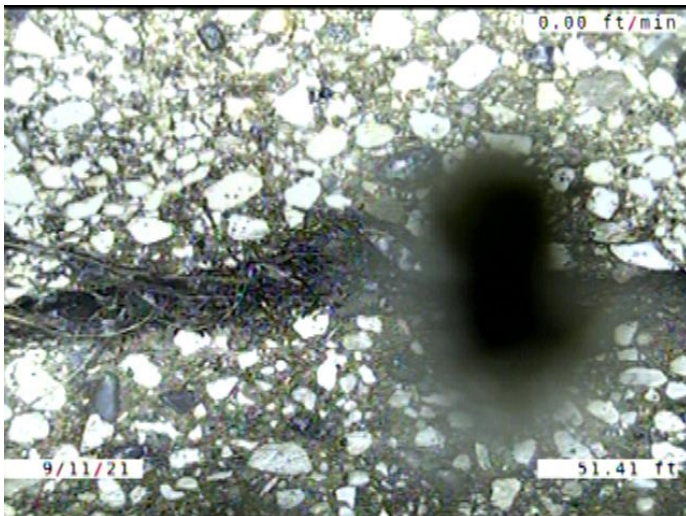


Code: **RFJ**
 Description: **Roots Fine Joint**

Distance (ft): **51.4**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **9**
 Clock To: **3**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

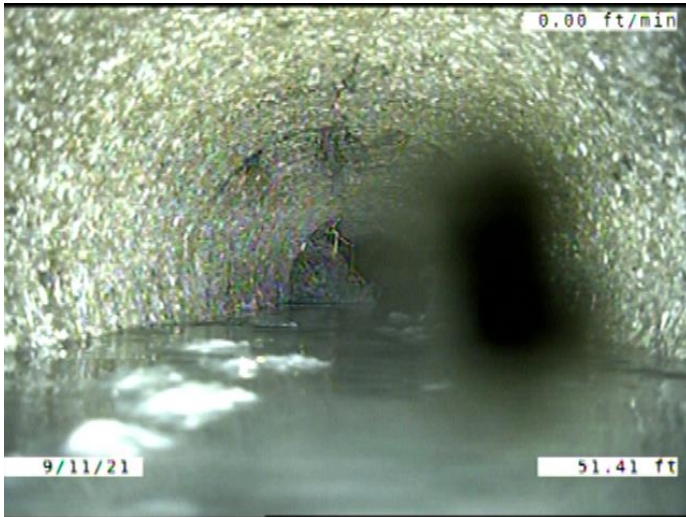


Code: **DSF**
 Description: **Deposits Settled Fine**

Distance (ft): **51.4**
 Structural Grade: **0**
 O&M Grade: **2**
 Clock Start/From: **4**
 Clock To: **8**
 1st Value:
 2nd Value:
 Value Percent: **5.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

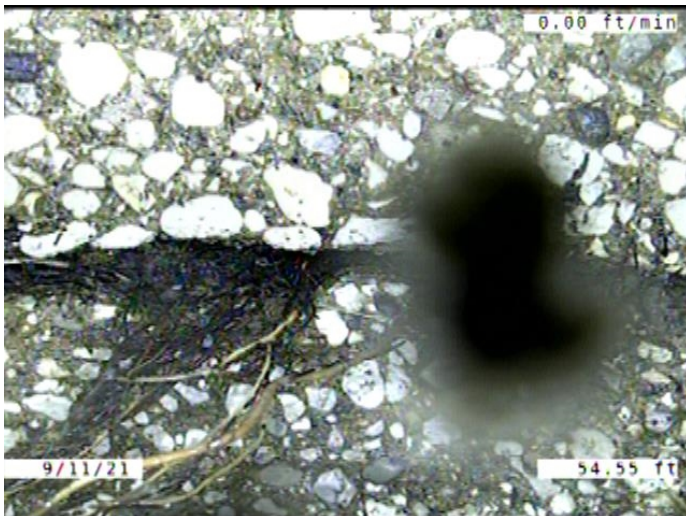


Code: **RMJ**
 Description: **Roots Medium Joint**

Distance (ft): **54.6**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **9**
 Clock To: **3**
 1st Value:
 2nd Value:
 Value Percent: **10.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

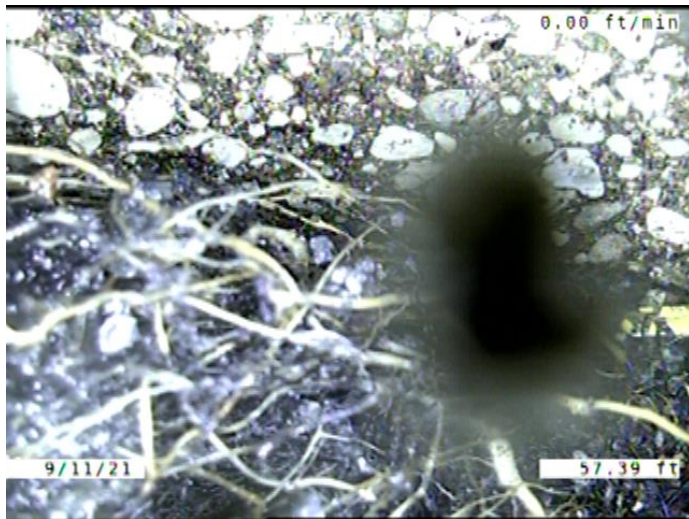


Code: **RMJ**
 Description: **Roots Medium Joint**

Distance (ft): **57.4**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **9**
 Clock To: **3**
 1st Value:
 2nd Value:
 Value Percent: **20.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

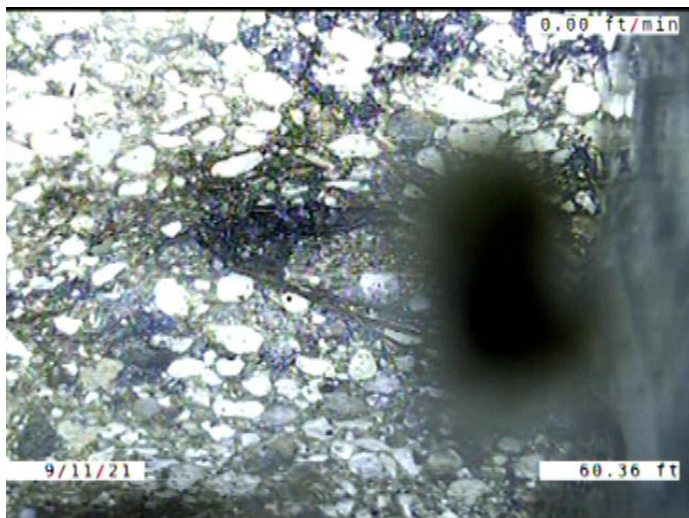


Code: **RFJ**
 Description: **Roots Fine Joint**

Distance (ft): **60.4**
 Structural Grade: **0**
 O&M Grade: **1**
 Clock Start/From: **9**
 Clock To: **3**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

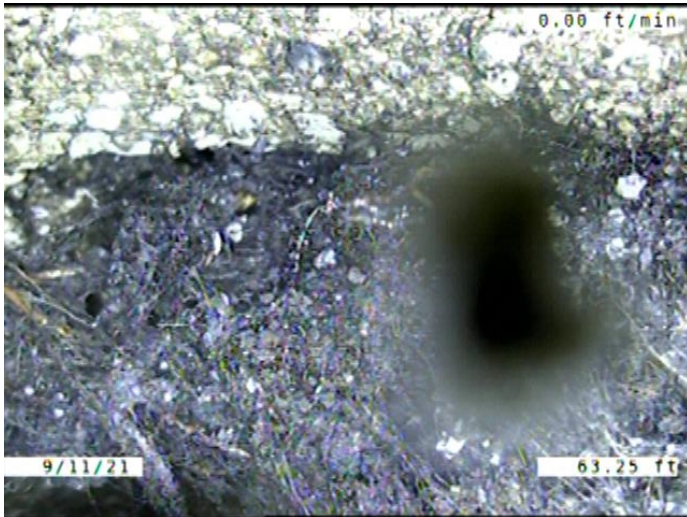

Code: **RMJ**
 Description: **Roots Medium Joint**

Distance (ft): **63.3**
 Structural Grade: **0**
 O&M Grade: **3**
 Clock Start/From: **9**
 Clock To: **3**
 1st Value:
 2nd Value:
 Value Percent: **20.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:

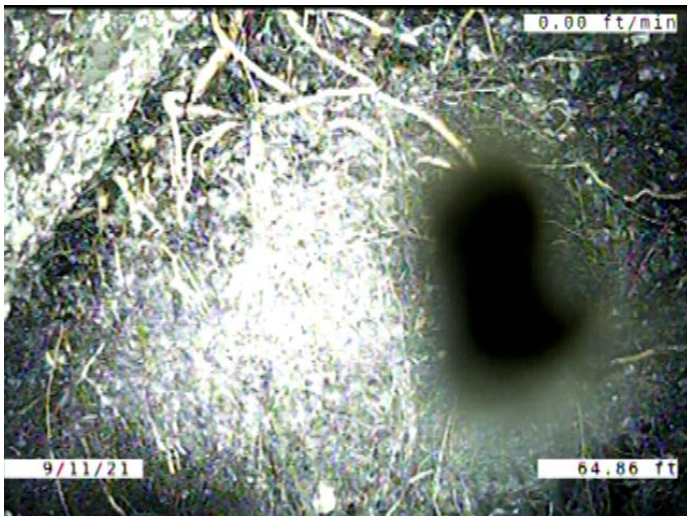

Code: **RBJ**
 Description: **Roots Ball Joint**

Distance (ft): **64.9**
 Structural Grade: **0**
 O&M Grade: **4**
 Clock Start/From: **8**
 Clock To: **4**
 1st Value:
 2nd Value:
 Value Percent: **65.000**
 Continuous Index:
 Within 8" of Joint: **YES**
 Remarks:



Code: **FM**
 Description: **Fracture Multiple**

Distance (ft): **65.9**
 Structural Grade: **4**
 O&M Grade: **0**
 Clock Start/From: **11**
 Clock To: **1**
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index: **F01**
 Within 8" of Joint: **YES**
 Remarks:



Code: **MSA**
 Description: **Miscellaneous Survey Abandoned**

Distance (ft): **65.9**
 Structural Grade: **0**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks: **CAMERA CANT MAKE IT PAST ROOTS.**