

Profile/Photo Observation Report




Date:	04/17/2018	Weather:		Coding:	PACP 6.0
Pipe Length (ft):	202.7	Owner:	NA	Pre Clean:	Not Known
P.O.#:		Surveyor:	Jen Costello	PSR:	P-504-119-118
Customer:		Clean Date:	01/01/1900	Shape:	C

Street:	Summerlin	Flow Control:	Not Controlled		
City:	Hobart, IN	Year Renewed:			
Location:	Light Highway	Tape/Media #:			
Purpose:	Not Known	Dia/Height:	12"		
Use:	Sanitary	Material:	VCP		
Drain Area:	NA	Lining:			
Category:	NA				
Comment:					
Location Details:		Direction of Survey:	Downstream		
US MH:	M-504-118	DS MH:	M-504-119	Total Length Surveyed (ft):	15.1

O&M Index:	<u>1.67</u>	O&M Quick:	<u>2211</u>	O&M Rating:	<u>5.00</u>
Structural Index:	<u>0.00</u>	Structural Quick:	<u>0000</u>	Structural Rating:	<u>0.00</u>
Overall Index:	<u>1.67</u>	Overall Quick:	<u>2211</u>	Overall Rating:	<u>5.00</u>

Position	Code	Observation	Video (sec)	Grade
M-504-118				
.0	AMH	Manhole	10	NA
.0	MWL	Water Level	21	NA
2.5	TBI	Tap Break-in Intruding	37	M 2
4.6	TFC	Tap Factory Capped	52	NA
6.6	TFC	Tap Factory Capped	67	NA
12.7	TBI	Tap Break-in Intruding	91	M 2
12.7	RFL	Roots Fine Lateral	102	M 1
15.1	MSA	Abandoned Survey	118	NA

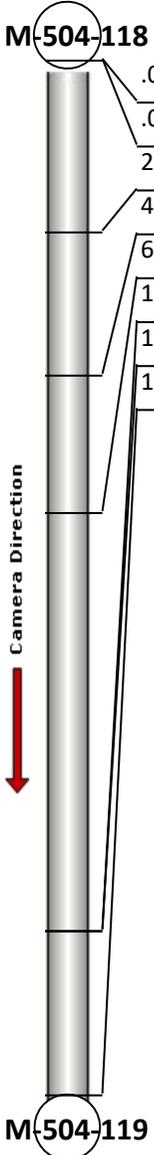

Code: **AMH**
 Description: **Manhole**
 Distance (ft): **.0**
 Structural Grade: **0**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks: **M-504-118**



Code: **MWL**
Description: **Water Level**



Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent: **10.000**
Continuous Index:
Within 8" of Joint: **NO**
Remarks:

Code: **TBI**
Description: **Tap Break-in Intruding**



Distance (ft): **2.5**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **1**
Clock To:
1st Value: **4.000**
2nd Value: **1.000**
Value Percent:
Continuous Index:
Within 8" of Joint:
Remarks:

Code: **TFC**
Description: **Tap Factory Capped**



Distance (ft): **4.6**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From: **11**
Clock To:
1st Value: **4.000**
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint:
Remarks:

Code: **TFC**
Description: **Tap Factory Capped**




Distance (ft): **6.6**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From: **12**
Clock To:
1st Value: **4.000**
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint:
Remarks:

Code: **TBI**
Description: **Tap Break-in Intruding**



Distance (ft): **12.7**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **10**
Clock To:
1st Value: **4.000**
2nd Value: **1.000**
Value Percent:
Continuous Index:
Within 8" of Joint:
Remarks: **rfl**

Code: **RFL**
Description: **Roots Fine Lateral**

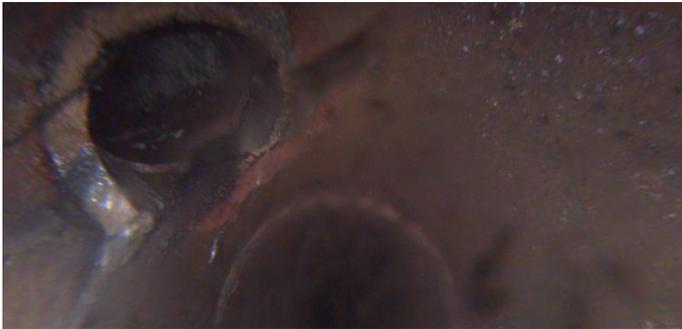

Distance (ft): **12.7**
Structural Grade: **0**
O&M Grade: **1**
Clock Start/From: **9**
Clock To: **10**
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks:



Code: **MSA**
Description: **Abandoned Survey**

Distance (ft): **15.1**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks: **unknown**