

Profile/Photo Observation Report



Date:	04/16/2018	Weather:		Coding:	PACP 6.0
Pipe Length (ft):		Owner:	City of Hobart	Pre Clean:	No Pre-Cleaning
P.O.#:	56-2	Surveyor:	M. Pielacha	PSR:	M-505-034-M-605-050
Customer:	City of Hobart	Clean Date:		Shape:	C

Street:	Colorado Street	Flow Control:	Not Controlled
City:	Hobart, IN	Year Renewed:	
Location:	Light Highway	Tape/Media #:	DEP 56
Purpose:	Routine Assessment	Dia/Height:	18"
Use:	Sanitary	Material:	VCP
Drain Area:		Lining:	


Category: **NA**

Comment:

Location Details: Direction of Survey: **Downstream**

US MH: **M-505-034** DS MH: **M-605-050** Total Length Surveyed (ft): **156.6**

O&M Index:	1.00	O&M Quick:	1500	O&M Rating:	5.00
Structural Index:	2.50	Structural Quick:	4131	Structural Rating:	15.00
Overall Index:	1.82	Overall Quick:	4131	Overall Rating:	20.00

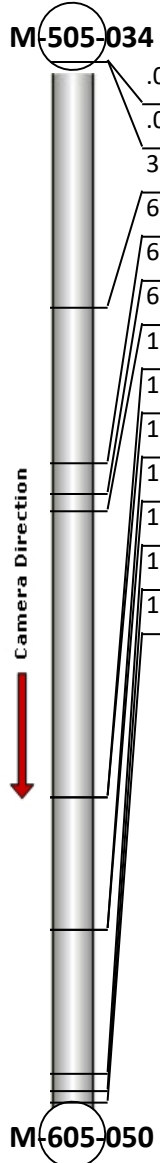Position	Code	Observation	Video (sec)	Grade
				
.0	AMH	Manhole	0	NA
.0	MWL	Water Level	6	NA
37.1	RFJ(S01)	Roots Fine Joint	72	M 1
60.3	RFJ(F01)	Roots Fine Joint	110	M 1
65.1	TF	Tap Factory	127	NA
67.6	TFC	Tap Factory Capped	144	NA
110.7	CM	Crack Multiple	212	S 3
110.7	CL	Crack Longitudinal	226	S 2
130.6	CL	Crack Longitudinal	265	S 2
130.6	CL	Crack Longitudinal	276	S 2
152.3	FM	Fracture Multiple	326	S 4
154.8	FC	Fracture Circumferential	344	S 2
156.6	AMH	Manhole	368	NA




Code: **AMH**
 Description: **Manhole**

 Distance (ft): **.0**
 Structural Grade: **0**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks: **M-505-034**



Code: **MWL**
Description: **Water Level**

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent: **20.000**
Continuous Index:
Within 8" of Joint: **NO**
Remarks:

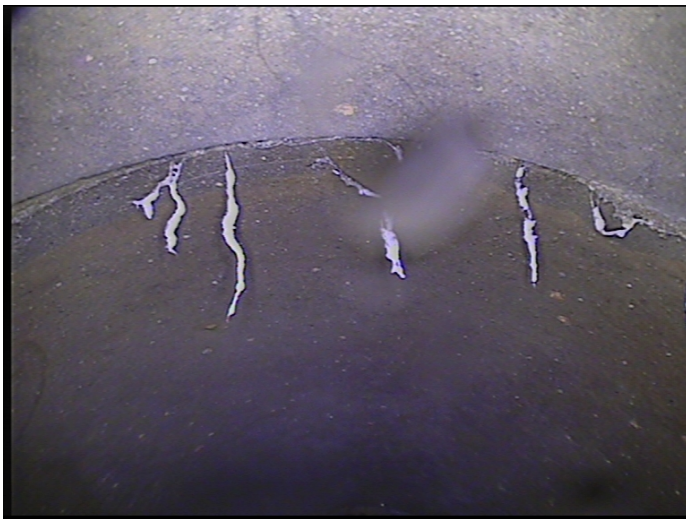


Code: **RFJ**
Description: **Roots Fine Joint**

Distance (ft): **37.1**
Structural Grade: **0**
O&M Grade: **1**
Clock Start/From: **11**
Clock To: **1**
1st Value:
2nd Value:
Value Percent:
Continuous Index: **S01**
Within 8" of Joint: **YES**
Remarks:




Code: **RFJ**
Description: **Roots Fine Joint**

Distance (ft): **60.3**
Structural Grade: **0**
O&M Grade: **1**
Clock Start/From: **11**
Clock To: **1**
1st Value:
2nd Value:
Value Percent:
Continuous Index: **F01**
Within 8" of Joint: **YES**
Remarks:

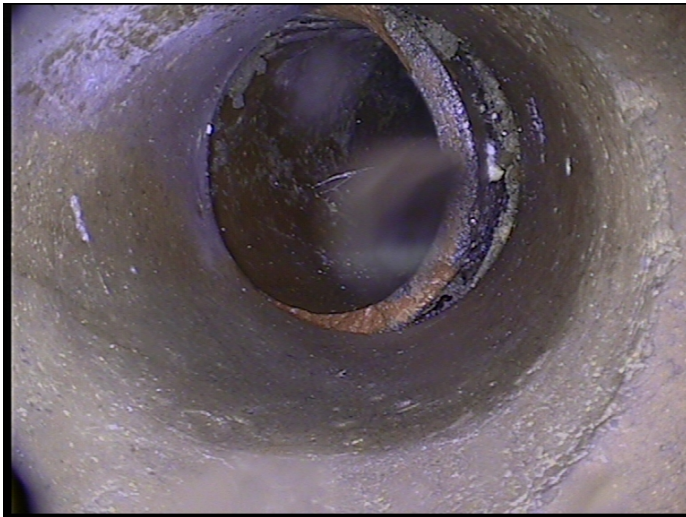


Code: **TF**
Description: **Tap Factory**

Distance (ft): **65.1**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From: **10**
Clock To:
1st Value: **4.000**
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks:

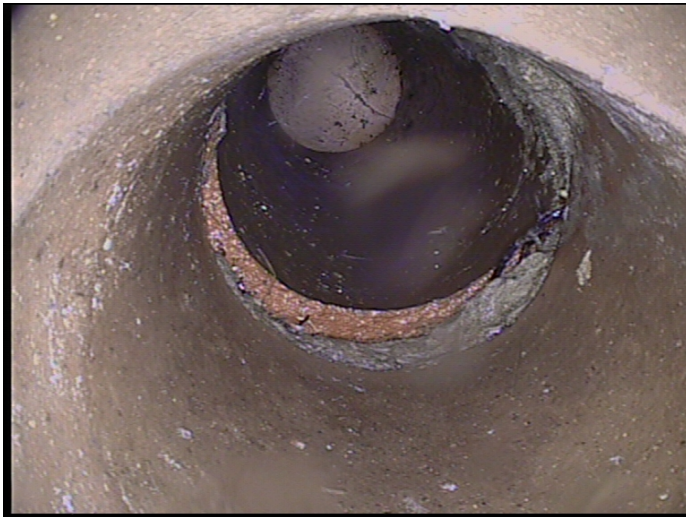


Code: **TFC**
Description: **Tap Factory Capped**

Distance (ft): **67.6**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From: **2**
Clock To:
1st Value: **4.000**
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks:

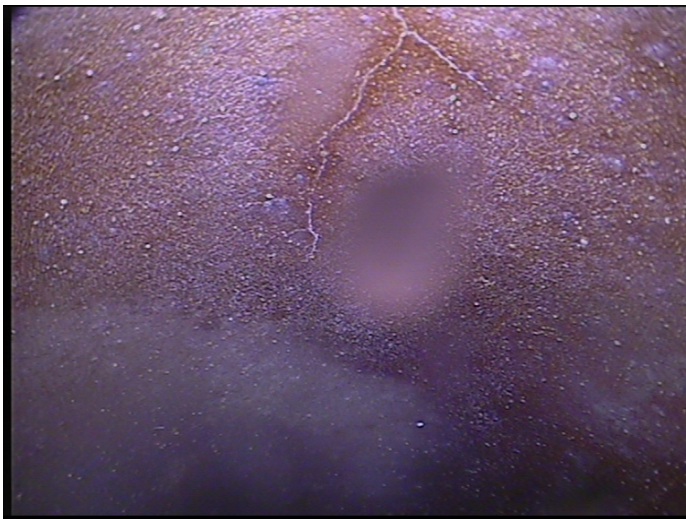


Code: **CM**
Description: **Crack Multiple**

Distance (ft): **110.7**
Structural Grade: **3**
O&M Grade: **0**
Clock Start/From: **1**
Clock To: **2**
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **YES**
Remarks:

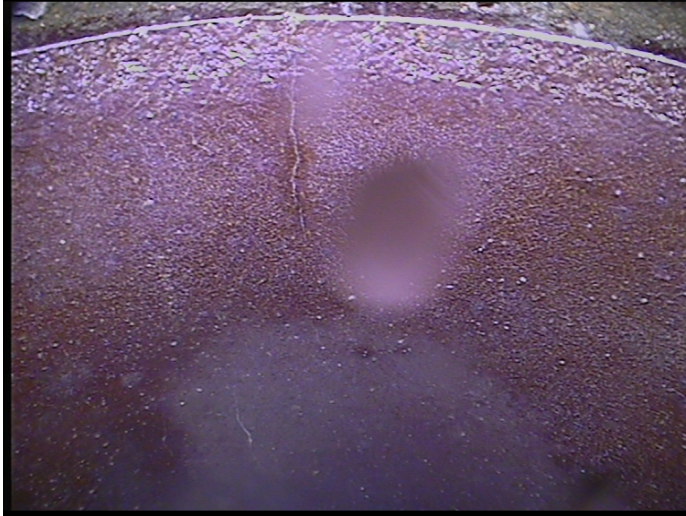

Code: **CL**
Description: **Crack Longitudinal**

Distance (ft): **110.7**
Structural Grade: **2**
O&M Grade: **0**
Clock Start/From: **11**
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **YES**
Remarks:

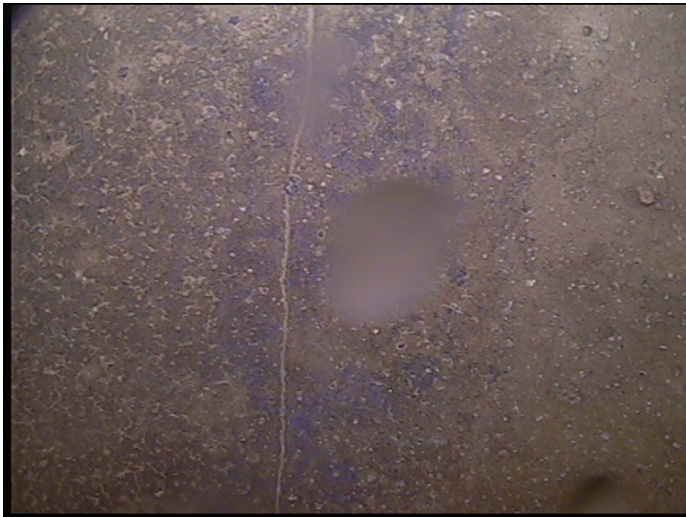


Code: **CL**
Description: **Crack Longitudinal**

Distance (ft): **130.6**
Structural Grade: **2**
O&M Grade: **0**
Clock Start/From: **2**
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **YES**
Remarks:



Code:	CL
Description:	Crack Longitudinal
Distance (ft):	130.6
Structural Grade:	2
O&M Grade:	0
Clock Start/From:	11
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	

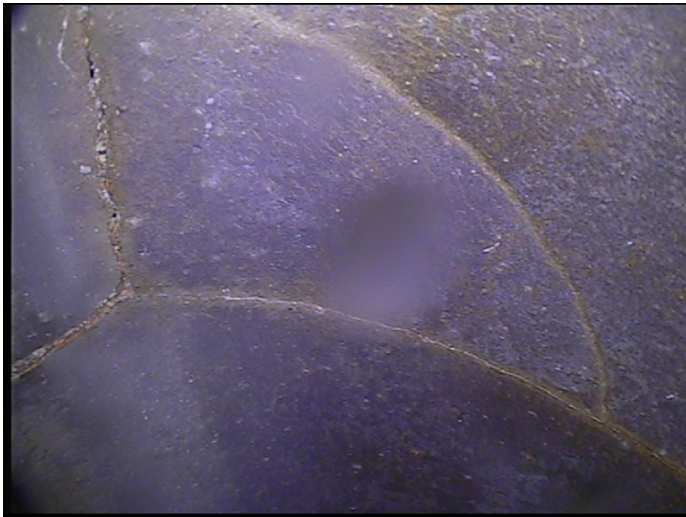

Code:	FM
Description:	Fracture Multiple
Distance (ft):	152.3
Structural Grade:	4
O&M Grade:	0
Clock Start/From:	9
Clock To:	3
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	



Code:	FC
Description:	Fracture Circumferential
Distance (ft):	154.8
Structural Grade:	2
O&M Grade:	0
Clock Start/From:	7
Clock To:	10
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	



Code:	AMH
Description:	Manhole
Distance (ft):	156.6
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-605-050