

Profile/Ph	oto Observation	Report				RedZone
Date: Pipe Length (ft) P.O.#: Customer:	03/26/2018 1: 56.8	Weather: Owner: Surveyor: Clean Date:	NA Byrd Fitzger 01/01/1900		Coding: Pre Clean: PSR: Shape:	PACP 6.0 No Pre-Cleaning P-507-081-050 C
Street:	FOXCROFT STREET		Flow Control:		Not Controlled	
City:	Hobart, IN		Year Renewe	d:		
Location:	Light Highway		Tape/Media	# :		
Purpose:	Routine Assessment	t	Dia/Height:		8"	
Use:	Sanitary		Material:		PVC	
Drain Area:	NA		Lining:			
Category:	NA					
Comment:						
Location Detail	s:		Direction of S	urvey:	Downstream	
US MH:	M-507-081	DS MH:	M-507-050		Total Length Surveyed (ft)	56.9
0&M Index:	2.00	O&M Quick:	:	2300	O&M Rating:	6.00
tructural Index:	0.00		ıick:	0000	Structural Rating:	0.00
Overall Index:	2.00	Overall Quick	<: 2	2300	Overall Rating:	6.00



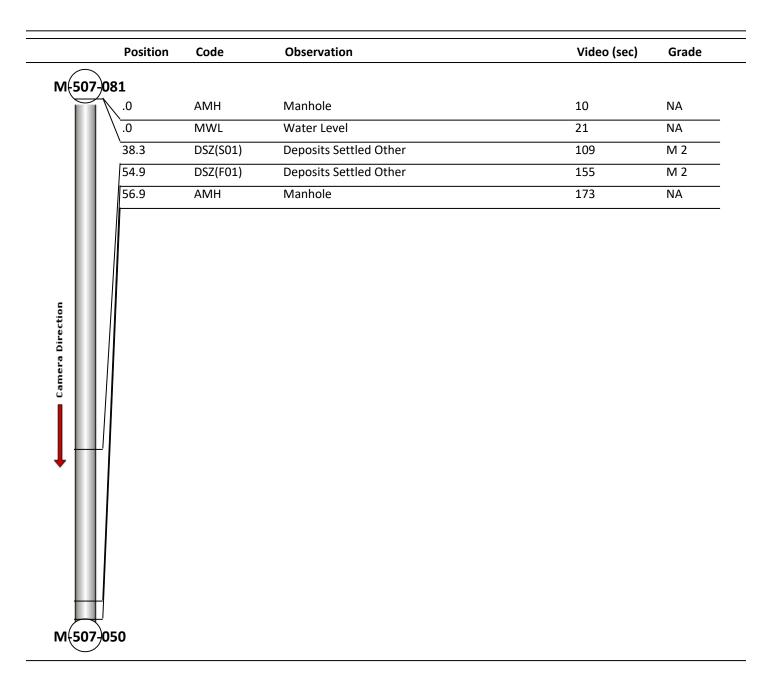

Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-507-081

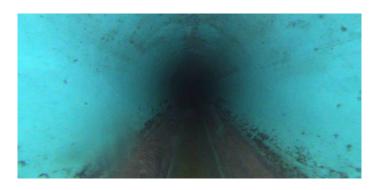

Code: MWL Description: Water Level

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	



Code:	DSZ
Description:	Deposits Settled Other

Distance (ft):	38.3
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	6
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	S01
Within 8" of Joint:	NO
Remarks:	debris/tissue



Code:DSZDescription:Deposits Settled Other

Distance (ft):	54.9
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	6
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	F01
Within 8" of Joint:	NO
Remarks:	debris/tissue

AMH

Manhole



Distance (ft):	56.9
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-507-050

Code:

Description: