

Date:	04/11/2018	Weather:			Coding:	PACP 6.0
Pipe Length (ft)	: <b>97.6</b>	Owner:	NA		Pre Clean:	Not Known
P.O.#:		Surveyor:	Jen Costello		PSR:	P-603-026-003
Customer:		Clean Date:	01/01/1900		Shape:	С
Street:	W 40th ave		Flow Control:		Not Controlled	
City:	Hobart, IN		Year Renewed	:		
Location:	Other		Tape/Media #			
Purpose:	Not Known		Dia/Height:		8"	
Use:	Sanitary		Material:		VCP	
Drain Area:	NA		Lining:			
Category:	NA					
Comment:						
Location Details	5:		Direction of Su	irvey:	Upstream	
US MH:	M-603-003	DS MH:	M-603-026	Total	Length Surveyed (ft)	76.7
0&M Index:	2.00	O&M Quick:	2:	L00	O&M Rating:	2.00
Structural Index:	5.00	Structural Qu	uick: 5	L00	Structural Rating:	5.00
Overall Index:	3.50	Overall Quic		121	Overall Rating:	7.00



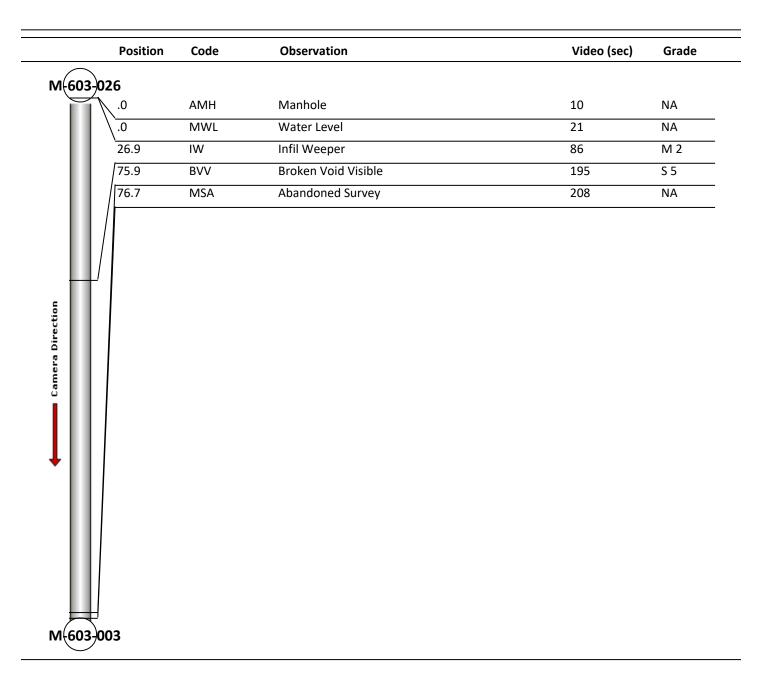


Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-603-003

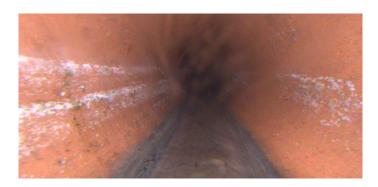

Code: MWL Description: Water Level

Distance (ft): .0 Structural Grade: 0 O&M Grade: 0 Clock Start/From: Clock To: 1st Value: 2nd Value: Value Percent: 5.000 Continuous Index: Within 8" of Joint: NO Remarks:

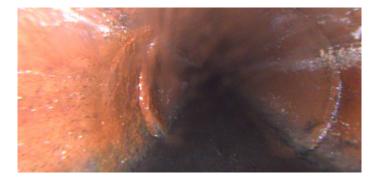


Code: Description:	IW Infil Weeper
Distance (ft):	26.9
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	8
Clock To:	10
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	

## Tuesday, December 8, 2020



Code:BVVDescription:Broken Void Visible

Distance (ft):	75.9	
Structural Grade:	5	
O&M Grade:	0	
Clock Start/From:	1	
Clock To:	4	
1st Value:		
2nd Value:		
Value Percent:		
Continuous Index:		
Within 8" of Joint:	YES	
Remarks:		

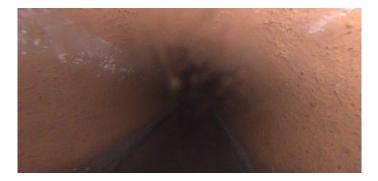

Code:	MSA
Description:	Abandoned Survey

Distance (ft):	76.7
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	bvv