

Date:	04/22/2018	Weather:			Coding:	PACP 6.0
Pipe Length (ft):	129.5	Owner:	NA		Pre Clean:	Not Known
P.O.#:		Surveyor:	Jen Costello		PSR:	P-604-087-088
Customer:		Clean Date:	01/01/1900		Shape:	С
Street:	Summerlin		Flow Control:		Not Controlled	
City:	Hobart, IN		Year Renewed:			
Location:	Light Highway		Tape/Media #:			
Purpose:	Not Known		Dia/Height:		12"	
Use:	Sanitary		Material:		VCP	
Drain Area:	NA		Lining:			
Category:	NA					
Comment:						
Location Details:			Direction of Sur	vey:	Downstream	
US MH:	vi-604-088	DS MH:	M-604-087	Total Ler	ngth Surveyed (ft):	4.9
D&M Index:	2.00	O&M Quick:	220)0 (D&M Rating:	4.00
Structural Index:	4.00	Structural Qu	ick: 410		Structural Rating:	4.00
Overall Index:	2.67	Overall Quick			Overall Rating:	8.00



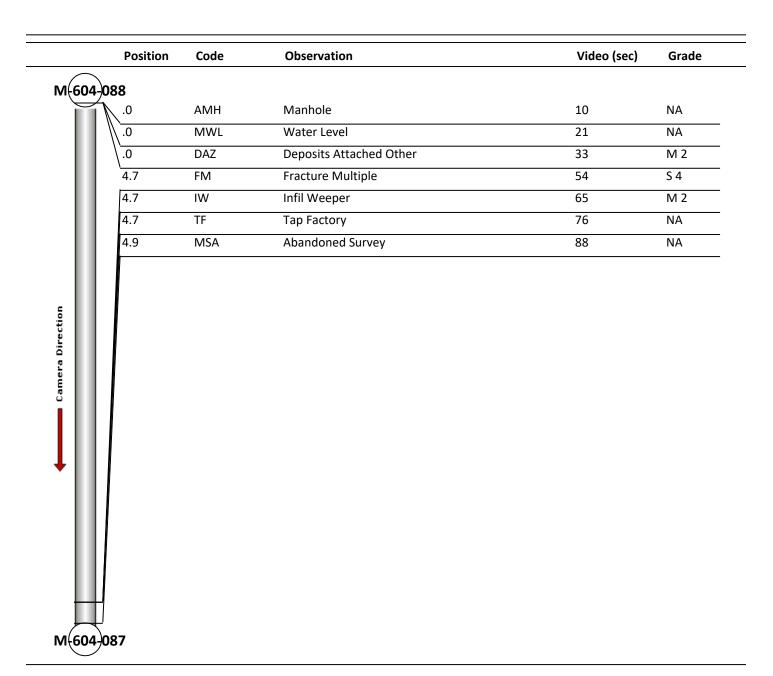


Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-604-088

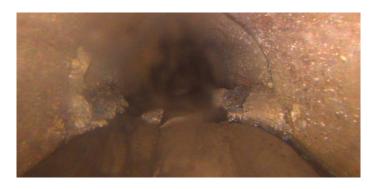

Code: MWL Description: Water Level

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	30.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	

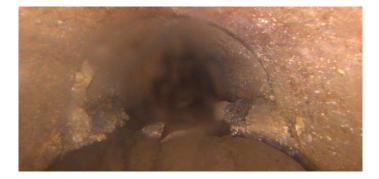

Code:	DAZ
Description:	Deposits Attached Other
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	10.000
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	



Code:FMDescription:Fracture Multiple

Distance (ft):	4.7
Structural Grade:	4
O&M Grade:	0
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	



Code: Description:	IW Infil Weeper
Distance (ft):	4.7
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	



Code:	TF
Description:	Tap Factory
Distance (ft):	4.7
(<i>i</i> ,	-
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	12
Clock To:	
1st Value:	4.000
2nd Value:	
Value Percent:	

2nd Value: Value Percent: Continuous Index: Within 8" of Joint: NO Remarks:

Code: Description:



Distance (ft):	4.9
Distance (ft):	4.5
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	DEBRIS UNDER WATER

MSA

Abandoned Survey