

Date:	04/08/2018	Weather:		Coding:	PACP 6.0
Pipe Length (f	t):	Owner:	City of Hobart	Pre Clean:	Not Known
P.O.#:	209	Surveyor:	B. Helbling	PSR:	P-607-056-055
Customer:	City of Hobart	Clean Date:		Shape:	С
Street:	South Wisconsin Street		Flow Control:	Not Controlled	1
City:	Hobart, IN		Year Renewed:		
Location:	Sidewalk		Tape/Media #:	DEP209	
Purpose:	Routine Assessme	nt	Dia/Height:	15"	
Use:	Sanitary		Material:	PVC	
Drain Area:			Lining:		
Category:	NA				
Comment:	nment: YES501824 Submital 2				
Location Deta	ils:		Direction of Survey	y: Downstream	
US MH:	M-607-056	DS MH:	M-607-055	Total Length Surveyed (ft	): <b>369.0</b>
D&M Index:	2.00	O&M Quick:	2M00	O&M Rating:	148.00
Structural Index		Structural Qu	uick: 0000	Structural Rating:	0.00
Overall Index: 2.00		Overall Quick			148.00



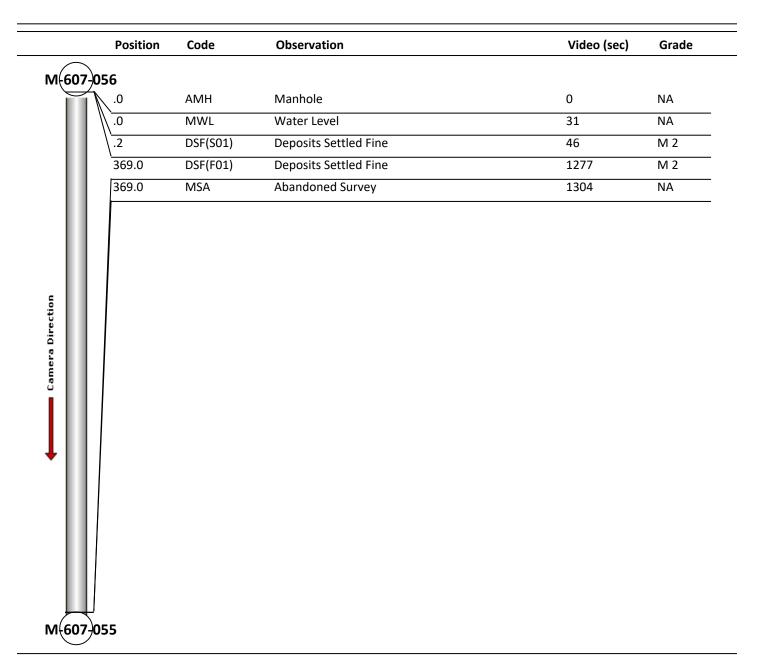

Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-607-056

Thursday, May 4, 2023

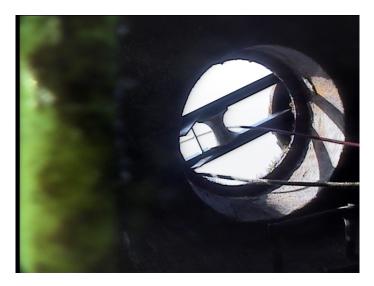

MWL
Water Level
.0
0
0
15.000
NO



Code: Description:	DSF Deposits Settled Fine
Distance (ft): Structural Grade: O&M Grade: Clock Start/From: Clock To: 1st Value: 2nd Value: Value Percent: Continuous Index: Within 8" of Joint: Remarks:	.2 0 2 5 7 5.000 501 NO



Code:	DSF
Description:	<b>Deposits Settled Fine</b>
Distance (ft):	369.0
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	5
Clock To:	7
1st Value:	
2nd Value:	
Value Percent:	10.000
Continuous Index:	F01
Within 8" of Joint:	NO

Remarks:



Code: Description:	MSA Abandoned Survey
Distance (ft):	369.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	Thick sediment