
Date:	04/21/2018	Weather:			Coding:	PACP 6.0
Pipe Length (ft)	: 350.9	Owner:	NA		Pre Clean:	Not Known
P.O.#:		Surveyor:	Jen Costello		PSR:	P-704-013-012
Customer:		Clean Date:	01/01/1900		Shape:	С
Street:	N Michigan Ave		Flow Control:		Not Controlled	
City:	Hobart, IN		Year Renewed:			
Location:	Other		Tape/Media #:			
Purpose:	Not Known		Dia/Height:		8"	
Use:	Sanitary		Material:		VCP	
Drain Area:	NA		Lining:			
Category:	NA					
Comment:						
Location Details	5:		Direction of Sur	vey:	Downstream	
US MH:	M-704-013	DS MH:	M-704-012	Total Len	gth Surveyed (ft):	5.2
0&M Index:	2.00	O&M Quick:	210	00 C	0&M Rating:	2.00
Structural Index:	4.00	Structural Qu	uick: 410		tructural Rating:	4.00
Overall Index:	3.00	Overall Quick)verall Rating:	6.00





Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-704-013

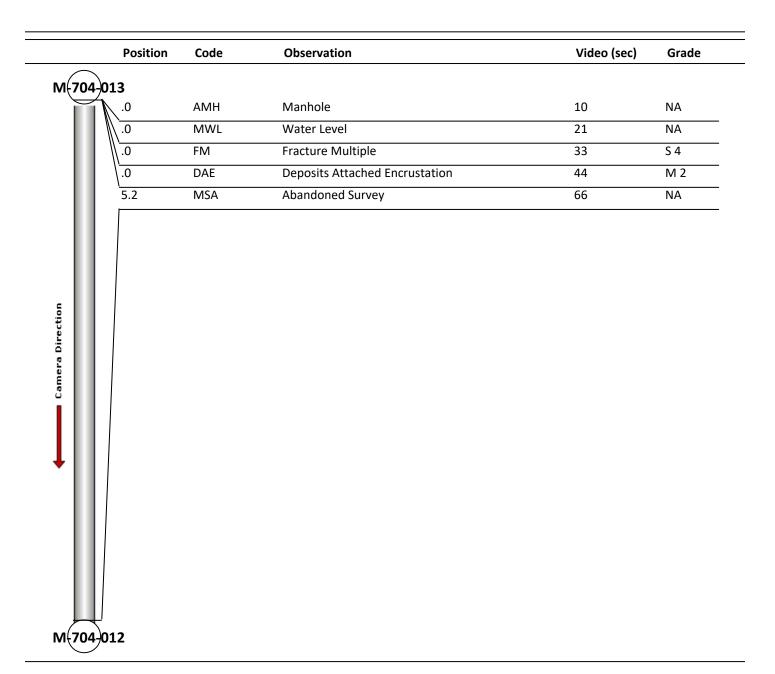


Code: MWL Description: Water Level

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	20.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	



Code: Description:	FM Fracture Multiple
Distance (ft):	.0
Structural Grade:	4
O&M Grade:	0
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	

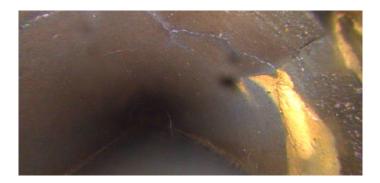

Code:DAEDescription:Deposits Attached Encrustation

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	2
Clock To:	3
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	



Code:	I
Description:	

MSA	
Abandoned Survey	,

Distance (ft):	5.2
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	unknown