
Date:	04/10/2018	Weather:			Coding:	PACP 6.0
Pipe Length (f	t):	Owner:	City of Hobar	t	Pre Clean:	No Pre-Cleaning
P.O.#:	223	Surveyor:	B. Helbling		PSR:	P-708-101-011
Customer:	City of Hobart	Clean Date	:		Shape:	С
Street:	South Lake Park Avenue		Flow Control:		Not Controlled	
City:	Hobart, IN		Year Renewed			
Location:	Yard		Tape/Media #:		DEP223	
Purpose:	Routine Assessme	nt	Dia/Height:		15"	
Use:	Sanitary		Material:		PVC	
Drain Area:			Lining:			
Category:	NA					
Comment:	YES501824 Submit	al 2				
Location Deta	ils:		Direction of Su	rvey:	Downstream	
US MH:	M-708-011	DS MH:	M-708-101	Total	Length Surveyed (ft)	: <b>138.3</b>
0&M Index:	2.00	O&M Quick	20	:00	O&M Rating:	44.00
Structural Index	c: <b>0.00</b>	 Structural Q	uick: OC	00	Structural Rating:	0.00
Overall Index: 2.00		Overall Quid		:00	Overall Rating:	44.00





Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-708-101

Thursday, May 4, 2023

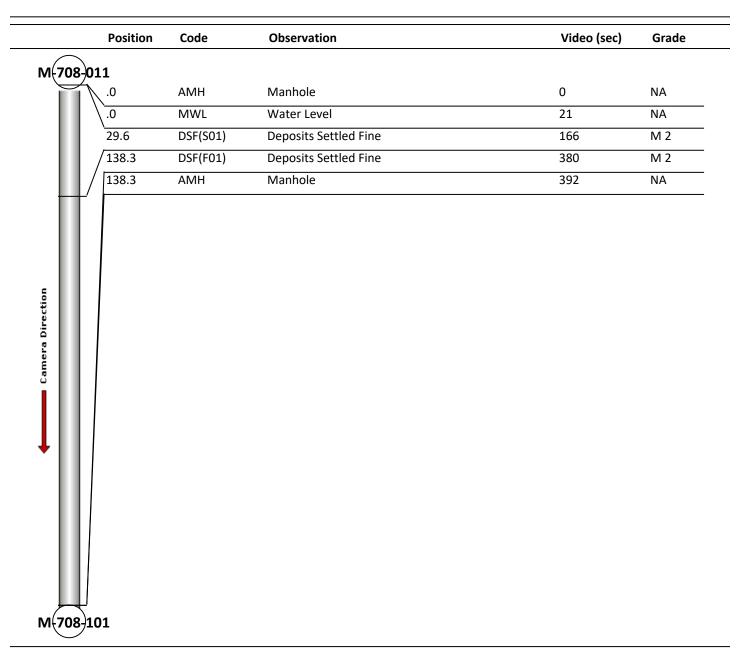

Code:	MWL
Description:	Water Level
<b>D</b> (0)	
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	10.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	



Code: Description:	DSF Deposits Settled Fine
Distance (ft): Structural Grade: O&M Grade: Clock Start/From: Clock To: 1st Value: 2nd Value: Value Percent: Continuous Index: Within 8" of Joint:	29.6 0 2 5 7 5.000 S01 NO
Remarks:	



Code:	DSF
Description:	<b>Deposits Settled Fine</b>
Distance (ft):	138.3
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	5
Clock To:	7
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	F01
Within 8" of Joint:	NO
Remarks:	



Code: Description:	AMH Manhole
Distance (ft):	138.3
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-708-011