

Date:	04/03/2018	Weather:		Coding:	PACP 6.0
Pipe Length (ft): 144.6	Owner:	NA	Pre Clean:	Not Known
P.O.#:		Surveyor:	Jen Costello	PSR:	P-708-114-113
Customer:		Clean Date:	01/01/1900	Shape:	С
Street:	Bracken		Flow Control:	Not Controlled	
City:	Hobart, IN		Year Renewed:		
Location:	Sidewalk		Tape/Media #:		
Purpose:	Maintenance Relat	ed	Dia/Height:	8"	
Use:	Sanitary		Material:	PVC	
Drain Area:	NA		Lining:	Cured in Place	
Category:	NA				
Comment:	Flow direction wro	ng. Reverse setu	ıp.		
Location Detail	s:		Direction of Survey	/: Upstream	
US MH:	M-708-113	DS MH:	M-708-114	Total Length Surveyed (ft)): 32.1
O&M Index:	2.00	O&M Quick:	2600	O&M Rating:	12.00
Structural Index:	0.00	Structural Qu	iick: 0000	Structural Rating:	0.00
Overall Index:	2.00	Overall Quick	2000	Overall Rating:	12.00



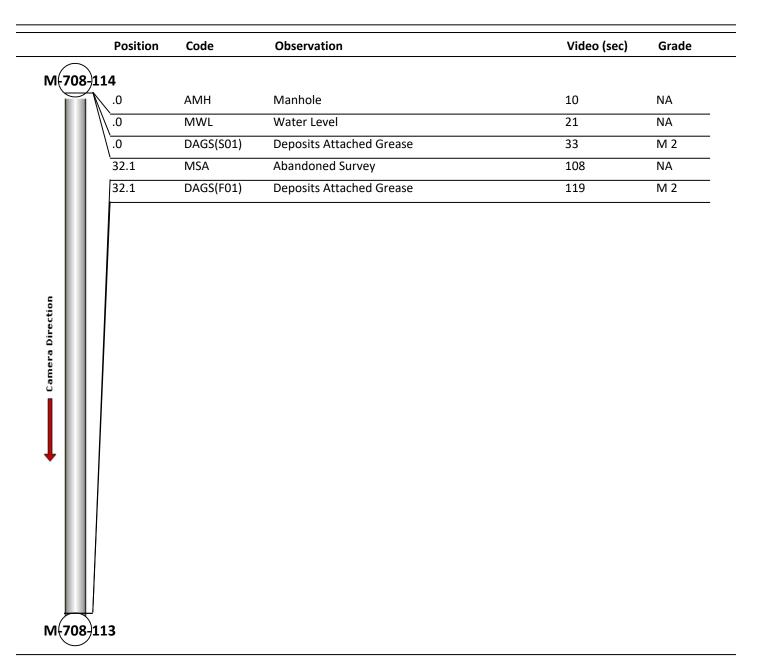


Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-708-114

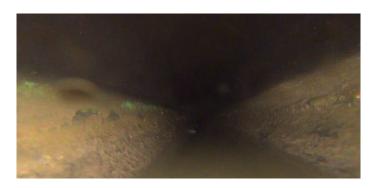

Code: MWL Description: Water Level

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	

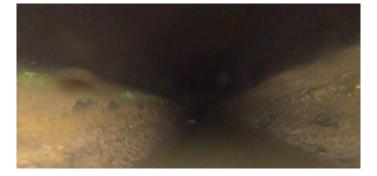

Code:	DAGS
Description:	Deposits Attached Grease

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	7
Clock To:	5
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	S01
Within 8" of Joint:	NO
Remarks:	



Code: MSA Description: Abandoned Survey

OVERTURNED

Code: Description: DAGS Deposits Attached Grease



Distance (ft):	32.1
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	7
Clock To:	5
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	F01
Within 8" of Joint:	NO
Remarks:	