Profile/Photo Observation Report



Date: 04/02/2018 Weather: **PACP 6.0** Coding: Pipe Length (ft): 92.7 Owner: NA Pre Clean: **Not Known** P.O.#: P-708-125-124 Jen Costello PSR: Surveyor:

Customer: Clean Date: 01/01/1900 Shape: C

Street: Redbud Flow Control: Not Controlled

City: Hobart, IN Year Renewed:
Location: Sidewalk Tape/Media #:

Purpose: Maintenance Related Dia/Height: 8"
Use: Sanitary Material: PVC

Drain Area: NA Lining: Cured in Place

Category: NA
Comment: Flow direction wrong.

Location Details: Direction of Survey: **Upstream**

US MH: M-708-124 DS MH: M-708-125 Total Length Surveyed (ft): 90.0

2.00 2B00 32.00 O&M Index: O&M Quick: O&M Rating: 0.00 0000 0.00 Structural Quick: Structural Rating: Structural Index: 2.00 2B00 32.00 Overall Index: Overall Quick: Overall Rating:

708-125	Code	Observation	Video (sec)	Grade
.0	АМН	Manhole	10	NA
0.	MWL	Water Level	22	NA
7.2	DAGS(S01)	Deposits Attached Grease	47	M 2
28.7	TF	Tap Factory	102	NA
74.5	TF	Tap Factory	206	NA
87.4	DAGS(F01)	Deposits Attached Grease	243	M 2
90.0	AMH	Manhole	260	NA

Code:



Description:	Manhole
Distance (ft):	.0
Structural Grade:	-
	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-708-125

AMH



Code: MWL

Description: **Water Level**

Distance (ft): .0 Structural Grade: 0 O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value:

Remarks:

Value Percent: 5.000

Continuous Index:

Within 8" of Joint:

NO

Code: DAGS Description: **Deposits Attached Grease**




Distance (ft): 7.2 Structural Grade: 0 O&M Grade: 2 Clock Start/From: 7 Clock To: 5 1st Value:

2nd Value:

Value Percent: 5.000 Continuous Index: **S01** Within 8" of Joint: NO

Remarks:

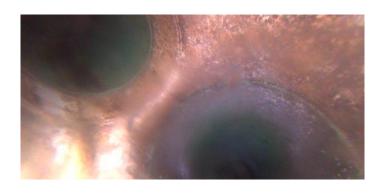

Code: **TF**

Description: Tap Factory

Distance (ft): 28.7
Structural Grade: 0
O&M Grade: 0
Clock Start/From: 10


Clock To:

1st Value:

4.000

2nd Value: Value Percent: Continuous Index: Within 8" of Joint:

Remarks:

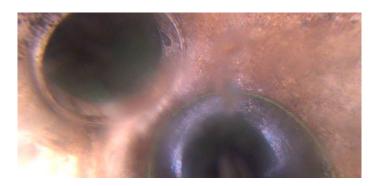

Code: **TF**

Description: Tap Factory

Distance (ft): 74.5
Structural Grade: 0
O&M Grade: 0
Clock Start/From: 10


Clock To:

1st Value: **4.000**

2nd Value: Value Percent: Continuous Index:

Within 8" of Joint:

Remarks:

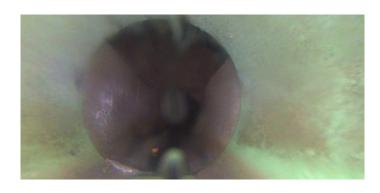

Code: DAGS

Description: Deposits Attached Grease

Distance (ft): 87.4
Structural Grade: 0

O&M Grade: 2

Clock Start/From: 7

Clock To: 5


1st Value:

2nd Value:

Value Percent: 5.000
Continuous Index: F01
Within 8" of Joint: NO

Remarks:

Code: AMH
Description: Manhole

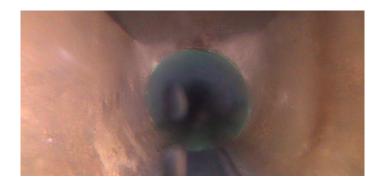

Distance (ft): 90.0
Structural Grade: 0
O&M Grade: 0

Clock Start/From:

Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:

Within 8" of Joint: NO

Remarks: M-708-124