Profile/Photo Observation Report



Date: 03/28/2018 Weather: **PACP 6.0** Coding: Pipe Length (ft): 203.9 Owner: NA Pre Clean: **Not Known** P.O.#: Surveyor: PSR: P-803-015-014 Selasie Honu

Customer: Clean Date: 01/01/1900 Shape: C

Street: N LIBERTY Flow Control: Not Controlled

City: Hobart, IN Year Renewed:
Location: Other Tape/Media #:

Purpose: Not Known Dia/Height: 10"
Use: Sanitary Material: VCP

Drain Area: **NA** Lining:

Category: NA

Comment:

Location Details: Direction of Survey: **Upstream**

US MH: M-803-014 DS MH: M-803-015 Total Length Surveyed (ft): 24.4

1.00 1100 1.00 O&M Index: O&M Quick: O&M Rating: 3.00 3100 3.00 Structural Quick: Structural Rating: Structural Index: 4.00 2.00 3111 Overall Quick: Overall Rating: Overall Index:

| | on Code | Observation | Video (sec) | Grade |
|-------------------------------------|---------|------------------|-------------|-------|
| 1 (803) 015 | | | | |
| 0. | AMH | Manhole | 10 | NA |
| 0. | MWL | Water Level | 21 | NA |
| 12.8 | RFJ | Roots Fine Joint | 58 | M 1 |
| 16.3 | CM | Crack Multiple | 77 | S 3 |
| 24.4 | MSA | Abandoned Survey | 105 | NA |
| | | | | |

Code:



| Description: | Manhole |
|----------------------------------|-----------------|
| Distance (ft): | .0 |
| Structural Grade: O&M Grade: | 0 |
| Clock Start/From: | |
| Clock To: 1st Value: | |
| 2nd Value: | |
| Value Percent: Continuous Index: | |
| Within 8" of Joint: Remarks: | NO M-803-015 |

AMH



Code: MWL Description: **Water Level**

Distance (ft): .0 Structural Grade: 0 O&M Grade: 0 Clock Start/From:

Clock To: 1st Value: 2nd Value:

Value Percent: 5.000

Continuous Index:

Within 8" of Joint: NO

Remarks:

Code: RFJ Description: **Roots Fine Joint**




Distance (ft): 12.8 Structural Grade: 0 O&M Grade: 1 Clock Start/From: 9 Clock To: 3 1st Value: 2nd Value:

Continuous Index: Within 8" of Joint:

Value Percent:

Remarks:

YES

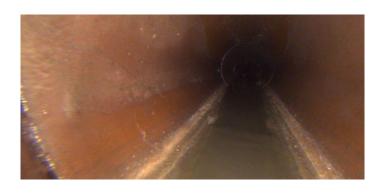

Code: CM

Description: Crack Multiple

Distance (ft): 16.3
Structural Grade: 3
O&M Grade: 0
Clock Start/From: 8
Clock To: 9

1st Value: 2nd Value: Value Percent: Continuous Index:


Within 8" of Joint:

Remarks:

YES



Description: Abandoned Survey

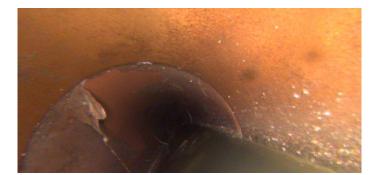

Distance (ft): 24.4
Structural Grade: 0

O&M Grade: 0

Clock Start/From:

Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:

Within 8" of Joint: NO Remarks: debris