
Profile/Ph	oto Observation	Report				RedZone
Date:	10/01/2018	Weather:			Coding:	PACP 6.0
Pipe Length (ft)	: 213.4	Owner:	NA		Pre Clean:	Not Known
P.O.#:		Surveyor:	Michael Carl	ino	PSR:	P-803-017-016
Customer:		Clean Date:	01/01/1900		Shape:	с
Street:	40th. Ave.		Flow Control:		Not Controlled	
City:	Hobart, IN		Year Renewed	:		
Location:	Light Highway		Tape/Media #			
Purpose:	Routine Assessment	:	Dia/Height:		12"	
Use:	Sanitary		Material:		VCP	
Drain Area:	NA		Lining:			
Category:	NA					
Comment:						
Location Details	s:		Direction of Su	irvey:	Downstream	
US MH:	M-803-016	DS MH:	M-803-017	Total	Length Surveyed (ft):	24.1
0&M Index:	1.00	O&M Quick:	1	200	O&M Rating:	2.00
structural Index:	0.00	 Structural Qu	iick: 0	000	Structural Rating:	0.00
Overall Index:	1.00	Overall Quick	1	200	Overall Rating:	2.00






Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-803-016


Tuesday, December 8, 2020

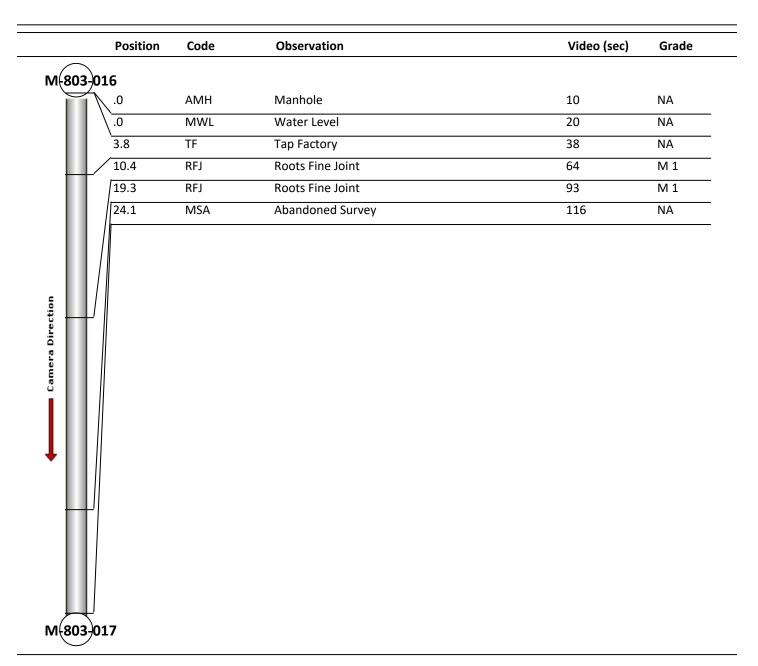

Code:	MWL
Description:	Water Level
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	25.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	

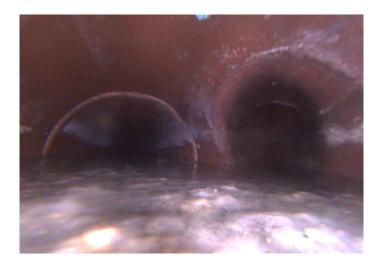

Code: Description:	TF Tap Factory
Distance (ft):	3.8
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	3
Clock To:	
1st Value:	6.000
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	
Remarks:	

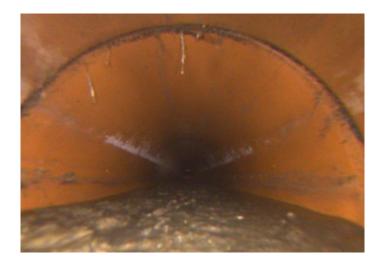

Code:	RFJ
Description:	Roots Fine Joint
Distance (ft):	10.4
Structural Grade:	0
O&M Grade:	1
Clock Start/From:	11
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	



Code: Description:	RFJ Roots Fine Joint
Distance (ft): Structural Grade: O&M Grade: Clock Start/From: Clock To: 1st Value: 2nd Value: Value Percent: Continuous Index:	19.3 0 1 9 12
Within 8" of Joint: Remarks:	YES



Code: Description:	MSA Abandoned Survey
Distance (ft):	24.1
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	Possible Debris