
Profile/Ph	oto Observatior	n Report				RedZo
Date:	03/28/2018	Weather:			Coding:	PACP 6.0
Pipe Length (ft)	): <b>167.2</b>	Owner:	NA		Pre Clean:	Not Known
P.O.#:		Surveyor:	Selasie Honu		PSR:	P-803-026-034
Customer:		Clean Date:	01/01/1900		Shape:	С
Street:	N INDIANA ST		Flow Control:		Not Controlled	
City:	Hobart, IN		Year Renewed	:		
Location:	Other		Tape/Media #:			
Purpose:	Not Known		Dia/Height:		10"	
Use:	Sanitary		Material:		VCP	
Drain Area:	NA		Lining:			
Category:	NA					
Comment:						
Location Detail	s:		Direction of Su	rvey:	Downstream	
US MH:	M-803-034	DS MH:	M-803-026	Total Le	ngth Surveyed (ft):	26.2
D&M Index:	3.00	O&M Quick:	35	500	O&M Rating:	15.00
Structural Index:	0.00	Structural Qu	iick: 00	000	Structural Rating:	0.00
Overall Index:	3.00	Overall Quick			Overall Rating:	15.00





Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-803-034

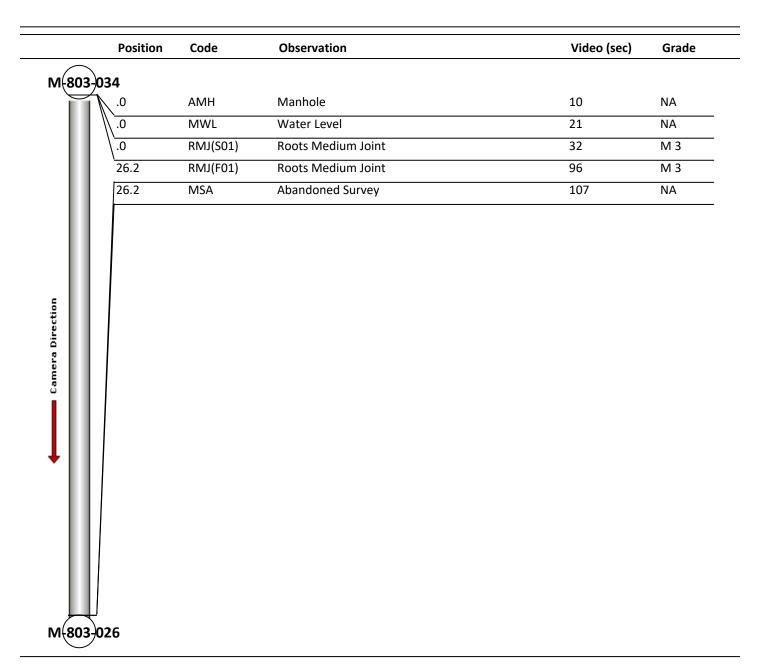

Code: MWL Description: Water Level

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	



Code:	RMJ
Description:	<b>Roots Medium Joint</b>

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	3
Clock Start/From:	7
Clock To:	5
1st Value:	
2nd Value:	
Value Percent:	40.000
Continuous Index:	S01
Within 8" of Joint:	YES
Remarks:	



Code:RMJDescription:Roots Medium Joint

Distance (ft):	26.2
Structural Grade:	0
O&M Grade:	3
Clock Start/From:	7
Clock To:	5
1st Value:	
2nd Value:	
Value Percent:	40.000
Continuous Index:	F01
Within 8" of Joint:	YES
Remarks:	

Description:	

Code:

MSA	
Abandoned S	Survey

Distance (ft):	26.2
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	camera stoppedd