

Profile/Photo Observation Report



Date:	04/19/2018	Weather:		Coding:	PACP 6.0
Pipe Length (ft):	132.4	Owner:	NA	Pre Clean:	Not Known
P.O.#:		Surveyor:	Jen Costello	PSR:	P-805-058-056
Customer:		Clean Date:	01/01/1900	Shape:	C

Street:	S Indiana St.	Flow Control:	Not Controlled
City:	Hobart, IN	Year Renewed:	
Location:	Other	Tape/Media #:	
Purpose:	Not Known	Dia/Height:	12"
Use:	Sanitary	Material:	VCP
Drain Area:	NA	Lining:	
Category:	NA		
Comment:			

Location Details:		Direction of Survey:	Downstream
US MH:	M-805-058	DS MH:	M-805-056
		Total Length Surveyed (ft):	3.3

O&M Index:	1.00	O&M Quick:	1100	O&M Rating:	1.00
Structural Index:	2.00	Structural Quick:	3111	Structural Rating:	4.00
Overall Index:	1.67	Overall Quick:	3112	Overall Rating:	5.00

The diagram illustrates a vertical pipe inspection. A vertical gray pipe is shown with a red arrow pointing downwards, labeled "Camera Direction". The pipe is labeled with "M-805-058" at the top and "M-805-056" at the bottom. A table to the right of the pipe lists inspection data points corresponding to the pipe's length.

Position	Code	Observation	Video (sec)	Grade
.0	AMH	Manhole	10	NA
.0	MWL	Water Level	21	NA
.0	FL	Fracture Longitudinal	33	S 3
.0	JOM	Joint Offset Medium	44	S 1
1.2	RFJ	Roots Fine Joint	58	M 1
2.6	MSA	Abandoned Survey	73	NA





Code: **MWL**
Description: **Water Level**

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent: **30.000**
Continuous Index:
Within 8" of Joint: **NO**
Remarks:



Code: **FL**
Description: **Fracture Longitudinal**

Distance (ft): **.0**
Structural Grade: **3**
O&M Grade: **0**
Clock Start/From: **12**
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **YES**
Remarks:

Code: **JOM**
Description: **Joint Offset Medium**




Distance (ft): **.0**
Structural Grade: **1**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks:

Code: **RFJ**
Description: **Roots Fine Joint**



Distance (ft): **1.2**
Structural Grade: **0**
O&M Grade: **1**
Clock Start/From: **1**
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **YES**
Remarks:

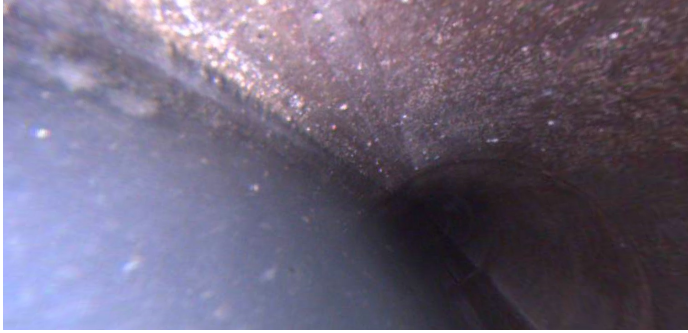

Code:	MSA
Description:	Abandoned Survey
Distance (ft):	2.6
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	debris under water